



Engineering
& Design

Wetland Delineation Report

NCHP Phase 3B Project

Colliers Engineering & Design Project Number: 21004202A

December 20, 2024

Prepared for:

NiSource Inc.
801 E. 86th Avenue
Merrillville, IN 46410

Prepared by:

Colliers Engineering & Design, Inc.
1501 Reedsdale Street,
Suite 302
Pittsburgh, PA 15233
Main: 412-618-5390
Colliersengineering.com



Table of Contents

EXECUTIVE SUMMARY	1
1.0 PROJECT INFORMATION	2
2.0 INTRODUCTION	3
3.0 PROPERTY DESCRIPTION	4
4.0 BACKGROUND INFORMATION	5
4.1 U.S. Geological Survey Map	5
4.2 Soil Survey	5
5.0 WETLAND & SURFACE WATER DELINEATION METHODOLOGY	7
6.0 WETLAND AND SURFACE WATER DELINEATION RESULTS.....	8
6.1 Wetland and Surface Water Summary	8
6.2 Vegetation	8
6.3 Soils.....	8
6.4 Hydrology	9
7.0 WETLAND DELINEATION CONCLUSION	10
8.0 REFERENCES.....	11

APPENDICES

- APPENDIX A - FIGURES
- APPENDIX B - DATA FORMS
- APPENDIX C - USACE ANTECEDENT PRECIPITATION TOOL
- APPENDIX D - PHOTOGRAPHS



EXECUTIVE SUMMARY

On behalf of NiSource Inc., Colliers Engineering & Design (CED) conducted field delineations for the North Columbus High Pressure (NCHP) Pipeline Project – Phase 3B within Franklin County, Ohio (hereinafter described as “Survey Corridor”). The Survey Corridor begins at latitudinal coordinate 40.021989 N and longitudinal coordinate -82.950258 W and ends at latitudinal coordinate 40.018147 N and longitudinal coordinate -82.882347 W. The Survey Corridor is located approximately 5 miles north of Columbus, Ohio. Access to the Survey Corridor can be achieved from Woodlawn Road, Granville Street, W Johnstown Road, James Road, and Agler Road.

The Project Study Area is comprised of a 100-foot wide survey corridor centered on the proposed pipeline alignment for approximately 3.75 miles. The Survey Corridor was investigated to identify potential jurisdictional Waters of the U.S. (WOTUS) and wetlands subject to Federal or State regulatory jurisdiction. The delineation methodologies developed by the USACE and the USEPA, as described in the *1987 Corps of Engineers Wetlands Delineation Manual, Technical Report Y-87-1* and the *Regional Supplement to the Corps of Engineers Wetland Delineation Manual: Midwest Region (Version 2.0)* and the subsequently issued USACE regulatory guidance regarding the identification of jurisdictional stream channels through the recognition of field indicators of an ordinary high-water mark within drainage features (Environmental Laboratory, 1987; USACE 2012; USACE 2005) were utilized during our investigation. The location and size of jurisdictional areas delineated are shown on the attached Figure 5. Delineation Results (**Appendix A**).

Based on the field investigations, five (5) wetland features, one (1) palustrine unconsolidated bottom (pond) feature, and seven (7) stream features were delineated within the Survey Corridor by CED on March 2nd and 3rd, 2022, October 24, 2022, and December 17, 2024. A total of 0.67 acres of palustrine forested (PFO) wetland, 0.23 acres of palustrine emergent (PEM) wetland, 0.18 acres of pond (palustrine unconsolidated bottom – PUB), 806 linear feet of perennial (R3) stream, and 1,120 linear feet of intermittent (R4) stream were delineated. It is CED’s professional opinion that Wetland Features “5” through “9” and Stream Features “4” through “10” are considered jurisdictional WOTUS since they are and/or drain into Big Walnut Creek and Alum Creek. These stream and wetland features can be considered jurisdictional WOTUS since they connect and/or are directly connected to Big Walnut Creek and Alum Creek, which eventually drain to the Scioto River. The location and size of jurisdictional areas delineated are shown on Figure 5. Delineation Results (**Appendix A**).



1.0 PROJECT INFORMATION

Project Name	North Columbus High Pressure (NCHP) Pipeline Project – Phase 3B
Project Location	Woodlawn Road, Granville Street, W Johnstown Road, James Road, and Agler Road
Municipality	Columbus
County	Franklin
State	Ohio
Latitude/Longitude	40.021989 N / -82.950258 W to 40.018147 N / -82.882347 W
Survey Corridor Size	+/- 3.75 mi 100 feet wide survey corridor
U.S.G.S. Quadrangle	Northeast Columbus OH
Potential Jurisdictional Waters of the U.S. (WOTUS) and wetlands	See Aquatic Resource Area Summary Table on Page 5
River Basin (HUC) & sub-watershed	Upper Scioto Basin: 8 Digit HUC Code 05060001
Nearest Stream	Big Walnut Creek, Alum Creek
Navigable Water Nexus	Stream features delineated on the Survey Corridor would be considered jurisdictional WOTUS and wetlands since these features drain towards Big Walnut Creek and Alum Creek
Isolated Wetlands/Waters Present (Yes/No)	No



2.0 INTRODUCTION

On behalf of NiSource Inc., Colliers Engineering & Design (CED) conducted field delineations for the North Columbus High Pressure (NCHP) Pipeline Project – Phase 3B located in the greater North Columbus area within Franklin County, Ohio (hereinafter described as “Survey Corridor”). The Survey Corridor begins at latitudinal coordinate 40.021989 N and longitudinal coordinate -82.950258 W and ends at latitudinal coordinate 40.018147 N and longitudinal coordinate -82.882347 W. The Survey Corridor is located approximately 5 miles north of Columbus, Ohio. Access to the Survey Corridor can be achieved from Woodlawn Road, Granville Street, W Johnstown Road, James Road, and Agler Road. The Survey Corridor is bordered by residential homes, commercial properties, and forested areas. There are unnamed tributaries located within the Survey Corridor that eventually drain to Big Walnut Creek and Alum Creek.

The Survey Corridor was investigated to identify potential jurisdictional Waters of the U.S. (WOTUS) and wetlands subject to Federal or State regulatory jurisdiction. According to the U.S. Army Corps of Engineers (USACE) and U.S. Environmental Protection Agency (USEPA) regulations described in Section 404 of the Clean Water Act (33 CFR Section 328.3 and 40 CFR Section 230.3) respectively, wetlands are "...areas that are inundated or saturated with surface or ground water at a frequency and duration sufficient to support, and that under normal circumstances do support, a prevalence of vegetation typically adapted for life in saturated soil conditions."



3.0 PROPERTY DESCRIPTION

The Survey Corridor is located within the Upper Scioto River Basin (8 Digit HUC Code 05060001). Access to the Survey Corridor can be achieved from Woodlawn Road, Granville Street, W Johnstown Road, James Road, and Agler Road. The western section of the Survey Corridor drains south and east towards Alum Creek and the central and eastern sections of the Survey Corridor drain to Big Walnut Creek. The Survey Corridor does contain a floodway and a floodplain according to FEMA Floodplain Panel Maps 39049C0189K, 39049C0193K, and 39049C0194K (eff. 6/17/2008). The Survey Corridor contains approximately 35% forested communities and 65% residential properties and commercial properties. The forested areas are comprised of a mixture of oak, tulip poplar, red maple, pine, and sweetgum species that dominate the canopy layer. Big Walnut Creek is located in the eastern section and Alum Creek is located in the western section of the Survey Corridor, flowing north to south. Unnamed tributaries can be found throughout the Survey Corridor eventually discharging into Big Walnut Creek and Alum Creek.

4.0 BACKGROUND INFORMATION

Prior to on-site field investigations, several publicly available sources of information were reviewed to determine the likelihood of wetlands and surface waters occurring within Survey Corridor. These mapping resources generally include, but are not limited to, the United States Geological Survey (USGS) maps (Figure 1. Project Location Map, **Appendix A**), the U.S. Department of Agriculture - Natural Resource Conservation Service (NRCS) soils database (Figure 2. Soil Series Map, **Appendix A**), National Hydrography Dataset (NHD), and the U.S. Fish & Wildlife Service National Wetlands Inventory (NWI) database (Figure 3. National Wetlands Inventory Map, **Appendix A**).

4.1 U.S. GEOLOGICAL SURVEY MAP

The Survey Corridor appears on the *Northeast Columbus OH* Quadrangle USGS Maps (Figure 1. Project Location Map, **Appendix A**) and is depicted as developed properties which contains approximately 35% forested areas habitat communities and 65% residential and commercial properties. The USGS also depicts unnamed tributaries located within the project limits. Residential and forested areas are located within the vicinity of the Survey Corridor to the north, south, east, and west. Elevations at the Survey Corridor range from approximately 770 to 830 feet above mean sea level (MSL) based on the USGS map.

4.2 SOIL SURVEY

The NRCS Web Soil Survey depicts the following 19 soil series map units within the Survey Corridor and Table 1 provides a description of the properties and qualities of each soil:

Table 1. NCHP Phase 3B Project USDA NRCS Soil Series

Map Unit Symbol	Map Unit Name	Drainage Class	Runoff Class	Depth to Water Table
AdC2	Alexandria silt loam, 6 to 12 percent slopes, eroded	Well Drained	High	More than 80 inches
BeB	Bennington silt loam, 2 to 6 percent slopes	Somewhat Poorly Drained	High	About 6 to 12 inches
BfA	Bennington-Urban land complex, 0 to 2 percent slopes	Somewhat Poorly Drained	High	About 6 to 12 inches
CbC	Cardington-Urban land complex, 6 to 12 percent slopes	Moderately Well Drained	High	About 24 to 36 inches
Crd1B1	Cardington silt loam, 2 to 6 percent slopes	Moderately Well Drained	Medium	About 12 to 24 inches
Ee	Eel silt loam, 0 to 2 percent slopes, occasionally flooded	Moderately Well Drained	Low	About 15 to 24 inches

Map Unit Symbol	Map Unit Name	Drainage Class	Runoff Class	Depth to Water Table
EIB	Eldean silt loam, 2 to 6 percent slopes	Well Drained	Low	More than 80 inches
EID2	Eldean silt loam, 12 to 18 percent slopes, eroded	Well Drained	High	More than 80 inches
So	Sloan silt loam, Columbus Lowland, 0-2 percent slopes, frequently flooded	Very Poorly Drained	Negligible	About 0 to 6 inches
Mh	Medway silt loam, occasionally flooded	Moderately Well Drained	Low	About 18 to 36 inches
Pm	Pewamo silty clay loam, low carbonate till, 0 to 2 percent slopes	Very Poorly Drained	Negligible	About 0 to 12 inches
Sh	Shoals silt loam, occasionally flooded	Somewhat Poorly Drained	Very low	About 12 to 36 inches
Pn	Pewamo low carbonate till-Urban land complex, 0 to 2 percent slopes	Very Poorly Drained	Negligible	About 0 to 12 inches
EIC2	Eldean silt loam, 6 to 12 percent slopes, eroded	Well Drained	High	More than 80 inches
AdE2	Alexandria silt loam, 18 to 25 percent slopes, eroded	Well Drained	Very High	More than 80 inches
KeB	Kendallville silt loam, 2 to 6 percent slopes	Well Drained	Low	More than 80 inches
Cn	Condit silt loam, 0 to 1 percent slopes	Poorly Drained	Negligible	About 0 to 12 inches
BeA	Bennington silt loam, 0 to 2 percent slopes	Somewhat Poorly Drained	High	About 6 to 12 inches
Ut	Udorthents-Urban land complex, gently rolling	-	-	More than 80 inches

Of the 19 mapped soil units, seven (7) soil units: Alexandria silt loam (AdC2), Bennington silt loam (BeB), Bennington-Urban land complex (BfA), Cardington silt loam (Crd1B1), Eel silt loam (Ee), Sloan silt loam, Columbus Lowland (So), and Pewamo silty clay loam (Pm), are listed as being hydric.



5.0 WETLAND & SURFACE WATER DELINEATION METHODOLOGY

The wetland delineation methodologies developed by the USACE and the USEPA, as described in the *1987 Corps of Engineers Wetlands Delineation Manual, Technical Report Y-87-1* and the *Regional Supplement to the Corps of Engineers Wetland Delineation Manual: Midwest Region* (Version 2.0) and subsequently issued USACE regulatory guidance regarding the identification of jurisdictional stream channels through the recognition of field indicators of an ordinary high-water mark within drainage features (Environmental Laboratory, 1987; USACE 2012; USACE 2005), were utilized during our investigation. These methodologies generally involve the review of three parameters (vegetation, soils, hydrology) when making a wetland or non-wetland determination.

The Survey Corridor was walked, community types were characterized, and wetland and surface water boundaries were flagged. Sample stations were established along the boundaries to examine vegetation, soils, and hydrology. Using this data, boundaries were established based on changes in vegetation, soils, hydrology, and surface water characteristics.

6.0 WETLAND AND SURFACE WATER DELINEATION RESULTS

6.1 WETLAND AND SURFACE WATER SUMMARY

On-site field investigations of the Survey Corridor were conducted by CED on March 2nd & 3rd, 2022, October 24, 2022, and December 17, 2024. The on-site delineation did verify the presence of wetlands and surface waters within Survey Corridor. A summary of the aquatic resources identified within the Survey Corridor is provided below in Table 2: Aquatic Resource Summary. The location and size of the aquatic resources delineated are shown on Figure 5. Wetland Delineation Map (**Appendix A**).

Table 2: Aquatic Resource Area Summary Table

Aquatic Resource	PFO Area (AC)	PEM Area (AC)	Aquatic Resource	PUB Area (AC)	Aquatic Resource	R3 Length (LF)	R4 Length (LF)
W-5	0.03	-	PUB3	0.18	S-4	-	204
W-6	-	0.23	-	-	S-5	-	750
W-7	0.29	-	-	-	S-6	-	166
W-8	0.02	-	-	-	S-7	155	-
W-9	0.33	-	-	-	S-8	39	-
-	-	-	-	-	S-9	337	-
-	-	-	-	-	S-10	275	-
Total Wetlands by Class (AC)	0.67	0.23	Total Pond (AC)	0.18	Total Stream by Class (LF)	806	1,120
Total Wetlands (AC)	0.9				Total Stream (LF)	1,926	

Note 1: Cowardin Classification; PFO = palustrine forested wetland; PEM = palustrine emergent wetland; PUB = palustrine unconsolidated bottom (pond), R3 = perennial stream, R4 = intermittent stream

6.2 VEGETATION

Representative plant species within the wetland areas include the following: green ash (*Fraxinus pennsylvanica*), red maple (*Acer rubrum*), sycamore (*Platanus occidentalis*), eastern cottonwood (*Populus deltoides*), amur honeysuckle (*Lonicera mackaii*), multiflora rose (*Rosa multiflora*), reed canary grass (*Phalaris arundinacea*), and broadleaf cattail (*Typha latifolia*).

Representative plant species within the upland areas include the following: eastern cottonwood, red maple, black cherry (*Prunus serotina*), Indian olive (*Elaeagnus angustifolia*), Tatarian honeysuckle (*Lonicera tatarica*), wild privet (*Ligustrum vulgare*), Callery pear (*Pyrus calleryana*) and tall fescue (*Schedonorus arundinaceus*).

6.3 SOILS

Hydric soils are defined as soils that formed under conditions of saturation, flooding, or ponding long enough during the growing season to develop anaerobic conditions in the upper part of the soil (USDA 2003). The soils in the wetland areas were variable, but for the most part, exhibited low chroma matrices with redoximorphic



features. Soils within the wetland areas on-site exhibit low chroma matrix colors and concentrations that are characteristic of reducing anaerobic conditions associated within the formation of hydric soils. Wetland soils were typically dark grayish brown (10YR 4/2), weak red (2.5Y 4/2 and 2.5Y 5/2), and dark gray (10YR 4/1) within the upper 16 inches. Redox concentrations greater than 3% were observed between 0 and 16 inches below soil surface and are typically dark yellowish brown (10YR 4/6). Soils within jurisdictional areas meet the F3 Depleted Matrix hydric soil indicator. Textures within the jurisdictional areas include clay, silt, and silty clay loam. The upland soils within each area varied from very dark grayish brown (10YR 3/2), yellowish brown (10YR 5/4 and 10YR 5/6), and dark brown (10YR 3/3) and (10YR 5/6) within the upper 16 inches. Soil textures include silt and clay.

6.4 HYDROLOGY

On-site field investigations of the Survey Corridor were conducted by CED on March 2nd & 3rd, 2022, October 24, 2022, and December 17, 2024. The USACE Antecedent Precipitation Tool (APT) was utilized for the Survey Corridor and is provided **Appendix B**. Based the USACE APT tool, the on-site field investigations were conducted in "Wetter than Normal" precipitation conditions in March 2022, "Normal Conditions" in October 2022, and "Normal Conditions" in December 2024 (with a 30-day rolling total).

The delineated wetlands exhibited primary and secondary indicators of wetland hydrology. Positive indicators of wetland hydrology on the property included the following: surface water (A1), high water table (A2), saturation (A3), water marks (B1), and water-stained leaves (B9). Secondary indicators include drainage patterns (B10), and the FAC-neutral test (D5). Indicators of wetland hydrology are largely absent in upland areas.



7.0 WETLAND DELINEATION CONCLUSION

Five (5) wetland features, one (1) palustrine unconsolidated bottom (pond) feature, and seven (7) stream features were delineated within the Survey Corridor by CED on March 2nd and 3rd, 2022, October 24, 2022, and December 17, 2024. A total of 0.67 acres of palustrine forested (PFO) wetland, 0.23 acres of palustrine emergent (PEM) wetland, 0.18 acres of pond (palustrine unconsolidated bottom – PUB), 806 linear feet of perennial (R3) stream, and 1,120 linear feet of intermittent (R4) stream were delineated. Field investigations were conducted in accordance with the manuals, methodologies, and regulatory guidance procedures as stated in Section 5.0 Wetland and Surface Water Delineation Methodology.

It is CED's professional opinion that Wetland Features "5" through "9" and Stream Features "4" through "10" are considered jurisdictional WOTUS since they are and/or drain into Big Walnut Creek and Alum Creek. These stream and wetland features can be considered jurisdictional WOTUS since they connect to Big Walnut Creek and Alum Creek, which eventually drain to the Scioto River. The location and size of jurisdictional areas delineated are shown on Figure 5. Delineation Results (**Appendix A**).




8.0 REFERENCES

- Cowardin, L. M., V. Carter, F. C. Golet, and E. T. LaRoe. 1979. Classification of wetlands and deepwater habitats of the United States. U.S. Department of the Interior, Fish and Wildlife Service, Washington, D.C.
- Environmental Laboratory. 1987. "Corps of Engineers Wetlands Delineation Manual" Technical Report Y-87-1. US Army Engineer Waterways Experiment Station, Vicksburg, Miss.
- Environmental Laboratory. 2012. "Regional Supplement to the Corps of Engineers Wetland Delineation Manual: Eastern Mountains and Piedmont Region (Version 2.0)". Technical Report ERDC/EL TR-09-19. US Army Engineer Research and Development Center, Vicksburg, Miss.
- Federal Interagency Committee for Wetland Delineation. 1989. Federal Manual for Identifying and Delineation Jurisdictional Wetlands. U.S. Army Corps of Engineers, U.S. Environmental Protection Agency, U.S. Fish and Wildlife Service, and U.S.D.A. Soil Conservation Service, Washington D.C. Cooperative technical publication. 76 pp. plus appendices.
- Federal Emergency Management Agency (FEMA). 2019. Flood Map Service Center. <https://msc.fema.gov/portal>.
- National List of Hydric Soils 2010, United States Department of Agriculture Natural Resource Conservation Service, <https://www.nrcs.usda.gov/wps/portal/nrcs/main/soils/use/hydric/>
- Ohio Environmental Protection Agency (OhioEPA)*. (2022, February 25). Qualitative Habitat Evaluation Index (QHEI). https://ohioepa.custhelp.com/app/answers/detail/a_id/470/%7E/qualitative-habitat-evaluation-index-%28qhei%29
- United States Department of Agriculture. Natural Resources Conservation Service <http://websoilsurvey.nrcs.usda.gov/app/HomePage.htm>
- United States Fish and Wildlife Service. National Wetlands Inventory <http://www.fws.gov/nwi/Overview.html>
- USDA, NRCS. 2003. Field Indicators of Hydric Soils in the United States, Version 5.01, G.W. Hurt, P.M. Whited, and R.F. Pringle (eds.). USDA, NRCS in cooperation with the National technical Committee for Hydric Soils, Fort Worth, TX.




Appendix

Appendix A | Figures

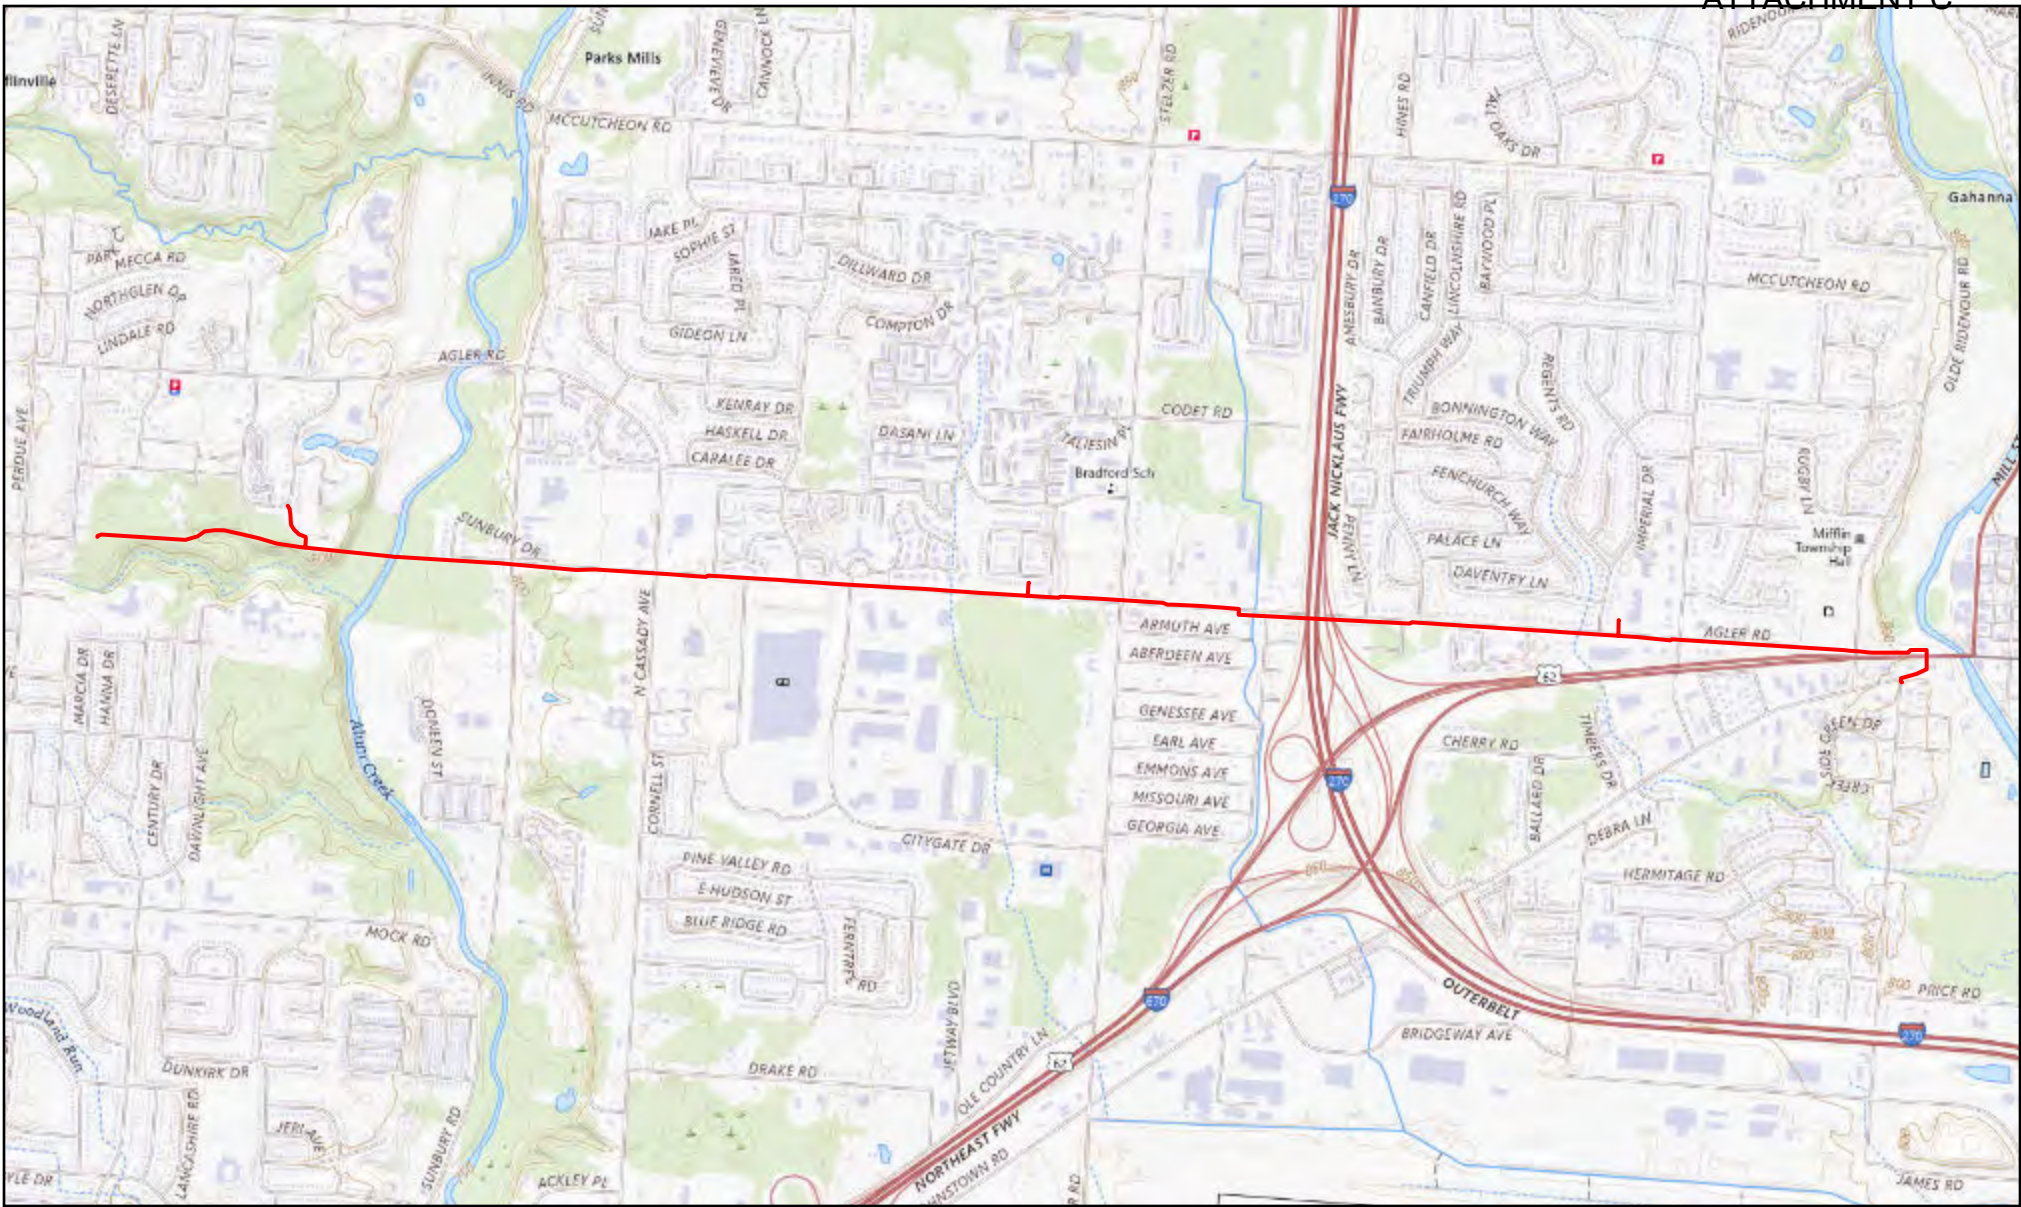

Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design
 T: 610.254.9140
 www.colliersengineering.com

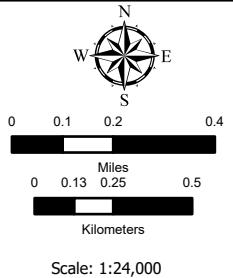

— Project Alignment

Project Location Map
NHCP Phase 3B Project
Franklin County, Ohio


Date Saved: 12/20/2024 CED PN: 21004202A Revised by: frances.buchank





Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design
 T: 610.254.9140
 www.colliersengineering.com

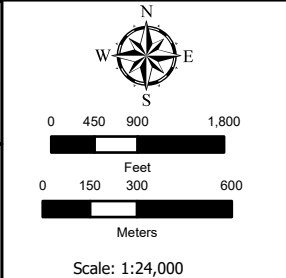


— Project Alignment
 — Soil Units (SSURGO)

Soil Series Map
NHCP Phase 3B Project
Franklin County, Ohio

Date Saved: 12/20/2024 CED PN: 21004202A Revised by: frances.buchank



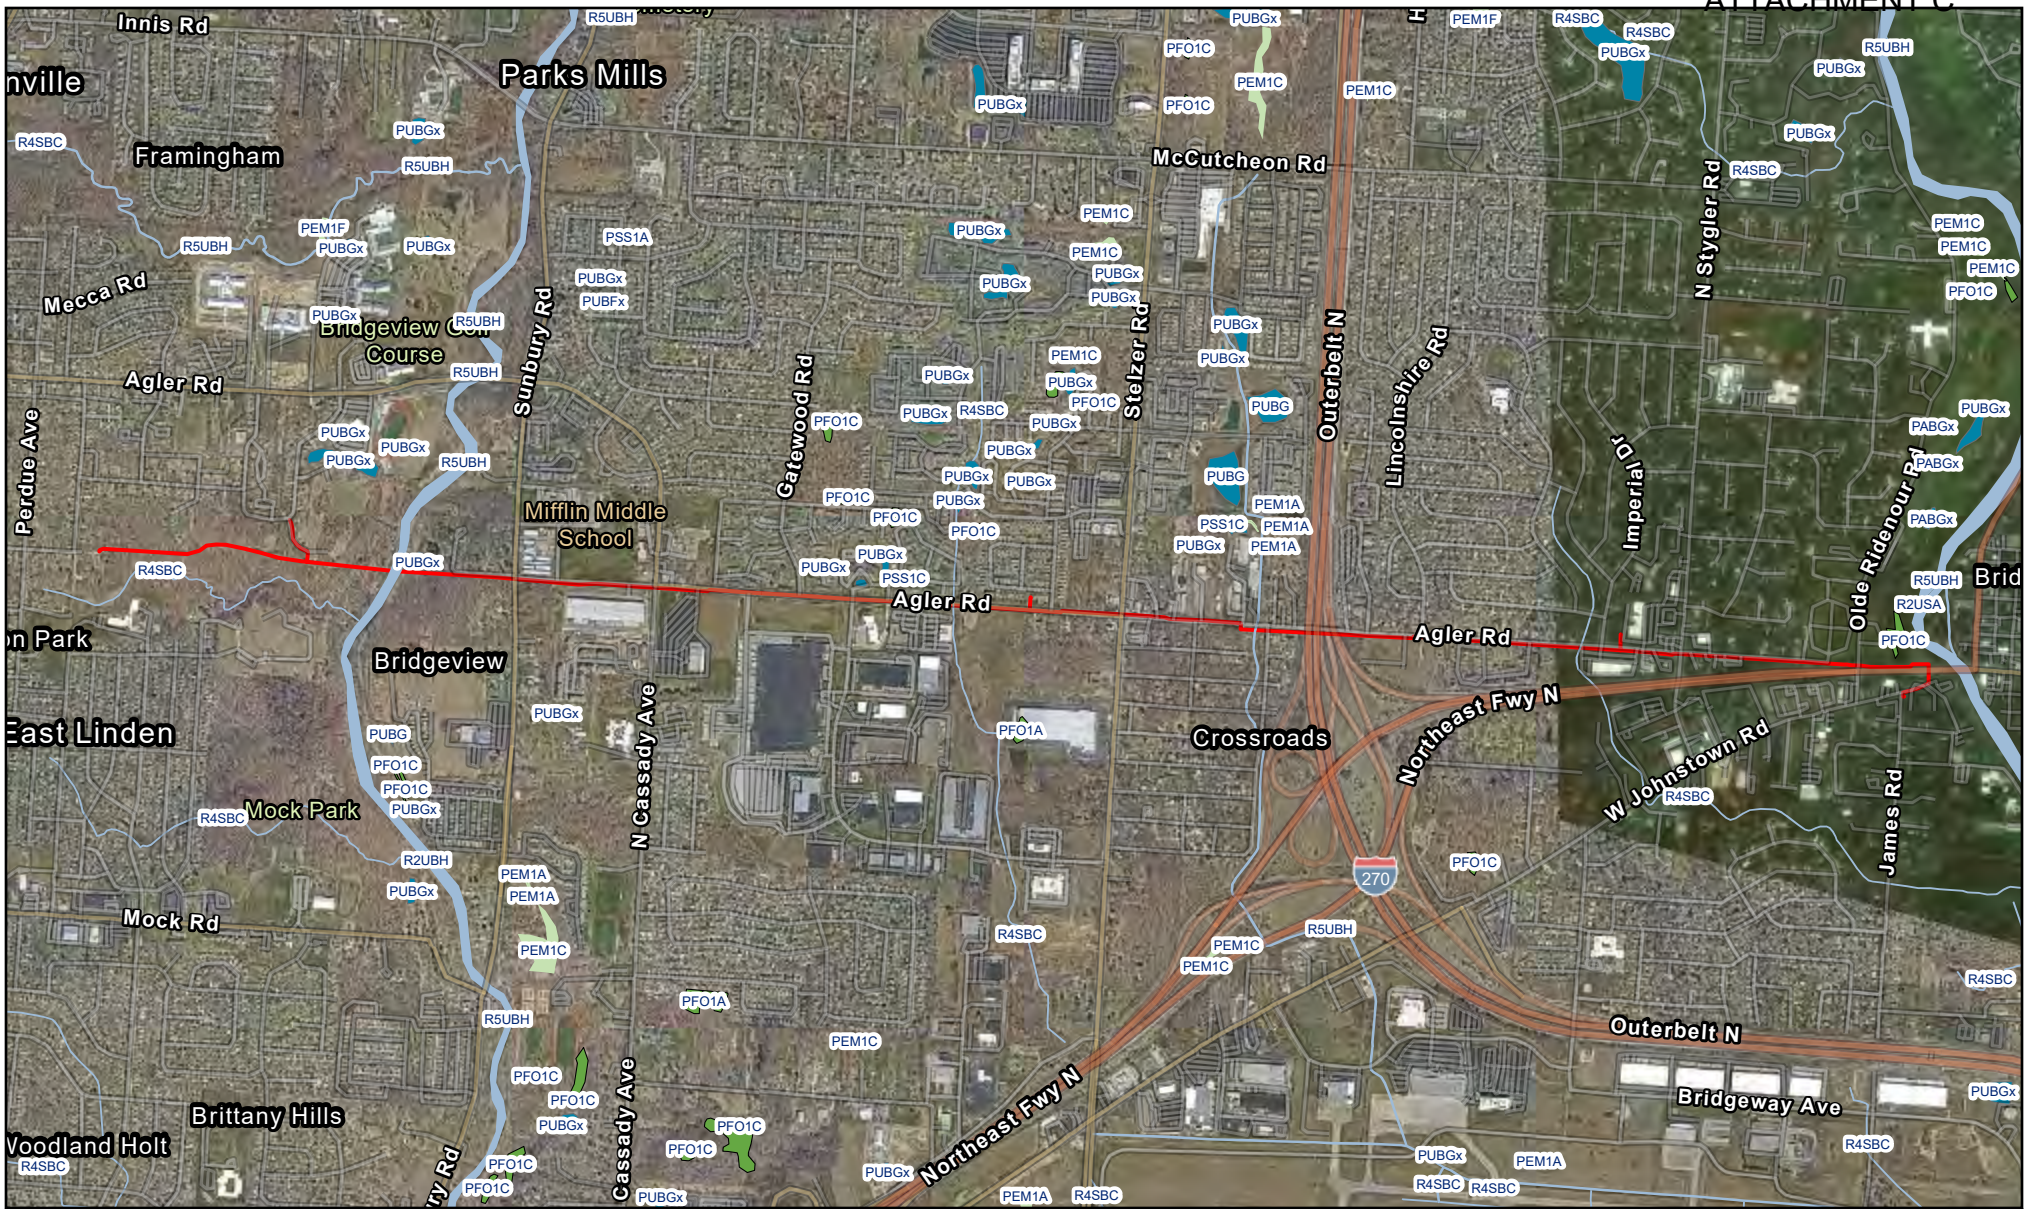


Prepared For:

NiSource Inc.
801 E. 86th Avenue
Merrillville, IN 46410

Prepared By:

Colliers Pittsburgh Office
1501 Reedsdale Street, Ste 302
Pittsburgh, PA 15233
Engineering & Design
T: 610.254.9140
www.colliersengineering.com

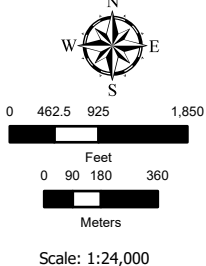

- Project Alignment
- Freshwater Emergent Wetland
- Freshwater Forested/Shrub Wetland
- Freshwater Pond
- Riverine

NWI Series Map

NHCP Phase 3B Project

Franklin County, Ohio


Date Saved: 12/20/2024

CED PN: 21004202A

Revised by: frances.buchanek


Figure 3



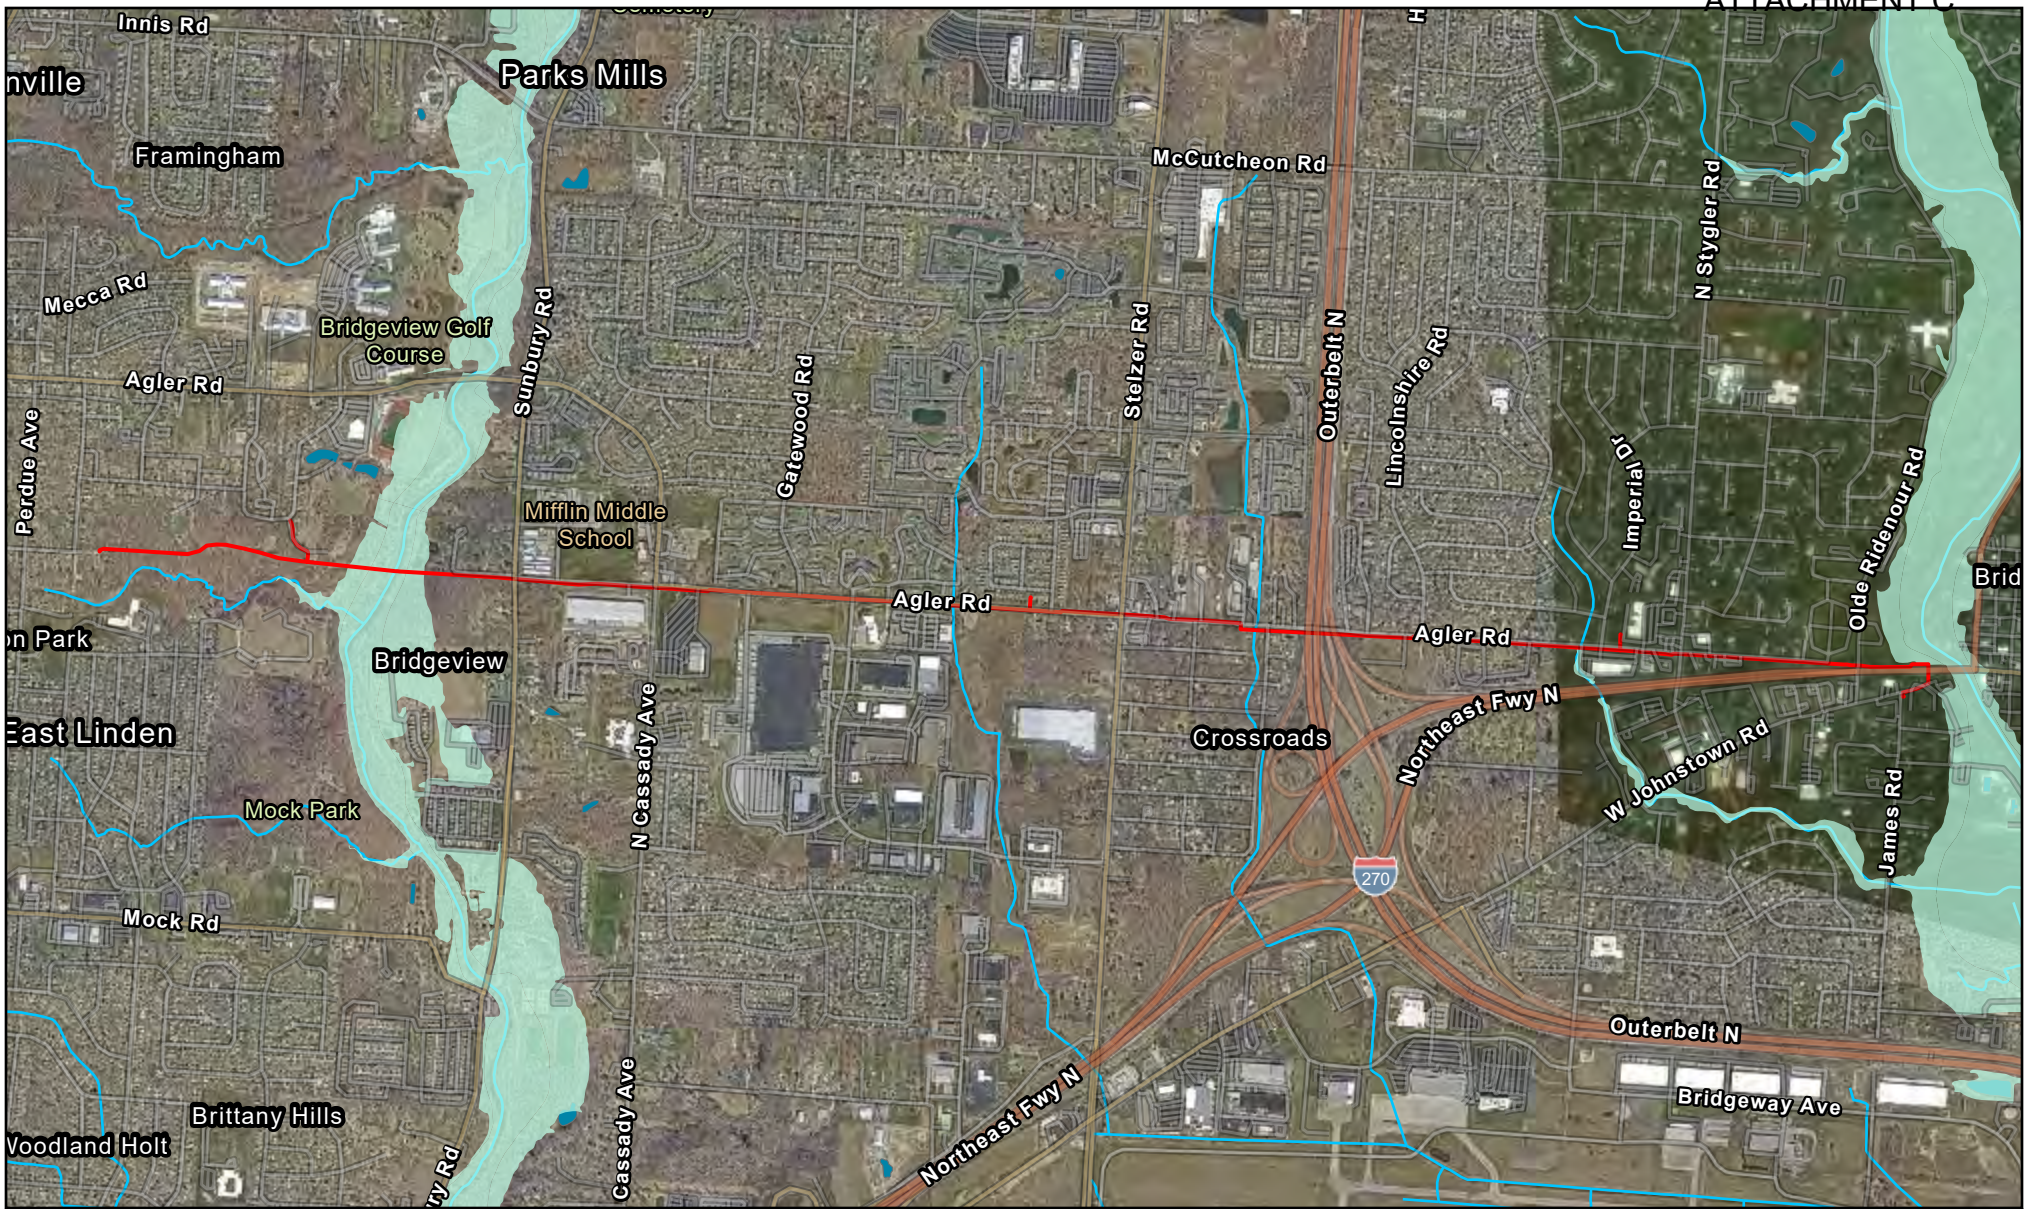

Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design
 T: 610.254.9140
 www.colliersengineering.com

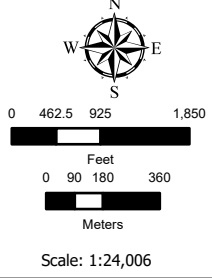

- Project Alignment
- NHD Flowline
- NHD Waterbody
- 100-Year Floodplain

FEMA/ NHD Map

NHCP Phase 3B Project

Franklin County, Ohio


Date Saved: 12/20/2024 CED PN: 21004202A Revised by: frances.buchanek





Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design
 T: 610.254.9140
 www.colliersengineering.com

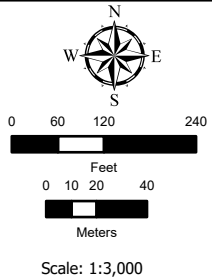

Project Data

- Project Alignment
- Study Corridor

Survey Data

- Culvert
- Ephemeral Stream
- Intermittent Stream
- Perennial Stream
- PEM Wetland
- PFO Wetland
- PUB Water
- Perennial Stream

Delineation Results Map

NHCP Phase 3B Project

Franklin County, Ohio

Date Saved: 12/20/2024

CED PN: 21004202A

Revised by: frances.buchanek


Figure 5 - Page 1 of 9







Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

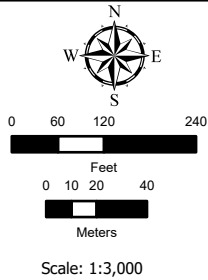






Prepared By:
 Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering T: 610.254.9140
 & Design www.colliersengineering.com



Project Data

-  Project Alignment
-  Study Corridor

Survey Data

-  Culvert
-  Ephemeral Stream
-  Intermittent Stream
-  Perennial Stream
-  PEM Wetland
-  PFO Wetland
-  PUB Water
-  Perennial Stream

Delineation Results Map

NHCP Phase 3B Project

Franklin County, Ohio


Date Saved: 12/20/2024

CED PN: 21004202A

Revised by: frances.buchanek


Figure 5 - Page 2 of 9



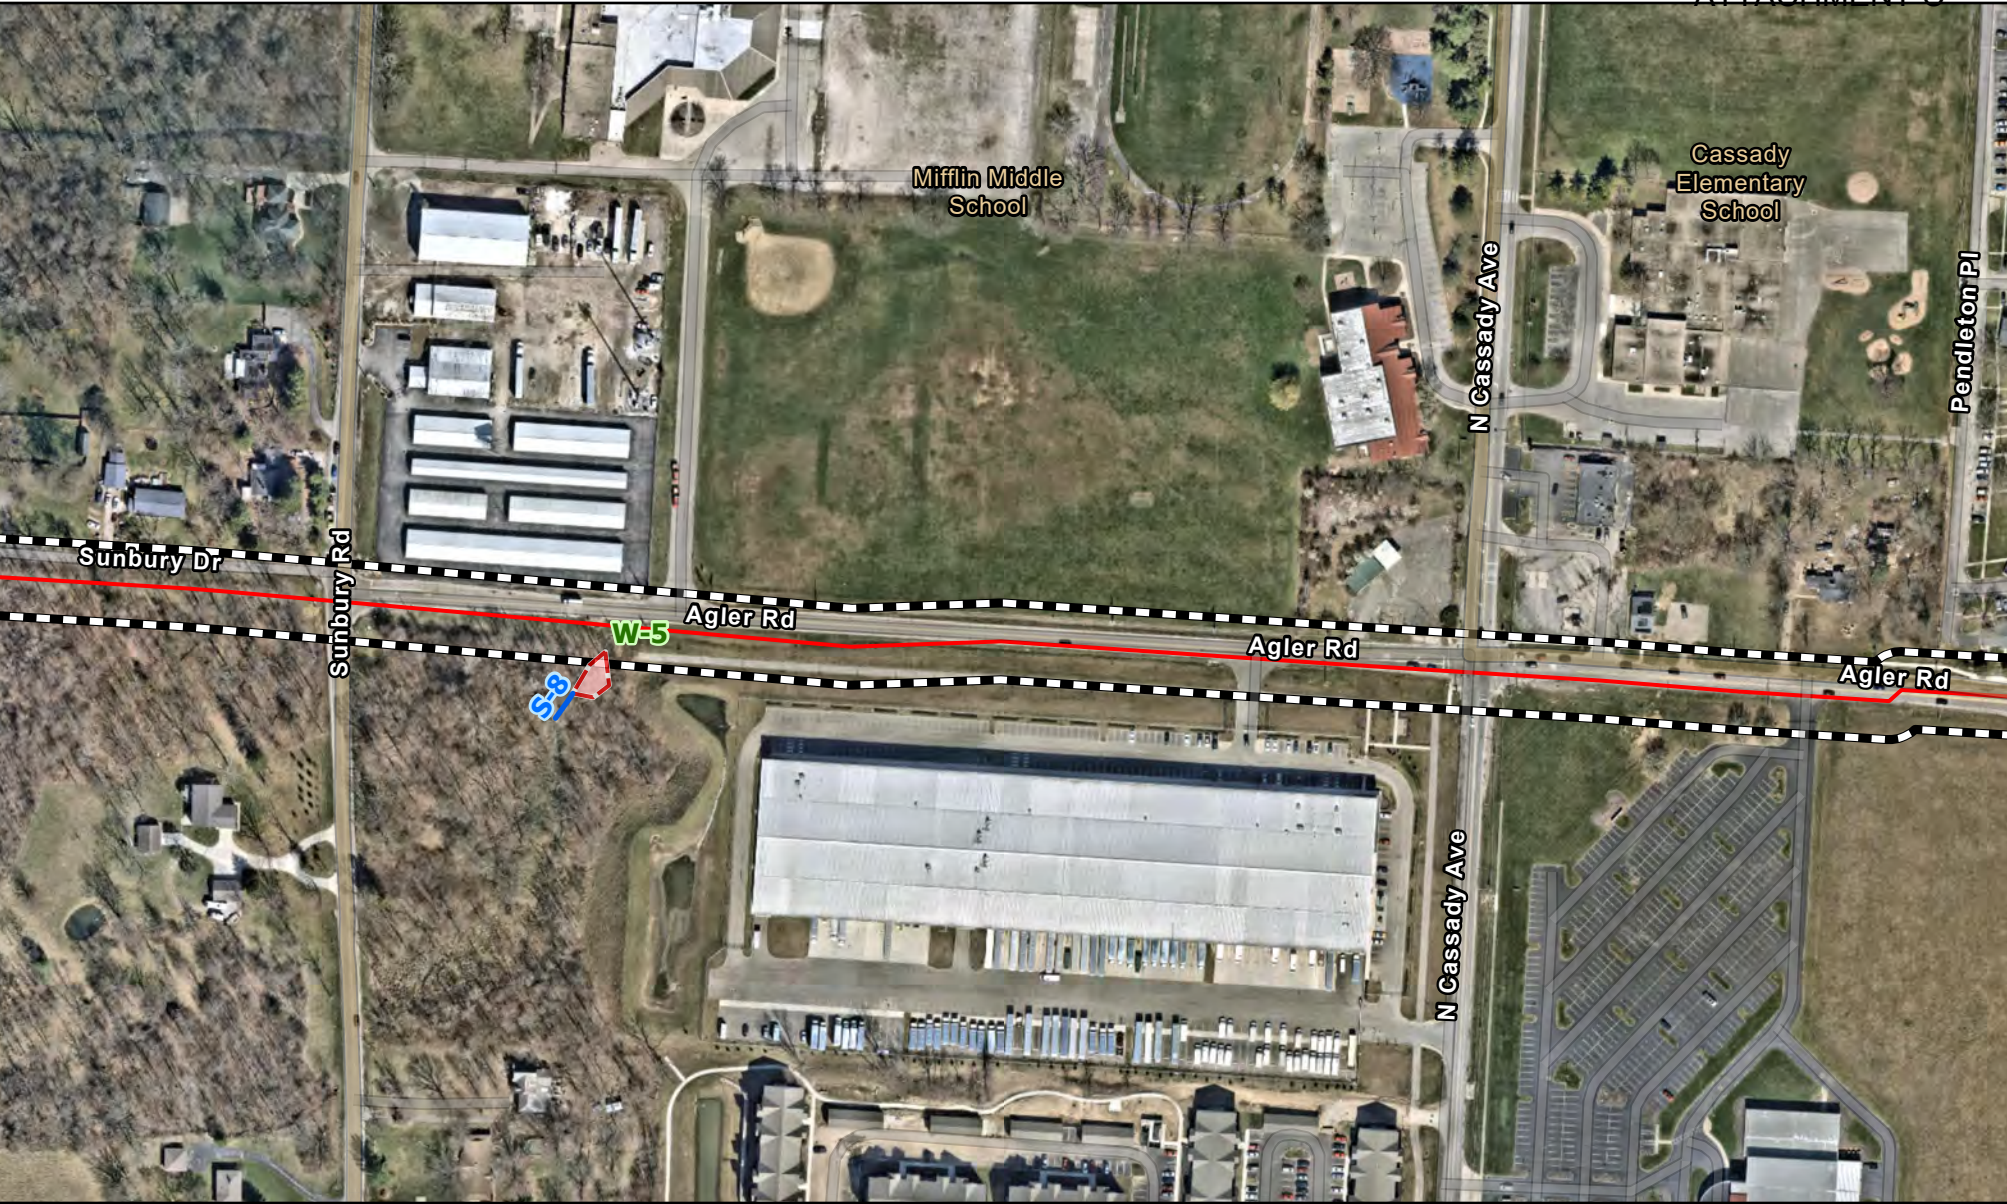

Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering T: 610.254.9140
 & Design www.colliersengineering.com

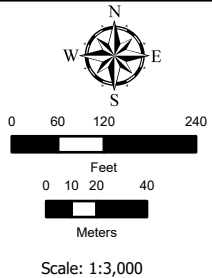

Project Data
 Project Alignment
 Study Corridor


Survey Data
 Culvert
 Ephemeral Stream
 Intermittent Stream
 Perennial Stream
 PEM Wetland
 PFO Wetland
 PUB Water
 Perennial Stream

Delineation Results Map
NHCP Phase 3B Project
Franklin County, Ohio

Date Saved: 12/20/2024 CED PN: 21004202A Revised by: frances.buchanek


Figure 5 - Page 3 of 9



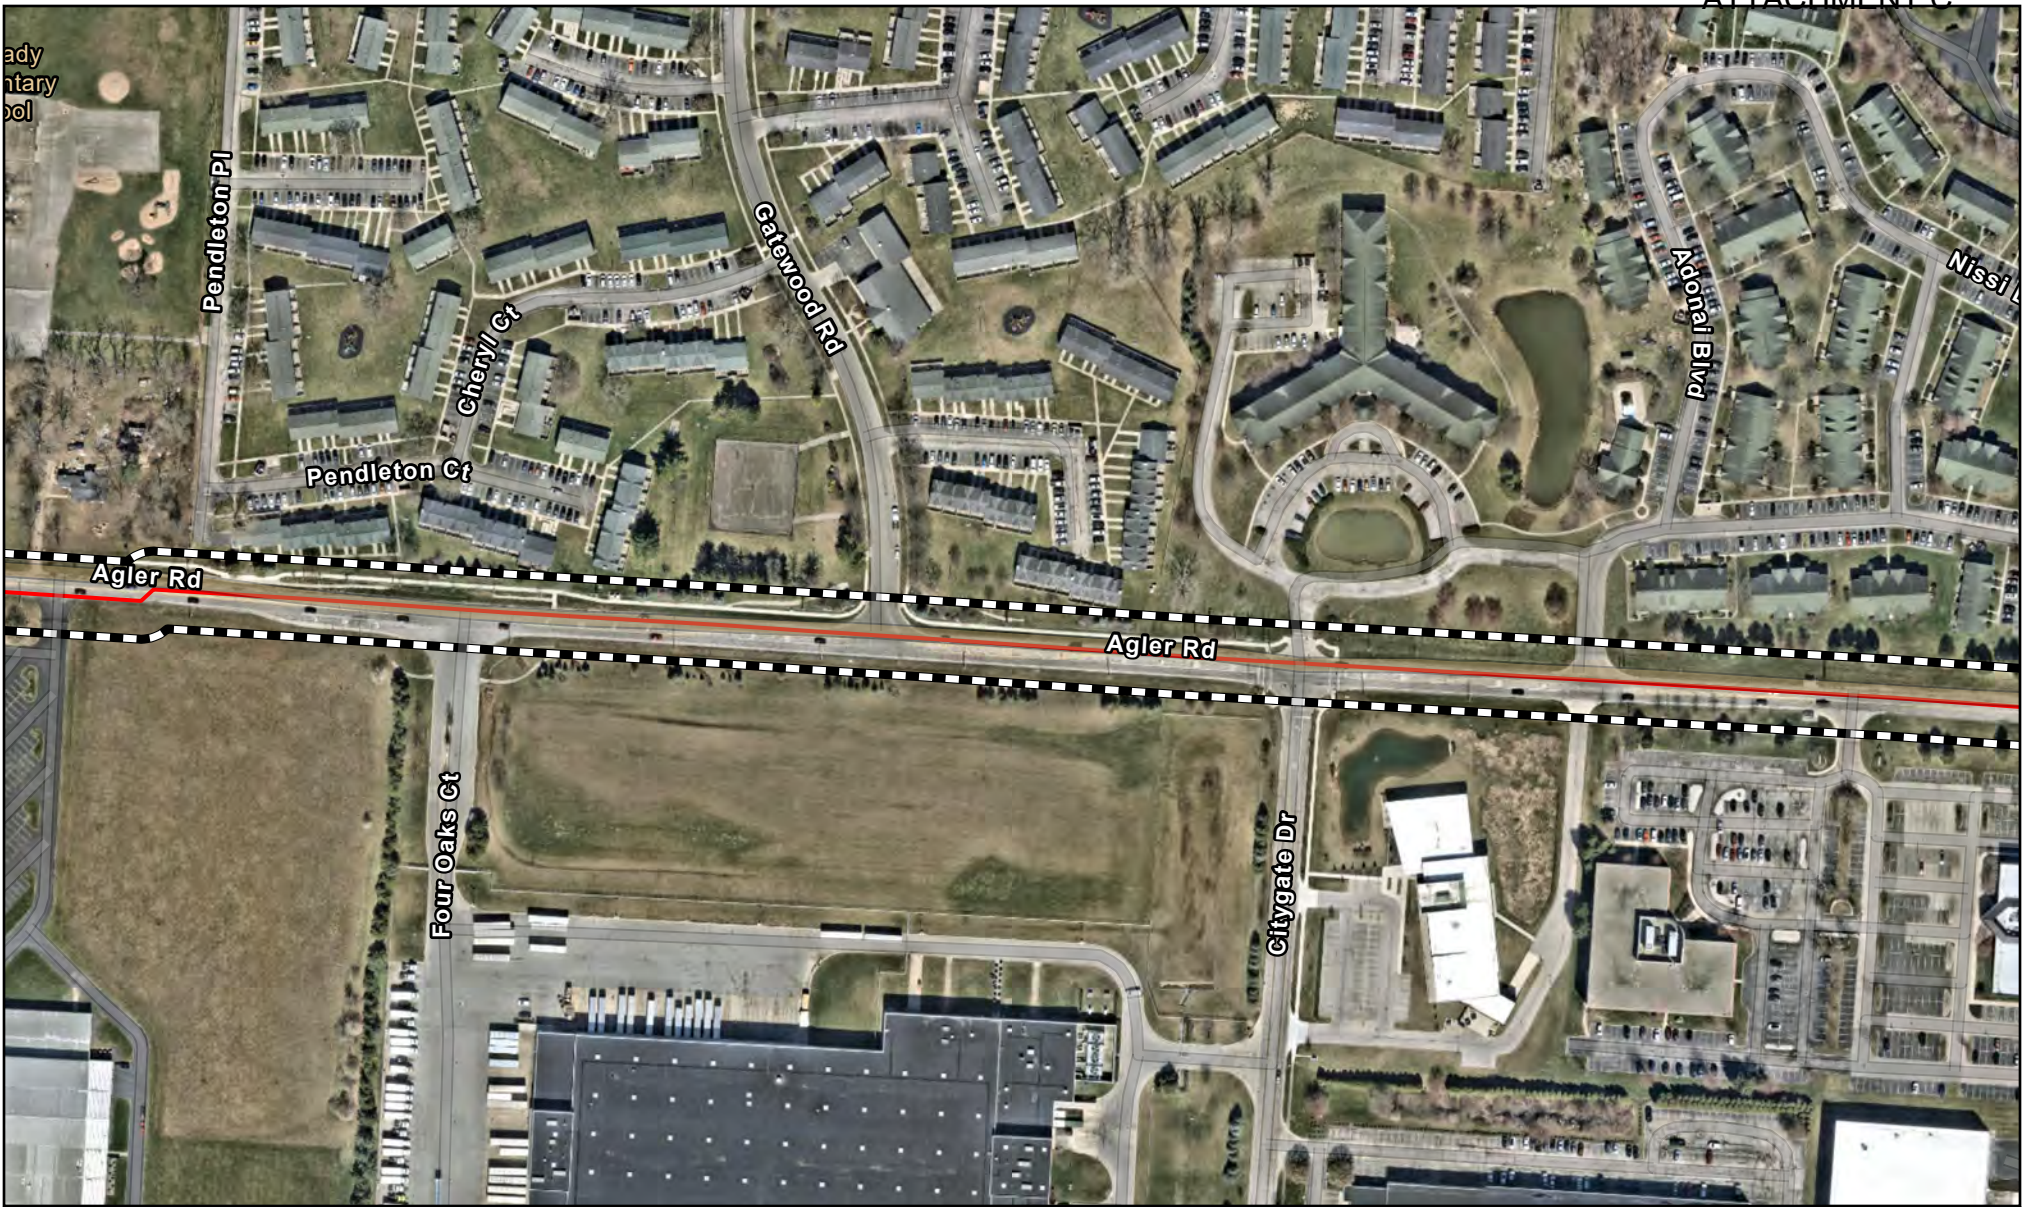



Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

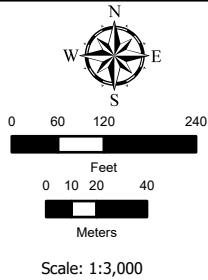







Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design T: 610.254.9140
 www.colliersengineering.com



Project Data

-  Project Alignment
-  Study Corridor

Survey Data

-  Culvert
-  Ephemeral Stream
-  Intermittent Stream
-  Perennial Stream
-  PEM Wetland
-  PFO Wetland
-  PUB Water
-  Perennial Stream

Delineation Results Map

NHCP Phase 3B Project

Franklin County, Ohio

Date Saved: 12/20/2024

CED PN: 21004202A

Revised by: frances.buchanek


Figure 5 - Page 4 of 9





Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design T: 610.254.9140
 www.colliersengineering.com

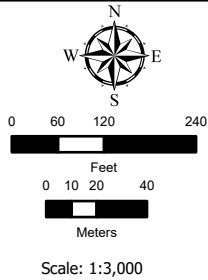

Project Data

- Project Alignment
- Study Corridor

Survey Data

- Culvert
- Ephemeral Stream
- Intermittent Stream
- Perennial Stream
- PEM Wetland
- PFO Wetland
- PUB Water
- Perennial Stream

Delineation Results Map

NHCP Phase 3B Project


Franklin County, Ohio


Date Saved: 12/20/2024

CED PN: 21004202A

Revised by: frances.buchanek


Figure 5 - Page 5 of 9

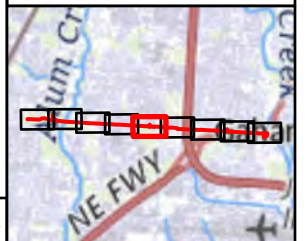

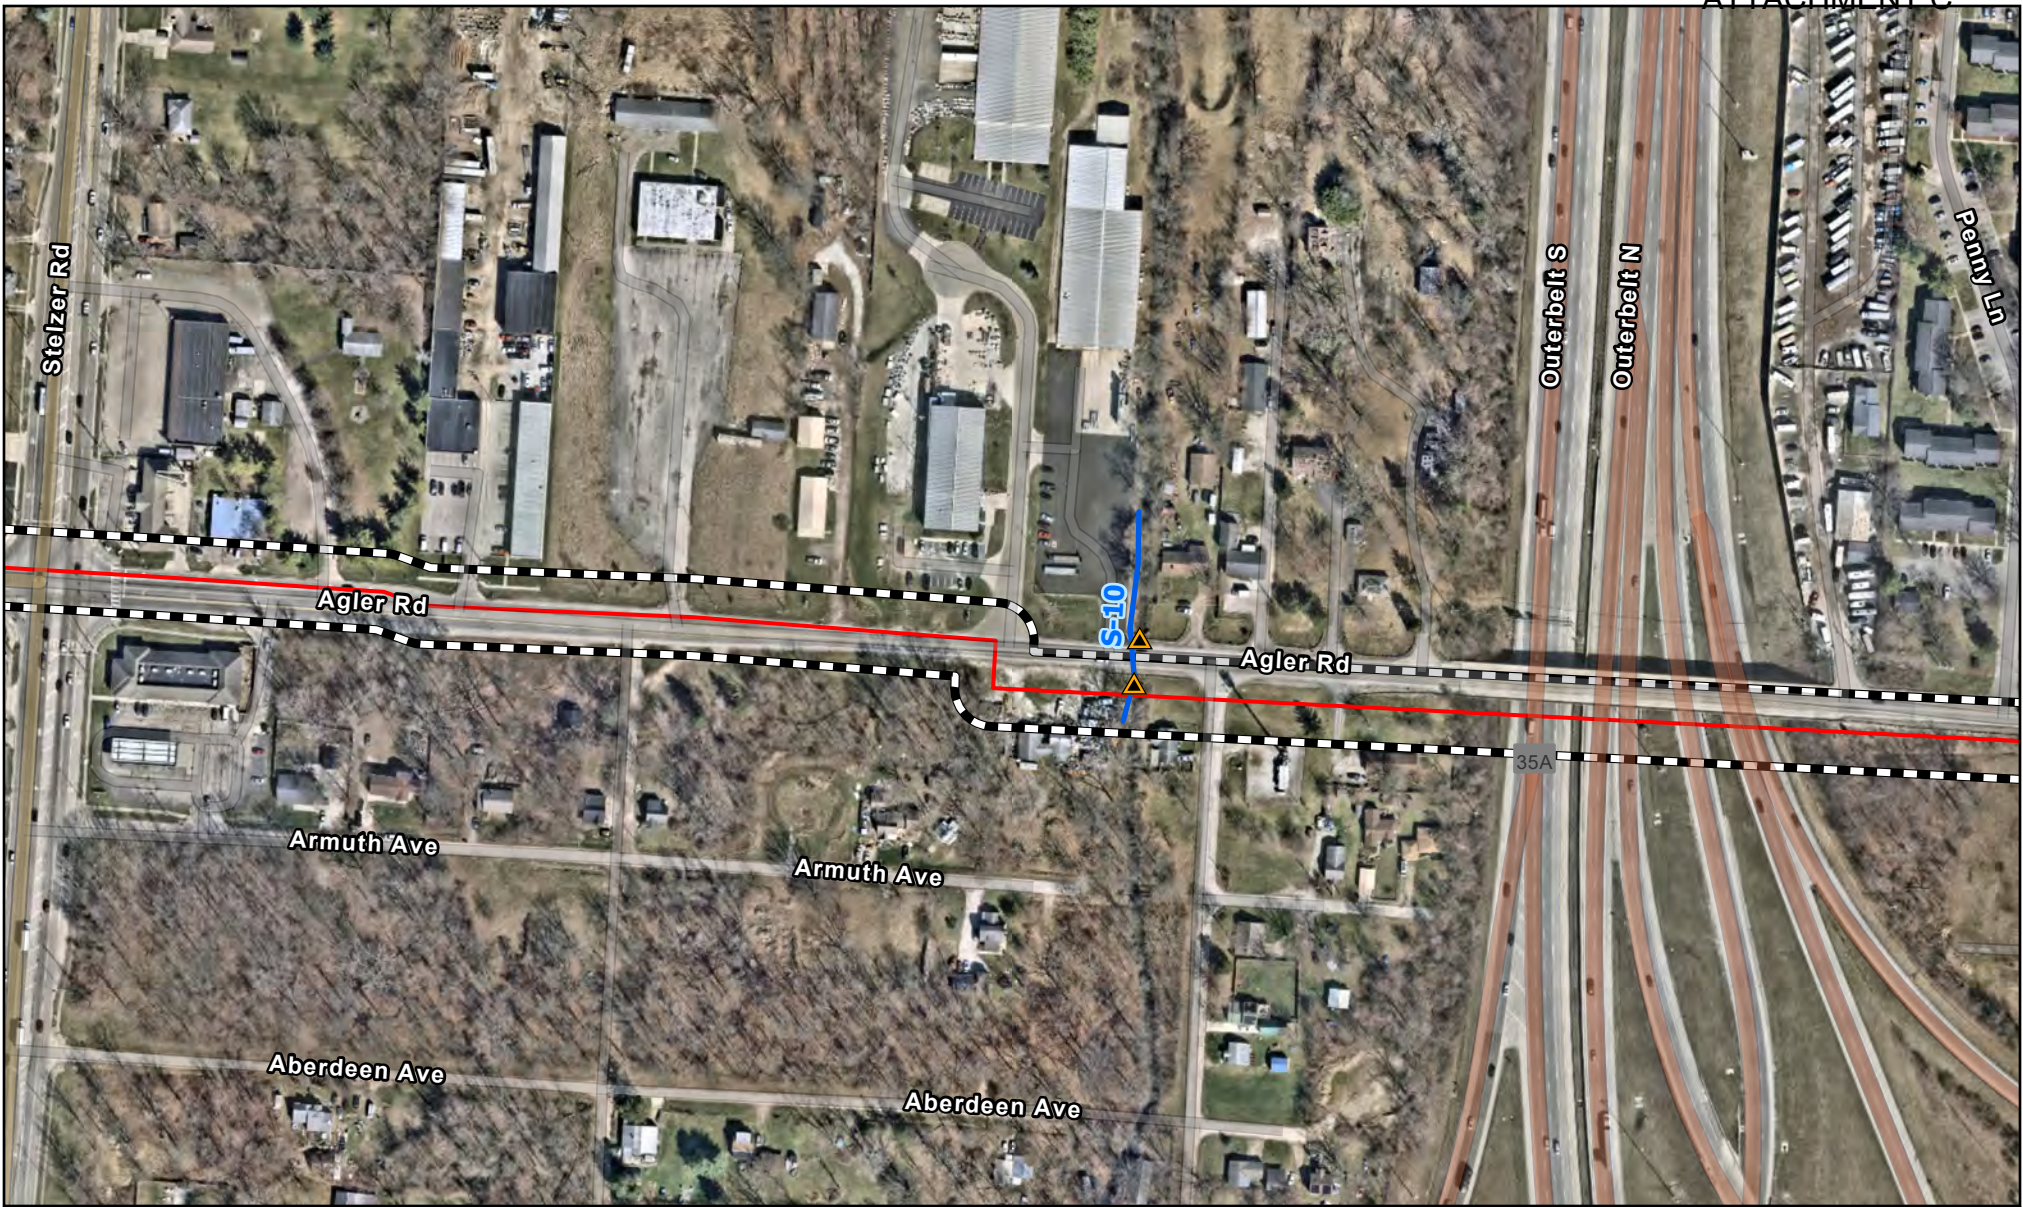

Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design T: 610.254.9140
 www.colliersengineering.com

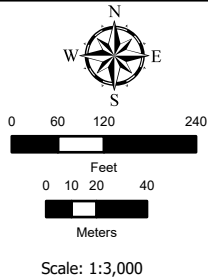

Project Data

- Project Alignment
- Study Corridor

Survey Data

- Culvert
- Ephemeral Stream
- Intermittent Stream
- Perennial Stream
- PEM Wetland
- PFO Wetland
- PUB Water
- Perennial Stream

Delineation Results Map

NHCP Phase 3B Project

Franklin County, Ohio

Date Saved: 12/20/2024

CED PN: 21004202A


Revised by: frances.buchanek


Figure 5 - Page 6 of 9







Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

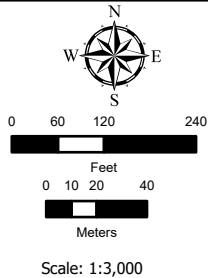







Prepared By:
 Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design T: 610.254.9140
 www.colliersengineering.com



Project Data

-  Project Alignment
-  Study Corridor

Survey Data

-  Culvert
-  Ephemeral Stream
-  Intermittent Stream
-  Perennial Stream
-  PEM Wetland
-  PFO Wetland
-  PUB Water
-  Perennial Stream

Delineation Results Map

NHCP Phase 3B Project

Franklin County, Ohio

Date Saved: 12/20/2024

CED PN: 21004202A

Revised by: frances.buchanek


Figure 5 - Page 7 of 9





Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design T: 610.254.9140
 www.colliersengineering.com

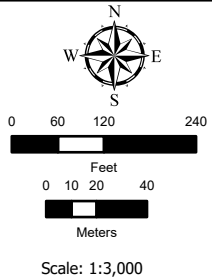

Project Data

- Project Alignment
- Study Corridor

Survey Data

- Culvert
- Ephemeral Stream
- Intermittent Stream
- Perennial Stream
- PEM Wetland
- PFO Wetland
- PUB Water
- Perennial Stream


Delineation Results Map

NHCP Phase 3B Project

Franklin County, Ohio


Date Saved: 12/20/2024
CED PN: 21004202A
Revised by: frances.buchanek

Figure 5 - Page 8 of 9

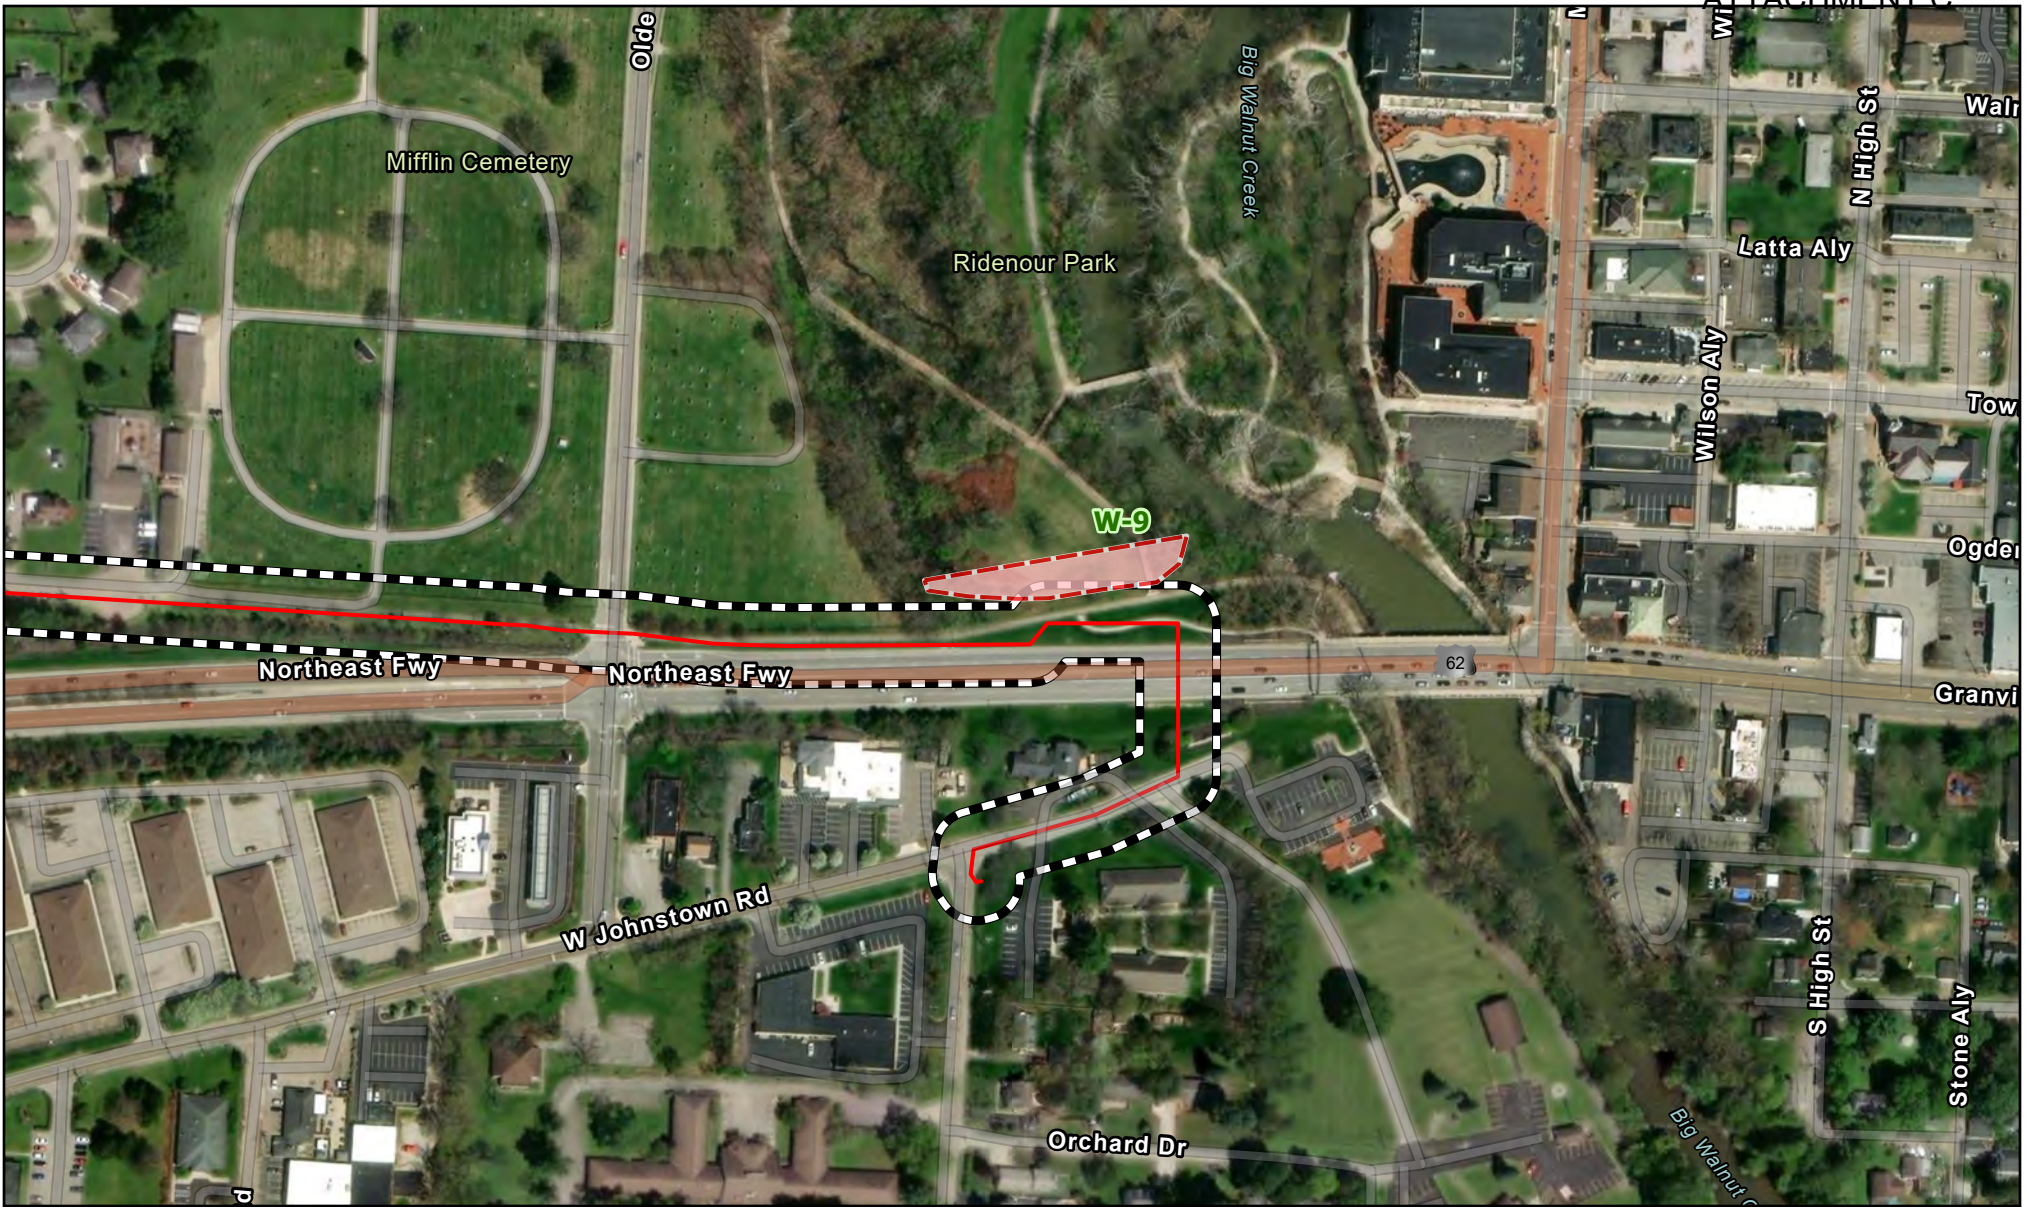

Prepared For:
 NiSource Inc.
 801 E. 86th Avenue
 Merrillville, IN 46410

Prepared By:
Colliers Pittsburgh Office
 1501 Reedsdale Street, Ste 302
 Pittsburgh, PA 15233
 Engineering & Design T: 610.254.9140
 www.colliersengineering.com

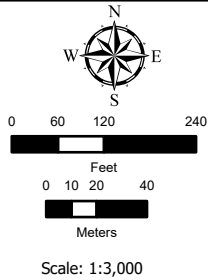

Project Data

- Project Alignment
- Study Corridor

Survey Data

- Culvert
- Ephemeral Stream
- Intermittent Stream
- Perennial Stream
- PEM Wetland
- PFO Wetland
- PUB Water
- Perennial Stream

Delineation Results Map

NHCP Phase 3B Project

Franklin County, Ohio

Date Saved: 12/20/2024

CED PN: 21004202A

Revised by: frances.buchanek

Figure 5 - Page 9 of 9





Appendix B | Data Forms

WETLAND DETERMINATION DATA FORM – Midwest Region

Project/Site: NC HP City/County: Columbus/Franklin Sampling Date: 3/2/22
 Applicant/Owner: NISOURCE State: OH Sampling Point: WOODS(PFO)
 Investigator(s): REL Section, Township, Range: T1N R17W
 Landform (hillslope, terrace, etc.): Depression Local relief (concave, convex, none): concave
 Slope (%): 5 Lat: _____ Long: _____ Datum: _____
 Soil Map Unit Name: Adc2 NWI classification: None
 Are climatic / hydrologic conditions on the site typical for this time of year? Yes No _____ (If no, explain in Remarks.)
 Are Vegetation N, Soil N, or Hydrology N significantly disturbed? Are "Normal Circumstances" present? Yes No _____
 Are Vegetation N, Soil N, or Hydrology N naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No _____	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No _____
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No _____		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No _____		
Remarks: <u>PFO rel to WOODS</u>			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: <u>30x30</u>)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>3</u> (A) Total Number of Dominant Species Across All Strata: <u>3</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100</u> (A/B)	
1. <u>Platanus occidentalis</u>	<u>45</u>	<u>Y</u>	<u>FACW</u>		
2. <u>Populus deltoides</u>	<u>10</u>	<u>N</u>	<u>FAC</u>		
3. _____	_____	_____	_____		
4. _____	_____	_____	_____		
Sapling/Shrub Stratum (Plot size: <u>15x5</u>) 1. <u>Platanus occidentalis</u> <u>5</u> <u>Y</u> <u>FACW</u> 2. <u>Lonicera mackaii</u> <u>15</u> <u>-</u> <u>NL</u> 3. _____ 4. _____ 5. _____ <u>20</u> = Total Cover				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species _____ x 1 = _____ FACW species _____ x 2 = _____ FAC species _____ x 3 = _____ FACU species _____ x 4 = _____ UPL species _____ x 5 = _____ Column Totals: _____ (A) _____ (B) Prevalence Index = B/A = _____	
Herb Stratum (Plot size: <u>5x5</u>) 1. <u>Evonymus fortunei</u> <u>5</u> <u>-</u> <u>NL</u> 2. _____ 3. _____ 4. _____ 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____ _____ = Total Cover					
Woody Vine Stratum (Plot size: <u>20x30</u>) 1. <u>Vitis riparia</u> <u>5</u> <u>Y</u> <u>FACW</u> 2. _____ _____ = Total Cover					Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0' ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No _____					
Remarks: (Include photo numbers here or on a separate sheet) <u>*Not listed in MW NWPL, not included in hydric veg calcs</u>					

SOIL

Sampling Point 1005 (PFO)

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-10	10YR4/2	92	10YR4/4	8	C	M	Silty clay loam	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Gleyed Matrix (S4)	<input type="checkbox"/> Coast Prairie Redox (A16)
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> Dark Surface (S7)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Iron-Manganese Masses (F12)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Mucky Mineral (F1)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> Stratified Layers (A5)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> 2 cm Muck (A10)	<input checked="" type="checkbox"/> Depleted Matrix (F3)	
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Redox Depressions (F8)	
<input type="checkbox"/> 5 cm Mucky Peat or Peat (S3)		

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):

Type: _____
Depth (inches): _____

Hydric Soil Present? Yes No

Remarks:

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required; check all that apply)	Secondary Indicators (minimum of two required)
<input checked="" type="checkbox"/> Surface Water (A1)	<input type="checkbox"/> Surface Soil Cracks (B6)
<input checked="" type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Drainage Patterns (B10)
<input checked="" type="checkbox"/> Saturation (A3)	<input type="checkbox"/> Dry-Season Water Table (C2)
<input type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Crayfish Burrows (C8)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Stunted or Stressed Plants (D1)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Iron Deposits (B5)	<input checked="" type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	
<input checked="" type="checkbox"/> Water-Stained Leaves (B9)	
<input type="checkbox"/> Aquatic Fauna (B13)	
<input type="checkbox"/> True Aquatic Plants (B14)	
<input type="checkbox"/> Hydrogen Sulfide Odor (C1)	
<input type="checkbox"/> Oxidized Rhizospheres on Living Roots (C3)	
<input type="checkbox"/> Presence of Reduced Iron (C4)	
<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)	
<input type="checkbox"/> Thin Muck Surface (C7)	
<input type="checkbox"/> Gauge or Well Data (D9)	
<input type="checkbox"/> Other (Explain in Remarks)	

Field Observations:

Surface Water Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Depth (inches): <u>8"</u>	Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Water Table Present?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Depth (inches): <u>3"</u>	
Saturation Present? (includes capillary fringe)	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Depth (inches): <u>0"</u>	

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:

N/A

Remarks:
outlets into channelized stream

WETLAND DETERMINATION DATA FORM – Midwest Region

Project/Site: NLHP City/County: Columbus/Franklin Sampling Date: 3/3/22
 Applicant/Owner: Nisource State: OH Sampling Point: W006 (PEM)
 Investigator(s): REK Section, Township, Range: T1N R17W
 Landform (hillslope, terrace, etc.): Floodplain Local relief (concave, convex, none): concave
 Slope (%): 3 Lat: _____ Long: _____ Datum: _____
 Soil Map Unit Name: ELC2 NWI classification: Nal
 Are climatic / hydrologic conditions on the site typical for this time of year? Yes X No _____ (If no, explain in Remarks.)
 Are Vegetation N, Soil N, or Hydrology N significantly disturbed? Are "Normal Circumstances" present? Yes X No _____
 Are Vegetation N, Soil N, or Hydrology N naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <u>X</u>	No _____	Is the Sampled Area within a Wetland? Yes <u>X</u> No _____
Hydric Soil Present?	Yes <u>X</u>	No _____	
Wetland Hydrology Present?	Yes <u>X</u>	No _____	
Remarks: <u>PEM rep to W006 - PEM w/in ROW, 9FO/PSS on edges</u>			

VEGETATION – Use scientific names of plants.

Tree Stratum (Plot size: <u>30x30</u>)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>6</u> (A) Total Number of Dominant Species Across All Strata: <u>6</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100</u> (A/B)
1. <u>Platanus occidentalis</u>	<u>10</u>	<u>Y</u>	<u>FACW</u>	
2. <u>Acer rubrum</u>	<u>5</u>	<u>Y</u>	<u>FAC</u>	
3. <u>Populus deltoides</u>	<u>5</u>	<u>Y</u>	<u>FAC</u>	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
Total Cover = <u>20</u>				Prevalence Index worksheet: Total % Cover of: _____ Multiply by: _____ OBL species _____ x 1 = _____ FACW species _____ x 2 = _____ FAC species _____ x 3 = _____ FACU species _____ x 4 = _____ UPL species _____ x 5 = _____ Column Totals: _____ (A) _____ (B) Prevalence Index = B/A = _____
Sapling/Shrub Stratum (Plot size: <u>5x5</u>) 1. <u>Platanus occidentalis</u> <u>10</u> <u>Y</u> <u>FACW</u> 2. <u>Rosa multiflora</u> <u>2</u> <u>N</u> <u>FACU</u> 3. <u>Cornus amomum</u> <u>3</u> <u>Y</u> <u>FACW</u> 4. _____ 5. _____				
Total Cover = <u>15</u>				
Herb Stratum (Plot size: <u>5x5</u>) 1. <u>Phalaris arundinacea</u> <u>80</u> <u>Y</u> <u>FACW</u> 2. <u>Veronica alternifolia</u> <u>10</u> <u>N</u> <u>FACW</u> 3. <u>Veronica noveboracensis</u> <u>5</u> <u>N</u> <u>FACW</u> 4. _____ 5. _____ 6. _____ 7. _____ 8. _____ 9. _____ 10. _____				
Total Cover = <u>95</u>				
Woody Vine Stratum (Plot size: <u>30x30</u>) 1. <u>Absent</u> 2. _____ _____ = Total Cover				
Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <u>X</u> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0 ¹ ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ Problematic Hydrophytic Vegetation ¹ (Explain)				
¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.				
Hydrophytic Vegetation Present? Yes <u>X</u> No _____				
Remarks: (Include photo numbers here or on a separate sheet.)				

SOIL

Sampling Point WOOD (PEM)

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)

Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-10	10YR 4/2	95	10YR 4/4	5	C	M	CLAY	

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, MS=Masked Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators:

<input type="checkbox"/> Histosol (A1)	<input type="checkbox"/> Sandy Gleyed Matrix (S4)	Indicators for Problematic Hydric Soils³:
<input type="checkbox"/> Histic Epipedon (A2)	<input type="checkbox"/> Sandy Redox (S5)	<input type="checkbox"/> Coast Prairie Redox (A16)
<input type="checkbox"/> Black Histic (A3)	<input type="checkbox"/> Stripped Matrix (S6)	<input type="checkbox"/> Dark Surface (S7)
<input type="checkbox"/> Hydrogen Sulfide (A4)	<input type="checkbox"/> Loamy Mucky Mineral (F1)	<input type="checkbox"/> Iron-Manganese Masses (F12)
<input type="checkbox"/> Stratified Layers (A5)	<input type="checkbox"/> Loamy Gleyed Matrix (F2)	<input type="checkbox"/> Very Shallow Dark Surface (TF12)
<input type="checkbox"/> 2 cm Muck (A10)	<input checked="" type="checkbox"/> Depleted Matrix (F3)	<input type="checkbox"/> Other (Explain in Remarks)
<input type="checkbox"/> Depleted Below Dark Surface (A11)	<input type="checkbox"/> Redox Dark Surface (F6)	
<input type="checkbox"/> Thick Dark Surface (A12)	<input type="checkbox"/> Depleted Dark Surface (F7)	
<input type="checkbox"/> Sandy Mucky Mineral (S1)	<input type="checkbox"/> Redox Depressions (F8)	
<input type="checkbox"/> 5 cm Mucky Peat or Peat (S3)		

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed):
 Type: _____
 Depth (inches): _____

Hydric Soil Present? Yes No

Remarks:

HYDROLOGY

Wetland Hydrology Indicators:

Primary Indicators (minimum of one is required: check all that apply)		Secondary Indicators (minimum of two required)
<input checked="" type="checkbox"/> Surface Water (A1)	<input checked="" type="checkbox"/> Water-Stained Leaves (B9)	<input type="checkbox"/> Surface Soil Cracks (B6)
<input type="checkbox"/> High Water Table (A2)	<input type="checkbox"/> Aquatic Fauna (B13)	<input checked="" type="checkbox"/> Drainage Patterns (B10)
<input checked="" type="checkbox"/> Saturation (A3)	<input type="checkbox"/> True Aquatic Plants (B14)	<input type="checkbox"/> Dry-Season Water Table (C2)
<input checked="" type="checkbox"/> Water Marks (B1)	<input type="checkbox"/> Hydrogen Sulfide Odor (C1)	<input type="checkbox"/> Crayfish Burrows (C8)
<input type="checkbox"/> Sediment Deposits (B2)	<input type="checkbox"/> Oxidized Rhizospheres on Living Roots (C3)	<input type="checkbox"/> Saturation Visible on Aerial Imagery (C9)
<input type="checkbox"/> Drift Deposits (B3)	<input type="checkbox"/> Presence of Reduced Iron (C4)	<input type="checkbox"/> Stunted or Stressed Plants (D1)
<input type="checkbox"/> Algal Mat or Crust (B4)	<input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6)	<input checked="" type="checkbox"/> Geomorphic Position (D2)
<input type="checkbox"/> Iron Deposits (B5)	<input type="checkbox"/> Thin Muck Surface (C7)	<input checked="" type="checkbox"/> FAC-Neutral Test (D5)
<input type="checkbox"/> Inundation Visible on Aerial Imagery (B7)	<input type="checkbox"/> Gauge or Well Data (D9)	
<input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	<input type="checkbox"/> Other (Explain in Remarks)	

Field Observations:

Surface Water Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Depth (inches): <u>1"</u>	Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Water Table Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Depth (inches): _____	
Saturation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Depth (inches): <u>4"</u>	

(includes capillary fringe)

Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:
N/A

Remarks:

WETLAND DETERMINATION DATA FORM - Midwest Region

Project/Site: NCHP City/County: Columbus/Franklin Sampling Date: 3/3/22
 Applicant/Owner: N. source State: _____ Sampling Point: WOOD LAGOON
 Investigator(s): REK Section, Township, Range: T1W R17W
 Landform (hillslope, terrace, etc.): Depression Local relief (concave, convex, none): CONCAVE
 Slope (%): 5 Lat: _____ Long: _____ Datum: _____
 Soil Map Unit Name: Ee NWI classification: RUBGX
 Are climatic / hydrologic conditions on the site typical for this time of year? Yes No _____ (If no, explain in Remarks.)
 Are Vegetation N, Soil N, or Hydrology N significantly disturbed? Are "Normal Circumstances" present? Yes No _____
 Are Vegetation N, Soil N, or Hydrology N naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS - Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present?	Yes <input checked="" type="checkbox"/> No _____	Is the Sampled Area within a Wetland?	Yes <input checked="" type="checkbox"/> No _____
Hydric Soil Present?	Yes <input checked="" type="checkbox"/> No _____		
Wetland Hydrology Present?	Yes <input checked="" type="checkbox"/> No _____		
Remarks:			

VEGETATION - Use scientific names of plants.

Tree Stratum (Plot size: <u>3x30</u>)	Absolute % Cover	Dominant Species?	Indicator Status	Dominance Test worksheet:
1. <u>Acer rubrum</u>	<u>30</u>	<u>Y</u>	<u>FAC</u>	
2. <u>Platanus occidentalis</u>	<u>15</u>	<u>Y</u>	<u>FACW</u>	Total Number of Dominant Species Across All Strata: <u>4</u> (B)
3. <u>Populus deltoides</u>	<u>10</u>	<u>N</u>	<u>FAC</u>	Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100</u> (A/B)
4. _____	_____	_____	_____	Prevalence Index worksheet:
5. _____	_____	_____	_____	
Sapling/Shrub Stratum (Plot size: <u>6x15</u>) <u>55</u> = Total Cover <u>11</u>				OBL species _____ x 1 = _____
1. <u>Acer rubrum</u>	<u>45</u>	<u>Y</u>	<u>FAC</u>	FACW species _____ x 2 = _____
2. <u>Platanus occidentalis</u>	<u>10</u>	<u>N</u>	<u>FACW</u>	FAC species _____ x 3 = _____
3. <u>Fraxinus pennsylvanica</u>	<u>5</u>	<u>N</u>	<u>FACW</u>	FACU species _____ x 4 = _____
4. _____	_____	_____	_____	UPL species _____ x 5 = _____
5. _____	_____	_____	_____	Column Totals: _____ (A) _____ (B)
Herb Stratum (Plot size: <u>5x5</u>) <u>30</u> <u>60</u> = Total Cover <u>12</u>				Prevalence Index = B/A = _____
1. <u>Phalaris arundinacea</u>	<u>35</u>	<u>Y</u>	<u>FACW</u>	Hydrophytic Vegetation Indicators: ___ 1 - Rapid Test for Hydrophytic Vegetation <input checked="" type="checkbox"/> 2 - Dominance Test is >50% ___ 3 - Prevalence Index is ≤3.0' ___ 4 - Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ Problematic Hydrophytic Vegetation ¹ (Explain) ¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
Woody Vine Stratum (Plot size: _____) <u>25</u> = Total Cover				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No _____
1. <u>ABSENT</u>	_____	_____	_____	
2. _____	_____	_____	_____	_____ = Total Cover
Remarks: (Include photo numbers here or on a separate sheet.)				

WETLAND DETERMINATION DATA FORM – Midwest Region

Project/Site: North Columbus High Pressure Pipeline Project City/County: Gahannah/Franklin Sampling Date: 12/17/24
 Applicant/Owner: Campos EPC State: OH Sampling Point: Wet 8
 Investigator(s): AAV Section, Township, Range: T/N R116W
 Landform (hillslope, terrace, etc.): Depression Local relief (concave, convex, none): Concave
 Slope (%): 0-3 Lat: 40.022098° Long: -82.941762° Datum: NAD 83
 Soil Map Unit Name: Cardington silt loam, 2 to 6 percent slopes NWI or WWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes No (If no, explain in Remarks.)
 Are Vegetation , Soil , or Hydrology significantly disturbed? Are "Normal Circumstances" present? Yes No
 Are Vegetation , Soil , or Hydrology naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Remarks: PFO rep to Wetland 8	

VEGETATION – Use scientific names of plants.

<u>Tree Stratum</u> (Plot size: <u>30'</u>)	Absolute % Cover	Dominant Species?	Indicator Status															
1. <u>Populus deltoides</u>	70	Y	FAC	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
2. _____																		
3. _____																		
4. _____																		
5. _____																		
<u>70</u> = Total Cover				Prevalence Index worksheet: <table style="width:100%; border:none;"> <tr> <td style="width:50%;">Total % Cover of:</td> <td style="width:50%;">Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>90</u></td> <td>x 3 = <u>270</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>90</u> (A)</td> <td><u>270</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.00</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>90</u>	x 3 = <u>270</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>90</u> (A)	<u>270</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>90</u>	x 3 = <u>270</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>90</u> (A)	<u>270</u> (B)																	
<u>Sapling/Shrub Stratum</u> (Plot size: <u>20'</u>)				Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> Dominance Test is >50% <input checked="" type="checkbox"/> Prevalence Index is ≤3.0 ¹ ___ Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ Problematic Hydrophytic Vegetation ¹ (Explain)														
1. <u>Populus deltoides</u>	20	Y	FAC															
2. _____																		
3. _____																		
4. _____																		
<u>20</u> = Total Cover				¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
<u>Herb Stratum</u> (Plot size: <u>5'</u>)																		
1. _____																		
2. _____																		
3. _____																		
4. _____																		
5. _____																		
6. _____																		
7. _____																		
8. _____																		
9. _____																		
10. _____																		
_____ = Total Cover				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
<u>Woody Vine Stratum</u> (Plot size: <u>15'</u>)																		
1. _____																		
2. _____																		
_____ = Total Cover																		

Remarks: (Include photo numbers here or on a separate sheet.)

Outside growing season.

SOIL

Sampling Point: Wet 8

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)								
Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-6	2.5Y 4/2	90	10YR 5/6	10	C	M	SiCL	
6-15	2.5Y 5/2	80	10YR 5/6	20	C	M	Clay	
¹ Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ² Location: PL=Pore Lining, M=Matrix.								
Hydric Soil Indicators:						Indicators for Problematic Hydric Soils³:		
<input type="checkbox"/> Histosol (A1) <input type="checkbox"/> Histic Epipedon (A2) <input type="checkbox"/> Black Histic (A3) <input type="checkbox"/> Hydrogen Sulfide (A4) <input type="checkbox"/> Stratified Layers (A5) <input type="checkbox"/> 2 cm Muck (A10) <input type="checkbox"/> Depleted Below Dark Surface (A11) <input type="checkbox"/> Thick Dark Surface (A12) <input type="checkbox"/> Sandy Mucky Mineral (S1) <input type="checkbox"/> 5 cm Mucky Peat or Peat (S3)			<input type="checkbox"/> Sandy Gleyed Matrix (S4) <input type="checkbox"/> Sandy Redox (S5) <input type="checkbox"/> Stripped Matrix (S6) <input type="checkbox"/> Loamy Mucky Mineral (F1) <input type="checkbox"/> Loamy Gleyed Matrix (F2) <input checked="" type="checkbox"/> Depleted Matrix (F3) <input type="checkbox"/> Redox Dark Surface (F6) <input type="checkbox"/> Depleted Dark Surface (F7) <input type="checkbox"/> Redox Depressions (F8)			<input type="checkbox"/> Coast Prairie Redox (A16) <input type="checkbox"/> Iron-Manganese Masses (F12) <input type="checkbox"/> Other (Explain in Remarks)		
Restrictive Layer (if observed): Type: _____ Depth (inches): _____						Hydric Soil Present? Yes <input checked="" type="checkbox"/> No _____		
Remarks: Meets F3								

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

HYDROLOGY

Wetland Hydrology Indicators:		
Primary Indicators (minimum of one is required; check all that apply)	Secondary Indicators (minimum of two required)	
<input checked="" type="checkbox"/> Surface Water (A1) <input checked="" type="checkbox"/> High Water Table (A2) <input checked="" type="checkbox"/> Saturation (A3) <input type="checkbox"/> Water Marks (B1) <input type="checkbox"/> Sediment Deposits (B2) <input type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Iron Deposits (B5) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input checked="" type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	<input checked="" type="checkbox"/> Water-Stained Leaves (B9) <input type="checkbox"/> Aquatic Fauna (B13) <input type="checkbox"/> True Aquatic Plants (B14) <input type="checkbox"/> Hydrogen Sulfide Odor (C1) <input type="checkbox"/> Oxidized Rhizospheres on Living Roots (C3) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Thin Muck Surface (C7) <input type="checkbox"/> Gauge or Well Data (D9) <input type="checkbox"/> Other (Explain in Remarks)	
<input type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Dry-Season Water Table (C2) <input type="checkbox"/> Crayfish Burrows (C8) <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input checked="" type="checkbox"/> Stunted or Stressed Plants (D1) <input type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> FAC-Neutral Test (D5)		
Field Observations: Surface Water Present? Yes <input checked="" type="checkbox"/> No _____ Depth (inches): <u>2</u> Water Table Present? Yes <input checked="" type="checkbox"/> No _____ Depth (inches): <u>0</u> Saturation Present? Yes <input checked="" type="checkbox"/> No _____ Depth (inches): <u>0</u> (includes capillary fringe)		
Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No _____		
Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:		
Remarks: Standing water		

WETLAND DETERMINATION DATA FORM – Midwest Region

Project/Site: North Columbus High Pressure Pipeline Project City/County: Gahannah/Franklin Sampling Date: 12/17/24
 Applicant/Owner: Campos EPC State: OH Sampling Point: Wet 9
 Investigator(s): AAY Section, Township, Range: T/N R116W
 Landform (hillslope, terrace, etc.): Toeslope Local relief (concave, convex, none): Concave
 Slope (%): 0-3 Lat: 019161° Long: -82.881995° Datum: NAD 83
 Soil Map Unit Name: Sloan silt loam, Columbus Lowland, 0 to 2 percent slopes, frequently flooded NWI or WWI classification: PFO1C

Are climatic / hydrologic conditions on the site typical for this time of year? Yes No (If no, explain in Remarks.)
 Are Vegetation , Soil , or Hydrology significantly disturbed? Are "Normal Circumstances" present? Yes No
 Are Vegetation , Soil , or Hydrology naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Hydric Soil Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> Wetland Hydrology Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
Remarks: PFO/PEM rep to Wetland 9	

VEGETATION – Use scientific names of plants.

<u>Tree Stratum</u> (Plot size: <u>30'</u>)	Absolute % Cover	Dominant Species?	Indicator Status															
1. <u>Platanus occidentalis</u>	10	Y	FACW	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>2</u> (A) Total Number of Dominant Species Across All Strata: <u>2</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>100.00</u> (A/B)														
2. _____																		
3. _____																		
4. _____																		
5. _____																		
<u>10</u> = Total Cover				Prevalence Index worksheet: <table style="width:100%; border:none;"> <tr> <td style="width:50%; text-align:right;">Total % Cover of:</td> <td style="width:50%; text-align:left;">Multiply by:</td> </tr> <tr> <td>OBL species <u>80</u></td> <td>x 1 = <u>80</u></td> </tr> <tr> <td>FACW species <u>30</u></td> <td>x 2 = <u>60</u></td> </tr> <tr> <td>FAC species <u>0</u></td> <td>x 3 = <u>0</u></td> </tr> <tr> <td>FACU species <u>0</u></td> <td>x 4 = <u>0</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>110</u> (A)</td> <td><u>140</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>1.27</u>	Total % Cover of:	Multiply by:	OBL species <u>80</u>	x 1 = <u>80</u>	FACW species <u>30</u>	x 2 = <u>60</u>	FAC species <u>0</u>	x 3 = <u>0</u>	FACU species <u>0</u>	x 4 = <u>0</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>110</u> (A)	<u>140</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>80</u>	x 1 = <u>80</u>																	
FACW species <u>30</u>	x 2 = <u>60</u>																	
FAC species <u>0</u>	x 3 = <u>0</u>																	
FACU species <u>0</u>	x 4 = <u>0</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>110</u> (A)	<u>140</u> (B)																	
_____ = Total Cover																		
_____ = Total Cover																		
_____ = Total Cover																		
_____ = Total Cover																		
<u>100</u> = Total Cover				Hydrophytic Vegetation Indicators: <input checked="" type="checkbox"/> Dominance Test is >50% <input checked="" type="checkbox"/> Prevalence Index is ≤3.0 ¹ ___ Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) ___ Problematic Hydrophytic Vegetation ¹ (Explain)														
1. <u>Typha latifolia</u>	70	Y	OBL															
2. <u>Epilobium hirsutum</u>	10	N	FACW															
3. <u>Polygonum pensylvanicum</u>	10	N	FACW															
4. <u>Persicaria sagittata</u>	10	N	OBL															
5. _____																		
6. _____																		
7. _____																		
8. _____																		
9. _____																		
10. _____																		
_____ = Total Cover				Hydrophytic Vegetation Present? Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>														
_____ = Total Cover																		
_____ = Total Cover																		
Remarks: (Include photo numbers here or on a separate sheet.) Outside growing season.																		

WETLAND DETERMINATION DATA FORM – Midwest Region

Project/Site: North Columbus High Pressure Pipeline Project City/County: Gahannah/Franklin Sampling Date: 12/17/24
 Applicant/Owner: Campos EPC State: OH Sampling Point: Up 8
 Investigator(s): AAY Section, Township, Range: T/N R116W
 Landform (hillslope, terrace, etc.): Sideslope Local relief (concave, convex, none): Convex
 Slope (%): 3-5 Lat: 40.022016° Long: -82.941911° Datum: NAD 83
 Soil Map Unit Name: Alexandria silt loam, 6 to 12 percent slopes, eroded NWI or WWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes No (If no, explain in Remarks.)
 Are Vegetation , Soil , or Hydrology significantly disturbed? Are "Normal Circumstances" present? Yes No
 Are Vegetation , Soil , or Hydrology naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Hydric Soil Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> Wetland Hydrology Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
Remarks: Upland woodlands adjacent to Wetland 8	

VEGETATION – Use scientific names of plants.

<u>Tree Stratum</u> (Plot size: <u>30'</u>)	Absolute % Cover	Dominant Species?	Indicator Status															
1. <u>Populus deltoides</u>	30	Y	FAC	Dominance Test worksheet: Number of Dominant Species That Are OBL, FACW, or FAC: <u>1</u> (A) Total Number of Dominant Species Across All Strata: <u>5</u> (B) Percent of Dominant Species That Are OBL, FACW, or FAC: <u>20.00</u> (A/B)														
2. <u>Prunus serotina</u>	30	Y	FACU															
3. <u>Acer rubrum</u>	10	N	FAC															
4. _____																		
5. _____																		
<u>70</u> = Total Cover				Prevalence Index worksheet: <table style="width:100%; border:none;"> <tr> <td style="width:50%;">Total % Cover of:</td> <td style="width:50%;">Multiply by:</td> </tr> <tr> <td>OBL species <u>0</u></td> <td>x 1 = <u>0</u></td> </tr> <tr> <td>FACW species <u>0</u></td> <td>x 2 = <u>0</u></td> </tr> <tr> <td>FAC species <u>40</u></td> <td>x 3 = <u>120</u></td> </tr> <tr> <td>FACU species <u>150</u></td> <td>x 4 = <u>600</u></td> </tr> <tr> <td>UPL species <u>0</u></td> <td>x 5 = <u>0</u></td> </tr> <tr> <td>Column Totals: <u>190</u> (A)</td> <td><u>720</u> (B)</td> </tr> </table> Prevalence Index = B/A = <u>3.79</u>	Total % Cover of:	Multiply by:	OBL species <u>0</u>	x 1 = <u>0</u>	FACW species <u>0</u>	x 2 = <u>0</u>	FAC species <u>40</u>	x 3 = <u>120</u>	FACU species <u>150</u>	x 4 = <u>600</u>	UPL species <u>0</u>	x 5 = <u>0</u>	Column Totals: <u>190</u> (A)	<u>720</u> (B)
Total % Cover of:	Multiply by:																	
OBL species <u>0</u>	x 1 = <u>0</u>																	
FACW species <u>0</u>	x 2 = <u>0</u>																	
FAC species <u>40</u>	x 3 = <u>120</u>																	
FACU species <u>150</u>	x 4 = <u>600</u>																	
UPL species <u>0</u>	x 5 = <u>0</u>																	
Column Totals: <u>190</u> (A)	<u>720</u> (B)																	
<u>Sapling/Shrub Stratum</u> (Plot size: <u>20'</u>)				Hydrophytic Vegetation Indicators: <input type="checkbox"/> Dominance Test is >50% <input type="checkbox"/> Prevalence Index is ≤3.0 ¹ <input type="checkbox"/> Morphological Adaptations ¹ (Provide supporting data in Remarks or on a separate sheet) <input type="checkbox"/> Problematic Hydrophytic Vegetation ¹ (Explain)														
1. <u>Elaeagnus angustifolia</u>	40	Y	FACU															
2. <u>Lonicera tatarica</u>	40	Y	FACU															
3. <u>Ligustrum vulgare</u>	40	Y	FACU															
4. _____																		
<u>120</u> = Total Cover				¹ Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.														
<u>Herb Stratum</u> (Plot size: <u>5'</u>)																		
1. _____																		
2. _____																		
3. _____																		
4. _____																		
5. _____																		
6. _____																		
7. _____																		
8. _____																		
9. _____																		
10. _____																		
_____ = Total Cover				Hydrophytic Vegetation Present? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>														
<u>Woody Vine Stratum</u> (Plot size: <u>15'</u>)																		
1. _____																		
2. _____																		
_____ = Total Cover																		

Remarks: (Include photo numbers here or on a separate sheet.)
Outside growing season.

SOIL

Sampling Point: Up 8

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)								
Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-6	10YR 3/2	100					SIL	
6-15	10YR 5/4	100					SiCL	Gravelly

¹Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ²Location: PL=Pore Lining, M=Matrix.

Hydric Soil Indicators: <input type="checkbox"/> Histosol (A1) <input type="checkbox"/> Histic Epipedon (A2) <input type="checkbox"/> Black Histic (A3) <input type="checkbox"/> Hydrogen Sulfide (A4) <input type="checkbox"/> Stratified Layers (A5) <input type="checkbox"/> 2 cm Muck (A10) <input type="checkbox"/> Depleted Below Dark Surface (A11) <input type="checkbox"/> Thick Dark Surface (A12) <input type="checkbox"/> Sandy Mucky Mineral (S1) <input type="checkbox"/> 5 cm Mucky Peat or Peat (S3)	<input type="checkbox"/> Sandy Gleyed Matrix (S4) <input type="checkbox"/> Sandy Redox (S5) <input type="checkbox"/> Stripped Matrix (S6) <input type="checkbox"/> Loamy Mucky Mineral (F1) <input type="checkbox"/> Loamy Gleyed Matrix (F2) <input type="checkbox"/> Depleted Matrix (F3) <input type="checkbox"/> Redox Dark Surface (F6) <input type="checkbox"/> Depleted Dark Surface (F7) <input type="checkbox"/> Redox Depressions (F8)	Indicators for Problematic Hydric Soils³: <input type="checkbox"/> Coast Prairie Redox (A16) <input type="checkbox"/> Iron-Manganese Masses (F12) <input type="checkbox"/> Other (Explain in Remarks)
---	--	--

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

Restrictive Layer (if observed): Type: _____ Depth (inches): _____	Hydric Soil Present? Yes _____ No <u> X </u>
---	--

Remarks:

HYDROLOGY

Wetland Hydrology Indicators:		
Primary Indicators (minimum of one is required; check all that apply)	Secondary Indicators (minimum of two required)	
<input type="checkbox"/> Surface Water (A1) <input type="checkbox"/> High Water Table (A2) <input type="checkbox"/> Saturation (A3) <input type="checkbox"/> Water Marks (B1) <input type="checkbox"/> Sediment Deposits (B2) <input type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Iron Deposits (B5) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	<input type="checkbox"/> Water-Stained Leaves (B9) <input type="checkbox"/> Aquatic Fauna (B13) <input type="checkbox"/> True Aquatic Plants (B14) <input type="checkbox"/> Hydrogen Sulfide Odor (C1) <input type="checkbox"/> Oxidized Rhizospheres on Living Roots (C3) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Thin Muck Surface (C7) <input type="checkbox"/> Gauge or Well Data (D9) <input type="checkbox"/> Other (Explain in Remarks)	<input type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Dry-Season Water Table (C2) <input type="checkbox"/> Crayfish Burrows (C8) <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input type="checkbox"/> Stunted or Stressed Plants (D1) <input type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> FAC-Neutral Test (D5)
Field Observations: Surface Water Present? Yes _____ No <u> X </u> Depth (inches): _____ Water Table Present? Yes _____ No <u> X </u> Depth (inches): _____ Saturation Present? Yes _____ No <u> X </u> Depth (inches): _____ (includes capillary fringe)		Wetland Hydrology Present? Yes _____ No <u> X </u>
Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available:		
Remarks:		

WETLAND DETERMINATION DATA FORM – Midwest Region

Project/Site: North Columbus High Pressure Pipeline Project City/County: Gahannah/Franklin Sampling Date: 12/17/24
 Applicant/Owner: Campos EPC State: _____ Sampling Point: Up 9
 Investigator(s): AAY Section, Township, Range: T/N R116W
 Landform (hillslope, terrace, etc.): Sideslope Local relief (concave, convex, none): Convex
 Slope (%): 5-8 Lat: 40.019084° Long: -82.881988° Datum: NAD 83
 Soil Map Unit Name: Udorthents-Urban land complex, gently rolling NWI or WWI classification: NA

Are climatic / hydrologic conditions on the site typical for this time of year? Yes No _____ (If no, explain in Remarks.)
 Are Vegetation _____, Soil _____, or Hydrology _____ significantly disturbed? Are "Normal Circumstances" present? Yes No _____
 Are Vegetation _____, Soil _____, or Hydrology _____ naturally problematic? (If needed, explain any answers in Remarks.)

SUMMARY OF FINDINGS – Attach site map showing sampling point locations, transects, important features, etc.

Hydrophytic Vegetation Present? Yes _____ No <input checked="" type="checkbox"/> Hydric Soil Present? Yes _____ No <input checked="" type="checkbox"/> Wetland Hydrology Present? Yes _____ No <input checked="" type="checkbox"/>	Is the Sampled Area within a Wetland? Yes _____ No <input checked="" type="checkbox"/>
Remarks: Upland maintained lawn/early successional veg adjacent to Wetland 9	

VEGETATION – Use scientific names of plants.

<u>Tree Stratum</u> (Plot size: <u>30'</u>)	Absolute % Cover	Dominant Species?	Indicator Status	
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
_____ = Total Cover				
<u>Sapling/Shrub Stratum</u> (Plot size: <u>15'</u>)	Absolute % Cover	Dominant Species?	Indicator Status	
1. <u><i>Pyrus calleryana</i></u>	20	Y	NI	
2. _____	_____	_____	_____	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
20 = Total Cover				
<u>Herb Stratum</u> (Plot size: <u>5'</u>)	Absolute % Cover	Dominant Species?	Indicator Status	
1. <u><i>Schedonorus arundinaceus</i></u>	90	Y	FACU	
2. <u><i>Trifolium repens</i></u>	10	N	FACU	
3. _____	_____	_____	_____	
4. _____	_____	_____	_____	
5. _____	_____	_____	_____	
6. _____	_____	_____	_____	
7. _____	_____	_____	_____	
8. _____	_____	_____	_____	
9. _____	_____	_____	_____	
10. _____	_____	_____	_____	
100 = Total Cover				
<u>Woody Vine Stratum</u> (Plot size: <u>15'</u>)	Absolute % Cover	Dominant Species?	Indicator Status	
1. _____	_____	_____	_____	
2. _____	_____	_____	_____	
_____ = Total Cover				

Dominance Test worksheet:
 Number of Dominant Species That Are OBL, FACW, or FAC: 0 (A)
 Total Number of Dominant Species Across All Strata: 2 (B)
 Percent of Dominant Species That Are OBL, FACW, or FAC: 0 (A/B)

Prevalence Index worksheet:

Total % Cover of:	Multiply by:
OBL species <u>0</u>	x 1 = <u>0</u>
FACW species <u>0</u>	x 2 = <u>0</u>
FAC species <u>0</u>	x 3 = <u>0</u>
FACU species <u>100</u>	x 4 = <u>400</u>
UPL species <u>0</u>	x 5 = <u>0</u>
Column Totals: <u>100</u> (A)	<u>400</u> (B)

Prevalence Index = B/A = 4.00

Hydrophytic Vegetation Indicators:
 ___ Dominance Test is >50%
 ___ Prevalence Index is ≤3.0¹
 ___ Morphological Adaptations¹ (Provide supporting data in Remarks or on a separate sheet)
 ___ Problematic Hydrophytic Vegetation¹ (Explain)

¹Indicators of hydric soil and wetland hydrology must be present, unless disturbed or problematic.

Hydrophytic Vegetation Present? Yes _____ No

Remarks: (Include photo numbers here or on a separate sheet.)

SOIL

Sampling Point: Up 9

Profile Description: (Describe to the depth needed to document the indicator or confirm the absence of indicators.)								
Depth (inches)	Matrix		Redox Features				Texture	Remarks
	Color (moist)	%	Color (moist)	%	Type ¹	Loc ²		
0-6	10YR 3/3	100					SIL	
6-12	10YR 5/6	100					CL	
¹ Type: C=Concentration, D=Depletion, RM=Reduced Matrix, CS=Covered or Coated Sand Grains. ² Location: PL=Pore Lining, M=Matrix.								
Hydric Soil Indicators:						Indicators for Problematic Hydric Soils³:		
<input type="checkbox"/> Histosol (A1) <input type="checkbox"/> Histic Epipedon (A2) <input type="checkbox"/> Black Histic (A3) <input type="checkbox"/> Hydrogen Sulfide (A4) <input type="checkbox"/> Stratified Layers (A5) <input type="checkbox"/> 2 cm Muck (A10) <input type="checkbox"/> Depleted Below Dark Surface (A11) <input type="checkbox"/> Thick Dark Surface (A12) <input type="checkbox"/> Sandy Mucky Mineral (S1) <input type="checkbox"/> 5 cm Mucky Peat or Peat (S3)			<input type="checkbox"/> Sandy Gleyed Matrix (S4) <input type="checkbox"/> Sandy Redox (S5) <input type="checkbox"/> Stripped Matrix (S6) <input type="checkbox"/> Loamy Mucky Mineral (F1) <input type="checkbox"/> Loamy Gleyed Matrix (F2) <input type="checkbox"/> Depleted Matrix (F3) <input type="checkbox"/> Redox Dark Surface (F6) <input type="checkbox"/> Depleted Dark Surface (F7) <input type="checkbox"/> Redox Depressions (F8)			<input type="checkbox"/> Coast Prairie Redox (A16) <input type="checkbox"/> Iron-Manganese Masses (F12) <input type="checkbox"/> Other (Explain in Remarks)		
Restrictive Layer (if observed): Type: _____ Depth (inches): _____						Hydric Soil Present? Yes _____ No <input checked="" type="checkbox"/>		
Remarks: _____ _____ _____								

³Indicators of hydrophytic vegetation and wetland hydrology must be present, unless disturbed or problematic.

HYDROLOGY

Wetland Hydrology Indicators:		
Primary Indicators (minimum of one is required; check all that apply)	Secondary Indicators (minimum of two required)	
<input type="checkbox"/> Surface Water (A1) <input type="checkbox"/> High Water Table (A2) <input type="checkbox"/> Saturation (A3) <input type="checkbox"/> Water Marks (B1) <input type="checkbox"/> Sediment Deposits (B2) <input type="checkbox"/> Drift Deposits (B3) <input type="checkbox"/> Algal Mat or Crust (B4) <input type="checkbox"/> Iron Deposits (B5) <input type="checkbox"/> Inundation Visible on Aerial Imagery (B7) <input type="checkbox"/> Sparsely Vegetated Concave Surface (B8)	<input type="checkbox"/> Water-Stained Leaves (B9) <input type="checkbox"/> Aquatic Fauna (B13) <input type="checkbox"/> True Aquatic Plants (B14) <input type="checkbox"/> Hydrogen Sulfide Odor (C1) <input type="checkbox"/> Oxidized Rhizospheres on Living Roots (C3) <input type="checkbox"/> Presence of Reduced Iron (C4) <input type="checkbox"/> Recent Iron Reduction in Tilled Soils (C6) <input type="checkbox"/> Thin Muck Surface (C7) <input type="checkbox"/> Gauge or Well Data (D9) <input type="checkbox"/> Other (Explain in Remarks)	<input type="checkbox"/> Surface Soil Cracks (B6) <input type="checkbox"/> Drainage Patterns (B10) <input type="checkbox"/> Dry-Season Water Table (C2) <input type="checkbox"/> Crayfish Burrows (C8) <input type="checkbox"/> Saturation Visible on Aerial Imagery (C9) <input type="checkbox"/> Stunted or Stressed Plants (D1) <input type="checkbox"/> Geomorphic Position (D2) <input type="checkbox"/> FAC-Neutral Test (D5)
Field Observations: Surface Water Present? Yes _____ No <input checked="" type="checkbox"/> Depth (inches): _____ Water Table Present? Yes _____ No <input checked="" type="checkbox"/> Depth (inches): _____ Saturation Present? Yes _____ No <input checked="" type="checkbox"/> Depth (inches): _____ (includes capillary fringe)		Wetland Hydrology Present? Yes _____ No <input checked="" type="checkbox"/>
Describe Recorded Data (stream gauge, monitoring well, aerial photos, previous inspections), if available: _____ _____		
Remarks: _____ _____		

Site: NCHP Rater(s): PEK Date: 3/2/22

1 1
max 6 pts. subtotal

Metric 1. Wetland Area (size).

- Select one size class and assign score.
- >50 acres (>20.2ha) (6 pts)
 - 25 to <50 acres (10.1 to <20.2ha) (5 pts)
 - 10 to <25 acres (4 to <10.1ha) (4 pts)
 - 3 to <10 acres (1.2 to <4ha) (3 pts)
 - 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
 - 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
 - <0.1 acres (0.04ha) (0 pts)

WOOS
PFO

2 3
max 14 pts. subtotal

Metric 2. Upland buffers and surrounding land use.

- 2a. Calculate average buffer width. Select only one and assign score. Do not double check.
- WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
 - MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
 - NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
 - VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)
- 2b. Intensity of surrounding land use. Select one or double check and average.
- VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
 - LOW. Old field (>10 years), shrub land, young second growth forest. (5)
 - MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
 - HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

8 11
max 30 pts. subtotal

Metric 3. Hydrology.

- 3a. Sources of Water. Score all that apply.
- High pH groundwater (5)
 - Other groundwater (3)
 - Precipitation (1)
 - Seasonal/Intermittent surface water (3)
 - Perennial surface water (lake or stream) (5)
- 3b. Connectivity. Score all that apply.
- 100 year floodplain (1)
 - Between stream/lake and other human use (1)
 - Part of wetland/upland (e.g. forest), complex (1)
 - Part of riparian or upland corridor (1)
- 3c. Maximum water depth. Select only one and assign score.
- >0.7 (27.6in) (3)
 - 0.4 to 0.7m (15.7 to 27.6in) (2)
 - <0.4m (<15.7in) (1)
- 3d. Duration inundation/saturation. Score one or dbl check.
- Semi- to permanently inundated/saturated (4)
 - Regularly inundated/saturated (3)
 - Seasonally inundated (2)
 - Seasonally saturated in upper 30cm (12in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

<input type="checkbox"/> None or none apparent (12)	Check all disturbances observed	<input type="checkbox"/> point source (nonstormwater)
<input checked="" type="checkbox"/> Recovered (7)	<input type="checkbox"/> ditch	<input checked="" type="checkbox"/> filling/grading
<input checked="" type="checkbox"/> Recovering (3)	<input type="checkbox"/> tile	<input type="checkbox"/> road bed/RR track
<input checked="" type="checkbox"/> Recent or no recovery (1)	<input type="checkbox"/> dike	<input type="checkbox"/> dredging
	<input type="checkbox"/> weir	<input type="checkbox"/> other
	<input checked="" type="checkbox"/> stormwater input	

7 18
max 20 pts. subtotal

Metric 4. Habitat Alteration and Development.

- 4a. Substrate disturbance. Score one or double check and average.
- None or none apparent (4)
 - Recovered (3)
 - Recovering (2)
 - Recent or no recovery (1)
- 4b. Habitat development. Select only one and assign score.
- Excellent (7)
 - Very good (6)
 - Good (5)
 - Moderately good (4)
 - Fair (3)
 - Poor to fair (2)
 - Poor (1)
- 4c. Habitat alteration. Score one or double check and average.

<input type="checkbox"/> None or none apparent (9)	Check all disturbances observed	<input type="checkbox"/> shrub/sapling removal
<input type="checkbox"/> Recovered (6)	<input type="checkbox"/> mowing	<input type="checkbox"/> herbaceous/aquatic bed removal
<input checked="" type="checkbox"/> Recovering (3)	<input type="checkbox"/> grazing	<input checked="" type="checkbox"/> sedimentation
<input type="checkbox"/> Recent or no recovery (1)	<input type="checkbox"/> clearcutting	<input type="checkbox"/> dredging
	<input type="checkbox"/> selective cutting	<input type="checkbox"/> farming
	<input type="checkbox"/> woody debris removal	<input type="checkbox"/> nutrient enrichment
	<input type="checkbox"/> toxic pollutants	

18
subtotal this page

Site: NCHP Rater(s): DEK Date: 3/2/22

18
subtotal first page

0 18
max 10 pts. subtotal

Metric 5. Special Wetlands.

WOOS
PFD

Check all that apply and score as indicated.

- Bog (10)
- Fen (10)
- Old growth forest (10)
- Mature forested wetland (5)
- Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- Lake Erie coastal/tributary wetland-restricted hydrology (5)
- Lake Plain Sand Prairies (Oak Openings) (10)
- Relict Wet Prairies (10)
- Known occurrence state/federal threatened or endangered species (10)
- Significant migratory songbird/water fowl habitat or usage (10)
- Category 1 Wetland. See Question 1 Qualitative Rating (-10)

5 23
max 20 pts. subtotal

Metric 6. Plant communities, interspersions, microtopography.

6a. Wetland Vegetation Communities.

Score all present using 0 to 3 scale.

- 0 Aquatic bed
- 1 Emergent
- 1 Shrub
- 4 2 Forest
- 0 Mudflats
- 0 Open water
- 0 Other _____

6b. horizontal (plan view) Interspersion.

Select only one.

- High (5)
- Moderately high(4)
- Moderate (3)
- Moderately low (2)
- Low (1)
- None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- Extensive >75% cover (-5)
- Moderate 25-75% cover (-3)
- Sparse 5-25% cover (-1)
- Nearly absent <5% cover (0)
- Absent (1)

6d. Microtopography.

Score all present using 0 to 3 scale.

- 0 Vegetated hummocks/tussocks
- 0 Coarse woody debris >15cm (6in)
- 0 Standing dead >25cm (10in) dbh
- 0 Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

23

Cat 1

End of Quantitative Rating. Complete Categorization Worksheets.

Site: NLHP

Rater(s): REK

Date: 3/3/22

2 2
max 6 pts. subtotal

Metric 1. Wetland Area (size).

WOOG
PEM

Select one size class and assign score.

- >50 acres (>20.2ha) (6 pts)
- 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- 10 to <25 acres (4 to <10.1ha) (4 pts)
- 3 to <10 acres (1.2 to <4ha) (3 pts)
- 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- <0.1 acres (0.04ha) (0 pts)

12 14
max 14 pts. subtotal

Metric 2. Upland buffers and surrounding land use.

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

16 30
max 30 pts. subtotal

Metric 3. Hydrology.

3a. Sources of Water. Score all that apply.

- High pH groundwater (5)
- Other groundwater (3)
- Precipitation (1)
- Seasonal/intermittent surface water (3)
- Perennial surface water (lake or stream) (5)

3c. Maximum water depth. Select only one and assign score.

- >0.7 (27.6in) (3)
- 0.4 to 0.7m (15.7 to 27.6in) (2)
- <0.4m (<15.7in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- None or none apparent (12)
- Recovered (7)
- Recovering (3)
- Recent or no recovery (1)

3b. Connectivity. Score all that apply.

- 100 year floodplain (1)
- Between stream/lake and other human use (1)
- Part of wetland/upland (e.g. forest), complex (1)
- Part of riparian or upland corridor (1)

3d. Duration inundation/saturation. Score one or dbl check.

- Semi- to permanently inundated/saturated (4)
- Regularly inundated/saturated (3)
- Seasonally inundated (2)
- Seasonally saturated in upper 30cm (12in) (1)

Check all disturbances observed

- ditch
- tile
- dike
- weir
- stormwater input
- point source (nonstormwater)
- filling/grading
- road bed/RR track
- dredging
- other

9 39
max 20 pts. subtotal

Metric 4. Habitat Alteration and Development.

4a. Substrate disturbance. Score one or double check and average.

- None or none apparent (4)
- Recovered (3)
- Recovering (2)
- Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- Excellent (7)
- Very good (6)
- Good (5)
- Moderately good (4)
- Fair (3)
- Poor to fair (2)
- Poor (1)

4c. Habitat alteration. Score one or double check and average.

- None or none apparent (9)
- Recovered (6)
- Recovering (3)
- Recent or no recovery (1)

Check all disturbances observed

- mowing
- grazing
- clearcutting
- selective cutting
- woody debris removal
- toxic pollutants
- shrub/sapling removal
- herbaceous/aquatic bed removal
- sedimentation
- dredging
- farming
- nutrient enrichment

39
subtotal this page

Site: NCHP Rater(s): REL Date: 3/3/22

39

subtotal first page

WOOS
PEM

0 39

max 10 pts.

subtotal

Metric 5. Special Wetlands.

Check all that apply and score as indicated.

- Bog (10)
- Fen (10)
- Old growth forest (10)
- Mature forested wetland (5)
- Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- Lake Erie coastal/tributary wetland-restricted hydrology (5)
- Lake Plain Sand Prairies (Oak Openings) (10)
- Relict Wet Prairies (10)
- Known occurrence state/federal threatened or endangered species (10)
- Significant migratory songbird/water fowl habitat or usage (10)
- Category 1 Wetland. See Question 1 Qualitative Rating (-10)

3

max 20 pts.

subtotal

Metric 6. Plant communities, interspersions, microtopography.

6a. Wetland Vegetation Communities.

Score all present using 0 to 3 scale.

5

- Aquatic bed
- Emergent
- Shrub
- Forest
- Mudflats
- Open water
- Other _____

6b. horizontal (plan view) Interspersion.

Select only one.

- High (5)
- Moderately high(4)
- Moderate (3)
- Moderately low (2)
- Low (1)
- None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- Extensive >75% cover (-5)
- Moderate 25-75% cover (-3)
- Sparse 5-25% cover (-1)
- Nearly absent <5% cover (0)
- Absent (1)

6d. Microtopography.

Score all present using 0 to 3 scale.

- Vegetated hummocks/tussocks
- Coarse woody debris >15cm (6in)
- Standing dead >25cm (10in) dbh
- Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

42

Cat Mod 2

End of Quantitative Rating. Complete Categorization Worksheets.

Site: NCHP	Rater(s): REK	Date: 3/3/22
-------------------	----------------------	---------------------

1	1
max 6 pts.	subtotal

Metric 1. Wetland Area (size).

WOOD
(PTD)

Select one size class and assign score.

- >50 acres (>20.2ha) (6 pts)
- 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- 10 to <25 acres (4 to <10.1ha) (4 pts)
- 3 to <10 acres (1.2 to <4ha) (3 pts)
- 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- <0.1 acres (0.04ha) (0 pts)

9	10
max 14 pts.	subtotal

Metric 2. Upland buffers and surrounding land use.

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

13	23
max 30 pts.	subtotal

Metric 3. Hydrology.

3a. Sources of Water. Score all that apply.

- High pH groundwater (5)
- Other groundwater (3)
- Precipitation (1)
- Seasonal/Intermittent surface water (3)
- Perennial surface water (lake or stream) (5)

3c. Maximum water depth. Select only one and assign score.

- >0.7 (27.6in) (3)
- 0.4 to 0.7m (15.7 to 27.6in) (2)
- <0.4m (<15.7in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- None or none apparent (12)
- Recovered (7)
- Recovering (3)
- Recent or no recovery (1)

3b. Connectivity. Score all that apply.

- 100 year floodplain (1)
- Between stream/lake and other human use (1)
- Part of wetland/upland (e.g. forest), complex (1)
- Part of riparian or upland corridor (1)

3d. Duration inundation/saturation. Score one or dbl check.

- Semi- to permanently inundated/saturated (4)
- Regularly inundated/saturated (3)
- Seasonally inundated (2)
- Seasonally saturated in upper 30cm (12in) (1)

Check all disturbances observed	
<input type="checkbox"/> ditch	<input checked="" type="checkbox"/> point source (nonstormwater)
<input type="checkbox"/> tile	<input checked="" type="checkbox"/> filling/grading
<input type="checkbox"/> dike	<input type="checkbox"/> road bed/RR track
<input type="checkbox"/> weir	<input type="checkbox"/> dredging
<input type="checkbox"/> stormwater input	<input type="checkbox"/> other

8	31
max 20 pts.	subtotal

Metric 4. Habitat Alteration and Development.

4a. Substrate disturbance. Score one or double check and average.

- None or none apparent (4)
- Recovered (3)
- Recovering (2)
- Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- Excellent (7)
- Very good (6)
- Good (5)
- Moderately good (4)
- Fair (3)
- Poor to fair (2)
- Poor (1)

4c. Habitat alteration. Score one or double check and average.

- None or none apparent (9)
- Recovered (6)
- Recovering (3)
- Recent or no recovery (1)

Check all disturbances observed	
<input checked="" type="checkbox"/> mowing	<input type="checkbox"/> shrub/sapling removal
<input type="checkbox"/> grazing	<input type="checkbox"/> herbaceous/aquatic bed removal
<input type="checkbox"/> clearcutting	<input type="checkbox"/> sedimentation
<input type="checkbox"/> selective cutting	<input type="checkbox"/> dredging
<input type="checkbox"/> woody debris removal	<input type="checkbox"/> farming
<input type="checkbox"/> toxic pollutants	<input type="checkbox"/> nutrient enrichment

31
subtotal this page

Site: NCHP Rater(s): PEK Date: 3/3/22

31

subtotal first page

WOOF
PFO

0 31

max 10 pts. subtotal

Metric 5. Special Wetlands.

Check all that apply and score as indicated.

- Bog (10)
- Fen (10)
- Old growth forest (10)
- Mature forested wetland (5)
- Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- Lake Erie coastal/tributary wetland-restricted hydrology (5)
- Lake Plain Sand Prairies (Oak Openings) (10)
- Relict Wet Prairies (10)
- Known occurrence state/federal threatened or endangered species (10)
- Significant migratory songbird/water fowl habitat or usage (10)
- Category 1 Wetland. See Question 1 Qualitative Rating (-10)

6 37

max 20 pts. subtotal

Metric 6. Plant communities, interspersions, microtopography.

6a. Wetland Vegetation Communities.
Score all present using 0 to 3 scale.

- 0 Aquatic bed
- 1 Emergent
- 2 Shrub
- 2 Forest
- 0 Mudflats
- 0 Open water
- 0 Other _____

6b. horizontal (plan view) Interspersion.
Select only one.

- High (5)
- Moderately high(4)
- Moderate (3)
- Moderately low (2)
- Low (1)
- None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- Extensive >75% cover (-5)
- Moderate 25-75% cover (-3)
- Sparse 5-25% cover (-1)
- Nearly absent <5% cover (0)
- Absent (1)

6d. Microtopography.

Score all present using 0 to 3 scale.

- 1 Vegetated hummocks/tussucks
- 0 Coarse woody debris >15cm (6in)
- 0 Standing dead >25cm (10in) dbh
- 0 Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

37 cat mod 2.

End of Quantitative Rating. Complete Categorization Worksheets.

Site: NCHP-Wet 8 Rater(s): AAV Date: 12/17/24

0 0
max 6 pts. subtotal

Metric 1. Wetland Area (size).

- Select one size class and assign score.
- >50 acres (>20.2ha) (6 pts)
 - 25 to <50 acres (10.1 to <20.2ha) (5 pts)
 - 10 to <25 acres (4 to <10.1ha) (4 pts)
 - 3 to <10 acres (1.2 to <4ha) (3 pts)
 - 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
 - 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
 - <0.1 acres (0.04ha) (0 pts)

4 4
max 14 pts. subtotal

Metric 2. Upland buffers and surrounding land use.

- 2a. Calculate average buffer width. Select only one and assign score. Do not double check.
- WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
 - MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
 - NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
 - VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)
- 2b. Intensity of surrounding land use. Select one or double check and average.
- VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
 - LOW. Old field (>10 years), shrub land, young second growth forest. (5)
 - MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
 - HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

10 18
max 30 pts. subtotal

Metric 3. Hydrology.

- 3a. Sources of Water. Score all that apply.
- High pH groundwater (5)
 - Other groundwater (3)
 - Precipitation (1)
 - Seasonal/Intermittent surface water (3)
 - Perennial surface water (lake or stream) (5)
- 3b. Connectivity. Score all that apply.
- 100 year floodplain (1)
 - Between stream/lake and other human use (1)
 - Part of wetland/upland (e.g. forest), complex (1)
 - Part of riparian or upland corridor (1)
- 3c. Maximum water depth. Select only one and assign score.
- >0.7 (27.6in) (3)
 - 0.4 to 0.7m (15.7 to 27.6in) (2)
 - <0.4m (<15.7in) (1)
- 3d. Duration inundation/saturation. Score one or dbl check.
- Semi- to permanently inundated/saturated (4)
 - Regularly inundated/saturated (3)
 - Seasonally inundated (2)
 - Seasonally saturated in upper 30cm (12in) (1)
- 3e. Modifications to natural hydrologic regime. Score one or double check and average.
- None or none apparent (12)
 - Recovered (7)
 - Recovering (3)
 - Recent or no recovery (1)

Check all disturbances observed	
<input type="checkbox"/> ditch	<input type="checkbox"/> point source (nonstormwater)
<input type="checkbox"/> tile	<input checked="" type="checkbox"/> filling/grading
<input type="checkbox"/> dike	<input type="checkbox"/> road bed/RR track
<input type="checkbox"/> weir	<input type="checkbox"/> dredging
<input type="checkbox"/> stormwater input	<input type="checkbox"/> other _____

8 26
max 20 pts. subtotal

Metric 4. Habitat Alteration and Development.

- 4a. Substrate disturbance. Score one or double check and average.
- None or none apparent (4)
 - Recovered (3)
 - Recovering (2)
 - Recent or no recovery (1)
- 4b. Habitat development. Select only one and assign score.
- Excellent (7)
 - Very good (6)
 - Good (5)
 - Moderately good (4)
 - Fair (3)
 - Poor to fair (2)
 - Poor (1)
- 4c. Habitat alteration. Score one or double check and average.
- None or none apparent (9)
 - Recovered (6)
 - Recovering (3)
 - Recent or no recovery (1)

Check all disturbances observed	
<input type="checkbox"/> mowing	<input type="checkbox"/> shrub/sapling removal
<input type="checkbox"/> grazing	<input type="checkbox"/> herbaceous/aquatic bed removal
<input checked="" type="checkbox"/> clearcutting	<input type="checkbox"/> sedimentation
<input checked="" type="checkbox"/> selective cutting	<input type="checkbox"/> dredging
<input type="checkbox"/> woody debris removal	<input type="checkbox"/> farming
<input type="checkbox"/> toxic pollutants	<input type="checkbox"/> nutrient enrichment

70
subtotal this page

Site: NCHP - Wet 8 Rater(s): AAJ Date: 12/17/24

26

subtotal first page

0 26

max 10 pts. subtotal

Metric 5. Special Wetlands.

Check all that apply and score as indicated.

- Bog (10)
- Fen (10)
- Old growth forest (10)
- Mature forested wetland (5)
- Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- Lake Erie coastal/tributary wetland-restricted hydrology (5)
- Lake Plain Sand Prairies (Oak Openings) (10)
- Relict Wet Prairies (10)
- Known occurrence state/federal threatened or endangered species (10)
- Significant migratory songbird/water fowl habitat or usage (10)
- Category 1 Wetland. See Question 1 Qualitative Rating (-10)

4 30

max 20 pts. subtotal

Metric 6. Plant communities, interspersions, microtopography.

6a. Wetland Vegetation Communities.

Score all present using 0 to 3 scale.

- 0 Aquatic bed
- 0 Emergent
- 1 Shrub
- 1 Forest
- 0 Mudflats
- 0 Open water
- 0 Other _____

6b. horizontal (plan view) Interspersion.

Select only one.

- High (5)
- Moderately high (4)
- Moderate (3)
- Moderately low (2)
- Low (1)
- None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- Extensive >75% cover (-5)
- Moderate 25-75% cover (-3)
- Sparse 5-25% cover (-1)
- Nearly absent <5% cover (0)
- Absent (1)

6d. Microtopography.

Score all present using 0 to 3 scale.

- Vegetated hummocks/tussocks
- Coarse woody debris >15cm (6in)
- Standing dead >25cm (10in) dbh
- Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

30

End of Quantitative Rating. Complete Categorization Worksheets.

Site: NCHP-wet 9 Rater(s): AAV Date: 12/17/24

3 0
max 6 pts. subtotal

Metric 1. Wetland Area (size).

Select one size class and assign score.

- >50 acres (>20.2ha) (6 pts)
- 25 to <50 acres (10.1 to <20.2ha) (5 pts)
- 10 to <25 acres (4 to <10.1ha) (4 pts)
- 3 to <10 acres (1.2 to <4ha) (3 pts)
- 0.3 to <3 acres (0.12 to <1.2ha) (2pts)
- 0.1 to <0.3 acres (0.04 to <0.12ha) (1 pt)
- <0.1 acres (0.04ha) (0 pts)

5 8
max 14 pts. subtotal

Metric 2. Upland buffers and surrounding land use.

2a. Calculate average buffer width. Select only one and assign score. Do not double check.

- WIDE. Buffers average 50m (164ft) or more around wetland perimeter (7)
- MEDIUM. Buffers average 25m to <50m (82 to <164ft) around wetland perimeter (4)
- NARROW. Buffers average 10m to <25m (32ft to <82ft) around wetland perimeter (1)
- VERY NARROW. Buffers average <10m (<32ft) around wetland perimeter (0)

2b. Intensity of surrounding land use. Select one or double check and average.

- VERY LOW. 2nd growth or older forest, prairie, savannah, wildlife area, etc. (7)
- LOW. Old field (>10 years), shrub land, young second growth forest. (5)
- MODERATELY HIGH. Residential, fenced pasture, park, conservation tillage, new fallow field. (3)
- HIGH. Urban, industrial, open pasture, row cropping, mining, construction. (1)

150 23
max 30 pts. subtotal

Metric 3. Hydrology.

3a. Sources of Water. Score all that apply.

- High pH groundwater (5)
- Other groundwater (3)
- Precipitation (1)
- Seasonal/Intermittent surface water (3)
- Perennial surface water (lake or stream) (5)

3c. Maximum water depth. Select only one and assign score.

- >0.7 (27.6in) (3)
- 0.4 to 0.7m (15.7 to 27.6in) (2)
- <0.4m (<15.7in) (1)

3e. Modifications to natural hydrologic regime. Score one or double check and average.

- None or none apparent (12)
- Recovered (7)
- Recovering (3)
- Recent or no recovery (1)

Check all disturbances observed

- ditch
- tile
- dike
- weir
- stormwater input
- point source (nonstormwater)
- filling/grading
- road bed/RR track
- dredging
- other _____

3b. Connectivity. Score all that apply.

- 100 year floodplain (1)
- Between stream/lake and other human use (1)
- Part of wetland/upland (e.g. forest), complex (1)
- Part of riparian or upland corridor (1)

3d. Duration inundation/saturation. Score one or dbl check.

- Semi- to permanently inundated/saturated (4)
- Regularly inundated/saturated (3)
- Seasonally inundated (2)
- Seasonally saturated in upper 30cm (12in) (1)

8 31
max 20 pts. subtotal

Metric 4. Habitat Alteration and Development.

4a. Substrate disturbance. Score one or double check and average.

- None or none apparent (4)
- Recovered (3)
- Recovering (2)
- Recent or no recovery (1)

4b. Habitat development. Select only one and assign score.

- Excellent (7)
- Very good (6)
- Good (5)
- Moderately good (4)
- Fair (3)
- Poor to fair (2)
- Poor (1)

4c. Habitat alteration. Score one or double check and average.

- None or none apparent (9)
- Recovered (6)
- Recovering (3)
- Recent or no recovery (1)

Check all disturbances observed

- mowing
- grazing
- clearcutting
- selective cutting
- woody debris removal
- toxic pollutants
- shrub/sapling removal
- herbaceous/aquatic bed removal
- sedimentation
- dredging
- farming
- nutrient enrichment

31
subtotal this page

Site: NCHP - wet 9 Rater(s): AAJ Date: 12/17/24

31

subtotal first page

0 31

max 10 pts.

subtotal

Metric 5. Special Wetlands.

Check all that apply and score as indicated.

- Bog (10)
- Fen (10)
- Old growth forest (10)
- Mature forested wetland (5)
- Lake Erie coastal/tributary wetland-unrestricted hydrology (10)
- Lake Erie coastal/tributary wetland-restricted hydrology (5)
- Lake Plain Sand Prairies (Oak Openings) (10)
- Relict Wet Prairies (10)
- Known occurrence state/federal threatened or endangered species (10)
- Significant migratory songbird/water fowl habitat or usage (10)
- Category 1 Wetland. See Question 1 Qualitative Rating (-10)

8 39

max 20 pts.

subtotal

Metric 6. Plant communities, interspersions, microtopography.

6a. Wetland Vegetation Communities.

Score all present using 0 to 3 scale.

- 0 Aquatic bed
- 3 Emergent
- 1 Shrub
- 2 Forest
- 0 Mudflats
- 0 Open water
- 0 Other _____

6b. horizontal (plan view) Interspersion.

Select only one.

- High (5)
- Moderately high(4)
- Moderate (3)
- Moderately low (2)
- Low (1)
- None (0)

6c. Coverage of invasive plants. Refer to Table 1 ORAM long form for list. Add or deduct points for coverage

- Extensive >75% cover (-5)
- Moderate 25-75% cover (-3)
- Sparse 5-25% cover (-1)
- Nearly absent <5% cover (0)
- Absent (1)

6d. Microtopography.

Score all present using 0 to 3 scale.

- Vegetated hummucks/tussucks
- Coarse woody debris >15cm (6in)
- Standing dead >25cm (10in) dbh
- Amphibian breeding pools

Vegetation Community Cover Scale

0	Absent or comprises <0.1ha (0.2471 acres) contiguous area
1	Present and either comprises small part of wetland's vegetation and is of moderate quality, or comprises a significant part but is of low quality
2	Present and either comprises significant part of wetland's vegetation and is of moderate quality or comprises a small part and is of high quality
3	Present and comprises significant part, or more, of wetland's vegetation and is of high quality

Narrative Description of Vegetation Quality

low	Low spp diversity and/or predominance of nonnative or disturbance tolerant native species
mod	Native spp are dominant component of the vegetation, although nonnative and/or disturbance tolerant native spp can also be present, and species diversity moderate to moderately high, but generally w/o presence of rare threatened or endangered spp
high	A predominance of native species, with nonnative spp and/or disturbance tolerant native spp absent or virtually absent, and high spp diversity and often, but not always, the presence of rare, threatened, or endangered spp

Mudflat and Open Water Class Quality

0	Absent <0.1ha (0.247 acres)
1	Low 0.1 to <1ha (0.247 to 2.47 acres)
2	Moderate 1 to <4ha (2.47 to 9.88 acres)
3	High 4ha (9.88 acres) or more

Microtopography Cover Scale

0	Absent
1	Present very small amounts or if more common of marginal quality
2	Present in moderate amounts, but not of highest quality or in small amounts of highest quality
3	Present in moderate or greater amounts and of highest quality

39

End of Quantitative Rating. Complete Categorization Worksheets.



Primary Headwater Habitat Evaluation Form

HHEI Score (sum of metrics 1, 2, 3):

46

SITE NAME/LOCATION NCHP
 SITE NUMBER 5001 RIVER BASIN Scioto River DRAINAGE AREA (mi²) 4
 LENGTH OF STREAM REACH (ft) 1510 LAT. 40.01332 LONG. 82.834119 RIVER CODE _____ RIVER MILE _____
 DATE 9/2/22 SCORER DAL COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Field Evaluation Manual for Ohio's PHWH Streams" for Instructions

STREAM CHANNEL NONE / NATURAL CHANNEL RECOVERED RECOVERING RECENT OR NO RECOVERY

MODIFICATIONS: culvert, channelization

1. SUBSTRATE (Estimate percent of every type of substrate present. Check ONLY two predominant substrate TYPE boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B.

TYPE	PERCENT	TYPE	PERCENT
<input type="checkbox"/> BLDR SLABS [16 pts]	_____	<input checked="" type="checkbox"/> SILT [3 pt]	<u>70</u>
<input type="checkbox"/> BOULDER (>256 mm) [16 pts]	_____	<input type="checkbox"/> LEAF PACK/WOODY DEBRIS [3 pts]	_____
<input type="checkbox"/> BEDROCK [16 pt]	_____	<input type="checkbox"/> FINE DETRITUS [3 pts]	_____
<input type="checkbox"/> COBBLE (65-256 mm) [12 pts]	<u>5</u>	<input type="checkbox"/> CLAY or HARDPAN [0 pt]	_____
<input checked="" type="checkbox"/> GRAVEL (2-64 mm) [9 pts]	<u>15</u>	<input type="checkbox"/> MUCK [0 pts]	_____
<input type="checkbox"/> SAND (<2 mm) [6 pts]	_____	<input type="checkbox"/> ARTIFICIAL [3 pts]	<u>17</u>

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 5 (A) 12 (B) 4

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: TOTAL NUMBER OF SUBSTRATE TYPES:

HHEI Metric Points

Substrate Max = 40

16

A + B

2. Maximum Pool Depth (Measure the maximum pool depth within the 61 meter (200 ft) evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check ONLY one box):

<input type="checkbox"/> > 30 centimeters [20 pts]	<input checked="" type="checkbox"/> > 5 cm - 10 cm [15 pts]
<input type="checkbox"/> > 22.5 - 30 cm [30 pts]	<input type="checkbox"/> < 5 cm [5 pts]
<input type="checkbox"/> > 10 - 22.5 cm [25 pts]	<input type="checkbox"/> NO WATER OR MOIST CHANNEL [0 pts]

COMMENTS _____ MAXIMUM POOL DEPTH (centimeters): 10

Pool Depth Max = 30

5

3. BANK FULL WIDTH (Measured as the average of 3-4 measurements) (Check ONLY one box):

<input type="checkbox"/> > 4.0 meters (> 13') [30 pts]	<input checked="" type="checkbox"/> > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
<input type="checkbox"/> > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]	<input type="checkbox"/> ≤ 1.0 m (≤ 3' 3") [5 pts]
<input type="checkbox"/> > 1.5 m - 3.0 m (> 8' 7" - 4' 8") [20 pts]	

COMMENTS _____ AVERAGE BANKFULL WIDTH (meters) 1.2

Bankfull Width Max=30

15

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ☆NOTE: River Left (L) and Right (R) as looking downstream☆

RIPARIAN WIDTH		FLOODPLAIN QUALITY		FLOODPLAIN QUALITY	
L	R	L	R	L	R
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Wide >10m		Mature Forest, Wetland		Conservation Tillage	
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
Moderate 5-10m		Immature Forest, Shrub or Old Field		Urban or Industrial	
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Narrow <5m		Residential, Park, New Field		Open Pasture, Row Crop	
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
None		Fenced Pasture		Mining or Construction	

COMMENTS _____

FLOW REGIME (At Time of Evaluation) (Check ONLY one box):

<input checked="" type="checkbox"/> Stream Flowing	<input type="checkbox"/> Moist Channel, isolated pools, no flow (Intermittent)
<input type="checkbox"/> Subsurface flow with isolated pools (Interstitial)	<input type="checkbox"/> Dry channel, no water (Ephemeral)

COMMENTS _____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

<input checked="" type="checkbox"/> None	<input type="checkbox"/> 1.0	<input type="checkbox"/> 2.0	<input type="checkbox"/> 3.0
<input type="checkbox"/> 0.5	<input type="checkbox"/> 1.5	<input type="checkbox"/> 2.5	<input type="checkbox"/> >3

STREAM GRADIENT ESTIMATE

Flat (0.5 ft/100 ft) Flat to Moderate Moderate (2 ft/100 ft) Moderate to Severe Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? - Yes No QHEI Score _____ (If Yes, Attach Completed QHEI Form)

DOWNSTREAM DESIGNATED USE(S)

WWH Name: _____ Distance from Evaluated Stream _____
 CWH Name: _____ Distance from Evaluated Stream _____
 EWH Name: Rocky Fork Distance from Evaluated Stream 0.8 mi.

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION

USGS Quadrangle Name: New Albany, OH NRCS Soil Map Page: _____ NRCS Soil Map Stream Order _____
 County: Franklin Township / City: Graham

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 2/25/22 Quantity: 0.8"

Photograph Information: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 1590

Were samples collected for water chemistry? (Y/N): N (Note lab sample no. or id. and attach results) Lab Number: _____

Field Measures: Temp (°C) _____ Dissolved Oxygen (mg/l) _____ pH (S.U.) _____ Conductivity (µmhos/cm) _____

Is the sampling reach representative of the stream (Y/N) Y If not, please explain: _____

Additional comments/description of pollution impacts: _____

BIOTIC EVALUATION

Performed? (Y/N): N (If Yes, Record all observations. Voucher collections optional. NOTE: all voucher samples must be labeled with the site ID number. Include appropriate field data sheets from the Primary Headwater Habitat Assessment Manual)

Fish Observed? (Y/N) N Voucher? (Y/N) N Salamanders Observed? (Y/N) N Voucher? (Y/N) N
 Frogs or Tadpoles Observed? (Y/N) N Voucher? (Y/N) N Aquatic Macroinvertebrates Observed? (Y/N) N Voucher? (Y/N) N

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed):

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location





Primary Headwater Habitat Evaluation Form

HHEI Score (sum of metrics 1, 2, 3) : 91

SITE NAME/LOCATION NCWP SITE NUMBER 5002 RIVER BASIN SC10+0 DRAINAGE AREA (mi²) 0.3mi²
 LENGTH OF STREAM REACH (ft) 200 LAT. 40.011017 LONG. 82.834066 RIVER CODE _____ RIVER MILE _____
 DATE 8/2/27 SCORER REK COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Field Evaluation Manual for Ohio's PHWH Streams" for Instructions

STREAM CHANNEL NONE / NATURAL CHANNEL RECOVERED RECOVERING RECENT OR NO RECOVERY
 MODIFICATIONS: _____

1. SUBSTRATE (Estimate percent of every type of substrate present. Check ONLY two predominant substrate TYPE boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B.)

TYPE	PERCENT	TYPE	PERCENT
<input type="checkbox"/> BLDR SLABS [16 pts]	_____	<input checked="" type="checkbox"/> SILT [3 pt]	<u>20</u>
<input type="checkbox"/> BOULDER (>256 mm) [16 pts]	_____	<input type="checkbox"/> LEAF PACK/WOODY DEBRIS [3 pts]	_____
<input type="checkbox"/> BEDROCK [16 pt]	_____	<input type="checkbox"/> FINE DETRITUS [3 pts]	_____
<input type="checkbox"/> COBBLE (65-256 mm) [12 pts]	<u>5</u>	<input type="checkbox"/> CLAY or HARDPAN [0 pt]	_____
<input checked="" type="checkbox"/> GRAVEL (2-64 mm) [9 pts]	<u>10</u>	<input type="checkbox"/> MUCK [0 pts]	_____
<input type="checkbox"/> SAND (<2 mm) [6 pts]	_____	<input type="checkbox"/> ARTIFICIAL [3 pts]	<u>5</u>

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 5 (A) 12 (B) 4

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: _____ TOTAL NUMBER OF SUBSTRATE TYPES: _____

2. Maximum Pool Depth (Measure the maximum pool depth within the 61 meter (200 ft) evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check ONLY one box):

<input type="checkbox"/> > 30 centimeters [20 pts]	<input checked="" type="checkbox"/> > 5 cm - 10 cm [15 pts]
<input type="checkbox"/> > 22.5 - 30 cm [30 pts]	<input type="checkbox"/> < 5 cm [5 pts]
<input type="checkbox"/> > 10 - 22.5 cm [25 pts]	<input type="checkbox"/> NO WATER OR MOIST CHANNEL [0 pts]

COMMENTS _____ MAXIMUM POOL DEPTH (centimeters): 8

3. BANK FULL WIDTH (Measured as the average of 3-4 measurements) (Check ONLY one box):

<input checked="" type="checkbox"/> > 4.0 meters (> 13') [30 pts]	<input type="checkbox"/> > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
<input type="checkbox"/> > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]	<input type="checkbox"/> ≤ 1.0 m (≤ 3' 3") [5 pts]
<input type="checkbox"/> > 1.5 m - 3.0 m (> 9' 7" - 4' 8") [20 pts]	

COMMENTS widened @ culving AVERAGE BANKFULL WIDTH (meters) 4.6

HHEI Metric Points

Substrate Max = 40

16

A + B

Pool Depth Max = 30

15

Bankfull Width Max=30

30

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ☆NOTE: River Left (L) and Right (R) as looking downstream☆

RIPARIAN WIDTH		FLOODPLAIN QUALITY			
L	R	L	R	L	R
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Wide >10m		Mature Forest, Wetland		Conservation Tillage	
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Moderate 5-10m		Immature Forest, Shrub or Old Field		Urban or Industrial	
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Narrow <5m		Residential, Park, New Field		Open Pasture, Row Crop	
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
None		Fenced Pasture		Mining or Construction	

COMMENTS _____

FLOW REGIME (At Time of Evaluation) (Check ONLY one box):

<input checked="" type="checkbox"/> Stream Flowing	<input type="checkbox"/> Moist Channel, isolated pools, no flow (Intermittent)
<input type="checkbox"/> Subsurface flow with isolated pools (Interstitial)	<input type="checkbox"/> Dry channel, no water (Ephemeral)

COMMENTS _____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

<input checked="" type="checkbox"/> None	<input type="checkbox"/> 1.0	<input type="checkbox"/> 2.0	<input type="checkbox"/> 3.0
<input type="checkbox"/> 0.5	<input type="checkbox"/> 1.5	<input type="checkbox"/> 2.5	<input type="checkbox"/> >3

STREAM GRADIENT ESTIMATE

Flat (0.5 ft/100 ft) Flat to Moderate Moderate (2 ft/100 ft) Moderate to Severe Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This information Must Also be Completed):

QHEI PERFORMED? - Yes No QHEI Score _____ (If Yes, Attach Completed QHEI Form)

DOWNSTREAM DESIGNATED USE(S)

WWH Name: _____ Distance from Evaluated Stream _____
 CWH Name: _____ Distance from Evaluated Stream _____
 EWH Name: Rocky Fork Distance from Evaluated Stream 0.8 mi

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION

USGS Quadrangle Name: New Albany NRCS Soil Map Page: _____ NRCS Soil Map Stream Order _____
County: Franklin Township / City: Graham

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 2/25/77 Quantity: 0.8"

Photograph Information: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 10%

Were samples collected for water chemistry? (Y/N): N (Note lab sample no. or id. and attach results) Lab Number: _____

Field Measures: Temp (°C) _____ Dissolved Oxygen (mg/l) _____ pH (S.U.) _____ Conductivity (µmhos/cm) _____

Is the sampling reach representative of the stream (Y/N) Y If not, please explain: _____

Additional comments/description of pollution impacts: _____

BIOTIC EVALUATION


Performed? (Y/N): N (If Yes, Record all observations. Voucher collections optional. NOTE: all voucher samples must be labeled with the site ID number. Include appropriate field data sheets from the Primary Headwater Habitat Assessment Manual)

Fish Observed? (Y/N) N Voucher? (Y/N) N Salamanders Observed? (Y/N) N Voucher? (Y/N) N
Frogs or Tadpoles Observed? (Y/N) N Voucher? (Y/N) N Aquatic Macroinvertebrates Observed? (Y/N) N Voucher? (Y/N) N

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed):

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

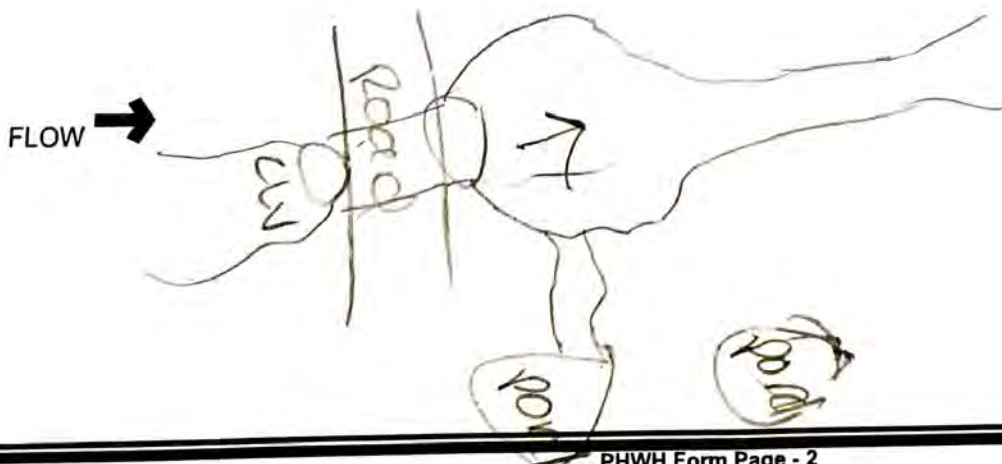

Ohio EPA Primary Headwater Habitat Evaluation Form

HHEI Score (sum of metrics 1, 2, 3):

41

SITE NAME/LOCATION NCHP
 SITE NUMBER 5005 RIVER BASIN Sicoma River DRAINAGE AREA (mi²) 40.1m²
 LENGTH OF STREAM REACH (ft) 80' LAT 40.00240 LONG 87.92576 RIVER CODE _____ RIVER MILE _____
 DATE 3/2/22 SCORER REK COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Field Evaluation Manual for Ohio's PWH Streams" for Instructions

STREAM CHANNEL NONE / NATURAL CHANNEL RECOVERED RECOVERING RECENT OR NO RECOVERY
 MODIFICATIONS: culvert tech, rd king

1. SUBSTRATE (Estimate percent of every type of substrate present. Check ONLY two predominant substrate TYPE boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B.

TYPE	PERCENT	TYPE	PERCENT
<input type="checkbox"/> BLDR SLABS [16 pts]	_____	<input checked="" type="checkbox"/> SILT [3 pt]	<u>40</u>
<input type="checkbox"/> BOULDER (>256 mm) [16 pts]	_____	<input type="checkbox"/> LEAF PACK/WOODY DEBRIS [3 pts]	_____
<input type="checkbox"/> BEDROCK [16 pt]	_____	<input type="checkbox"/> FINE DETRITUS [3 pts]	_____
<input type="checkbox"/> COBBLE (65-256 mm) [12 pts]	_____	<input type="checkbox"/> CLAY or HARDPAN [0 pt]	_____
<input type="checkbox"/> GRAVEL (2-64 mm) [9 pts]	_____	<input type="checkbox"/> MUCK [0 pts]	_____
<input checked="" type="checkbox"/> SAND (<2 mm) [6 pts]	<u>60</u>	<input type="checkbox"/> ARTIFICIAL [3 pts]	_____

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 0 (A) 9 (B) 2

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: _____ TOTAL NUMBER OF SUBSTRATE TYPES: _____

HHEI Metric Points

Substrate Max = 40

11

A + B

Pool Depth Max = 30

15

Bankfull Width Max = 30

13

2. Maximum Pool Depth (Measure the maximum pool depth within the 61 meter (200 ft) evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check ONLY one box):
 > 30 centimeters [20 pts]
 > 22.5 - 30 cm [30 pts]
 > 10 - 22.5 cm [25 pts]
 > 5 cm - 10 cm [15 pts]
 < 5 cm [5 pts]
 NO WATER OR MOIST CHANNEL [0 pts]

COMMENTS _____ MAXIMUM POOL DEPTH (centimeters): 9

3. BANK FULL WIDTH (Measured as the average of 3-4 measurements) (Check ONLY one box):
 > 4.0 meters (> 13') [30 pts]
 > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]
 > 1.5 m - 3.0 m (> 9' 7" - 4' 8") [20 pts]
 > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
 ≤ 1.0 m (≤ 3' 3") [5 pts]

COMMENTS _____ AVERAGE BANKFULL WIDTH (meters) 1.2

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ☆NOTE: River Left (L) and Right (R) as looking downstream☆

RIPARIAN WIDTH		FLOODPLAIN QUALITY			
L	R	L	R	L	R
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
(Per Bank)		(Most Predominant per Bank)			
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Wide >10m		<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
Moderate 5-10m		<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Narrow <5m		<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
None		<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
None		<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
COMMENTS _____		<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
		<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
		<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

FLOW REGIME (At Time of Evaluation) (Check ONLY one box):
 Stream Flowing
 Subsurface flow with isolated pools (Interstitial)
 Moist Channel, isolated pools, no flow (Intermittent)
 Dry channel, no water (Ephemeral)

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):
 None
 0.5
 1.0
 1.5
 2.0
 2.5
 3.0
 >3

STREAM GRADIENT ESTIMATE
 Flat (0.5 ft/100 ft) Flat to Moderate Moderate (2 ft/100 ft) Moderate to Severe Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? - Yes No QHEI Score _____ (If Yes, Attach Completed QHEI Form)

DOWNSTREAM DESIGNATED USE(S)

WWH Name: _____ Distance from Evaluated Stream _____
 CWH Name: _____ Distance from Evaluated Stream _____
 EWH Name: ROCKY FORK Distance from Evaluated Stream 1.3

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION

USGS Quadrangle Name: New Albany NRCS Soil Map Page: _____ NRCS Soil Map Stream Order _____
 County: Franklin Township / City: Grananna

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 2/25/22 Quantity: 0.8"
 Photograph Information: _____
 Elevated Turbidity? (Y/N): N Canopy (% open): 20%
 Were samples collected for water chemistry? (Y/N): N (Note lab sample no. or id. and attach results) Lab Number: _____
 Field Measures: Temp (°C) _____ Dissolved Oxygen (mg/l) _____ pH (S.U.) _____ Conductivity (µmhos/cm) _____
 Is the sampling reach representative of the stream (Y/N) Y If not, please explain: _____


Additional comments/description of pollution impacts: _____

BIOTIC EVALUATION

Performed? (Y/N): N (If Yes, Record all observations. Voucher collections optional. NOTE: all voucher samples must be labeled with the site ID number. Include appropriate field data sheets from the Primary Headwater Habitat Assessment Manual)
 Fish Observed? (Y/N) N Voucher? (Y/N) N Salamanders Observed? (Y/N) N Voucher? (Y/N) N
 Frogs or Tadpoles Observed? (Y/N) N Voucher? (Y/N) N Aquatic Macroinvertebrates Observed? (Y/N) N Voucher? (Y/N) _____
 Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed):

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

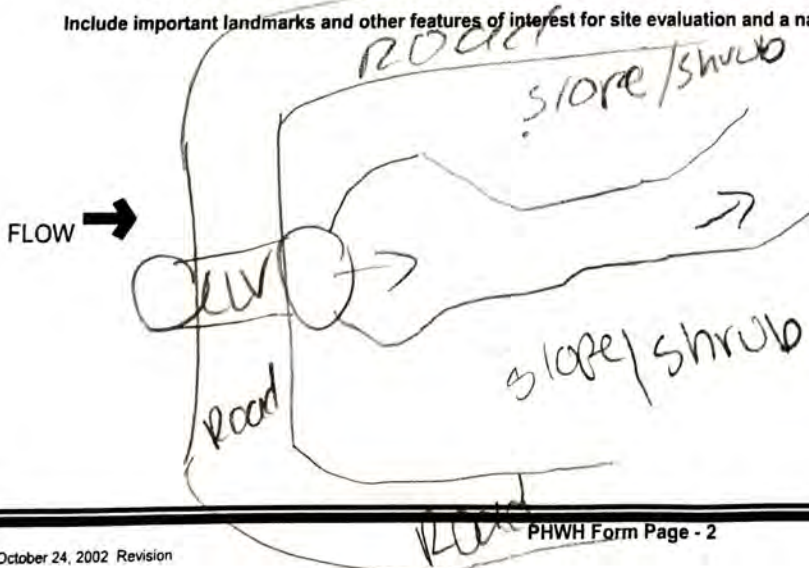



Primary Headwater Habitat Evaluation Form

HHEI Score (sum of metrics 1, 2, 3):

47

SITE NAME/LOCATION NCHP SITE NUMBER 5003 RIVER BASIN Susquehanna River DRAINAGE AREA (mi²) 0.04
 LENGTH OF STREAM REACH (ft) 105 LAT: 40.001079 LONG: 82.834067 RIVER CODE _____ RIVER MILE _____
 DATE 3/2/22 SCORER PEK COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Field Evaluation Manual for Ohio's PHWH Streams" for Instructions

STREAM CHANNEL NONE / NATURAL CHANNEL RECOVERED RECOVERING RECENT OR NO RECOVERY

MODIFICATIONS: Converted, Road King

1. SUBSTRATE (Estimate percent of every type of substrate present. Check ONLY two predominant substrate TYPE boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B.

TYPE	PERCENT	TYPE	PERCENT
<input type="checkbox"/> BLDR SLABS [16 pts]	_____	<input checked="" type="checkbox"/> SILT [3 pt]	<u>40</u>
<input type="checkbox"/> BOULDER (>256 mm) [16 pts]	_____	<input type="checkbox"/> LEAF PACK/WOODY DEBRIS [3 pts]	<u>10</u>
<input type="checkbox"/> BEDROCK [16 pt]	_____	<input type="checkbox"/> FINE DETRITUS [3 pts]	_____
<input type="checkbox"/> COBBLE (65-256 mm) [12 pts]	<u>10</u>	<input type="checkbox"/> CLAY or HARDPAN [0 pt]	_____
<input checked="" type="checkbox"/> GRAVEL (2-64 mm) [9 pts]	<u>30</u>	<input type="checkbox"/> MUCK [0 pts]	_____
<input type="checkbox"/> SAND (<2 mm) [6 pts]	<u>10</u>	<input type="checkbox"/> ARTIFICIAL [3 pts]	_____

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 10

(A) 12

(B) 5

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES:

TOTAL NUMBER OF SUBSTRATE TYPES:

HHEI Metric Points

Substrate Max = 40

17

A + B

2. Maximum Pool Depth (Measure the maximum pool depth within the 61 meter (200 ft) evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check ONLY one box):

<input type="checkbox"/> > 30 centimeters [20 pts]	<input checked="" type="checkbox"/> > 5 cm - 10 cm [15 pts]
<input type="checkbox"/> > 22.5 - 30 cm [30 pts]	<input type="checkbox"/> < 5 cm [5 pts]
<input type="checkbox"/> > 10 - 22.5 cm [25 pts]	<input type="checkbox"/> NO WATER OR MOIST CHANNEL [0 pts]

COMMENTS _____

MAXIMUM POOL DEPTH (centimeters):

10

Pool Depth Max = 30

15

3. BANK FULL WIDTH (Measured as the average of 3-4 measurements) (Check ONLY one box):

<input type="checkbox"/> > 4.0 meters (> 13') [30 pts]	<input checked="" type="checkbox"/> > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
<input type="checkbox"/> > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]	<input type="checkbox"/> ≤ 1.0 m (≤ 3' 3") [5 pts]
<input type="checkbox"/> > 1.5 m - 3.0 m (> 9' 7" - 4' 8") [20 pts]	

COMMENTS _____

AVERAGE BANKFULL WIDTH (meters)

0.6

Bankfull Width Max=30

15

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ☆NOTE: River Left (L) and Right (R) as looking downstream☆

RIPARIAN WIDTH		FLOODPLAIN QUALITY			
L	R	L	R	L	R
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Wide >10m		Mature Forest, Wetland		Conservation Tillage	
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
Moderate 5-10m		Immature Forest, Shrub or Old Field		Urban or Industrial	
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Narrow <5m		Residential, Park, New Field		Open Pasture, Row Crop	
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
None		Fenced Pasture		Mining or Construction	

COMMENTS _____

FLOW REGIME (At Time of Evaluation) (Check ONLY one box):

<input checked="" type="checkbox"/> Stream Flowing	<input type="checkbox"/> Moist Channel, isolated pools, no flow (Intermittent)
<input type="checkbox"/> Subsurface flow with isolated pools (Interstitial)	<input type="checkbox"/> Dry channel, no water (Ephemeral)

COMMENTS _____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

<input checked="" type="checkbox"/> None	<input type="checkbox"/> 1.0	<input type="checkbox"/> 2.0	<input type="checkbox"/> 3.0
<input type="checkbox"/> 0.5	<input type="checkbox"/> 1.5	<input type="checkbox"/> 2.5	<input type="checkbox"/> >3

STREAM GRADIENT ESTIMATE

Flat (0.5 ft/100 ft) Flat to Moderate Moderate (2 ft/100 ft) Moderate to Severe Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This information Must Also be Completed):

QHEI PERFORMED? - Yes No QHEI Score _____ (If Yes, Attach Completed QHEI Form)

DOWNSTREAM DESIGNATED USE(S)

WWH Name: _____ Distance from Evaluated Stream _____
 CWH Name: _____ Distance from Evaluated Stream _____
 EWH Name: Rocky Fork Distance from Evaluated Stream 1.1 m.

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION

USGS Quadrangle Name: New Albany, OH NRCS Soil Map Page: _____ NRCS Soil Map Stream Order _____
 County: Franklin Township / City: Gabanna

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 2/25/22 Quantity: 0.8"

Photograph Information: _____

Elevated Turbidity? (Y/N): N Canopy (% open): 15

Were samples collected for water chemistry? (Y/N): N (Note lab sample no. or id. and attach results) Lab Number: _____

Field Measures: Temp (°C) _____ Dissolved Oxygen (mg/l) _____ pH (S.U.) _____ Conductivity (µmhos/cm) _____

Is the sampling reach representative of the stream (Y/N) Y If not, please explain: _____

Additional comments/description of pollution impacts: _____

BIOTIC EVALUATION


Performed? (Y/N): N (If Yes, Record all observations. Voucher collections optional. NOTE: all voucher samples must be labeled with the site ID number. Include appropriate field data sheets from the Primary Headwater Habitat Assessment Manual)

Fish Observed? (Y/N) N Voucher? (Y/N) N Salamanders Observed? (Y/N) N Voucher? (Y/N) N
 Frogs or Tadpoles Observed? (Y/N) N Voucher? (Y/N) N Aquatic Macroinvertebrates Observed? (Y/N) Y Voucher? (Y/N) N

Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed):

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

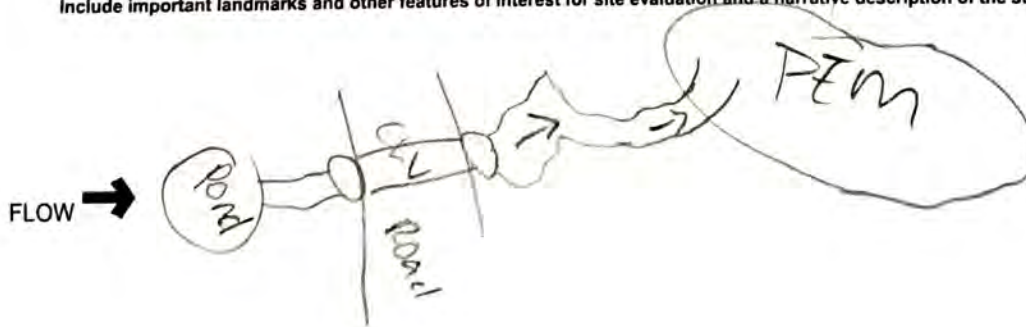



Primary Headwater Habitat Evaluation Form

HHEI Score (sum of metrics 1, 2, 3) : 44

SITE NAME/LOCATION NCHP SITE NUMBER 5000 RIVER BASIN Scioto River DRAINAGE AREA (mi²) 0.11mi²
 LENGTH OF STREAM REACH (ft) 200' LAT 40 007994 LONG -82 855057 RIVER CODE _____ RIVER MILE _____
 DATE 3/2/22 SCORER REK COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Field Evaluation Manual for Ohio's PHWH Streams" for Instructions

STREAM CHANNEL NONE / NATURAL CHANNEL RECOVERED RECOVERING RECENT OR NO RECOVERY

MODIFICATIONS: Culvert, Road King

1. SUBSTRATE (Estimate percent of every type of substrate present. Check ONLY two predominant substrate TYPE boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B.)

TYPE	PERCENT	TYPE	PERCENT
<input type="checkbox"/> Bldr Slabs [16 pts]	_____	<input checked="" type="checkbox"/> SILT [3 pt]	15
<input type="checkbox"/> Boulder (>256 mm) [16 pts]	_____	<input type="checkbox"/> Leaf Pack/Woody Debris [3 pts]	_____
<input type="checkbox"/> Bedrock [16 pt]	_____	<input type="checkbox"/> Fine Detritus [3 pts]	_____
<input type="checkbox"/> Cobble (65-256 mm) [12 pts]	5	<input type="checkbox"/> Clay or Hardpan [0 pt]	_____
<input type="checkbox"/> Gravel (2-64 mm) [9 pts]	10	<input type="checkbox"/> Muck [0 pts]	_____
<input checked="" type="checkbox"/> Sand (<2 mm) [6 pts]	100	<input type="checkbox"/> Artificial [3 pts]	10

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 5 (A) 9 (B) 5

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: _____ TOTAL NUMBER OF SUBSTRATE TYPES: _____

2. Maximum Pool Depth (Measure the maximum pool depth within the 61 meter (200 ft) evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check ONLY one box):

<input type="checkbox"/> > 30 centimeters [20 pts]	<input checked="" type="checkbox"/> > 5 cm - 10 cm [15 pts]
<input type="checkbox"/> > 22.5 - 30 cm [30 pts]	<input type="checkbox"/> < 5 cm [5 pts]
<input type="checkbox"/> > 10 - 22.5 cm [25 pts]	<input type="checkbox"/> NO WATER OR MOIST CHANNEL [0 pts]

COMMENTS _____ MAXIMUM POOL DEPTH (centimeters): 3

3. BANK FULL WIDTH (Measured as the average of 3-4 measurements) (Check ONLY one box):

<input type="checkbox"/> > 4.0 meters (> 13') [30 pts]	<input checked="" type="checkbox"/> > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
<input type="checkbox"/> > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]	<input type="checkbox"/> ≤ 1.0 m (≤ 3' 3") [5 pts]
<input type="checkbox"/> > 1.5 m - 3.0 m (> 9' 7" - 4' 8") [20 pts]	

COMMENTS _____ AVERAGE BANKFULL WIDTH (meters): 1

HHEI Metric Points

Substrate Max = 40

14

A + B

Pool Depth Max = 30

5

Bankfull Width Max=30

15

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ☆NOTE: River Left (L) and Right (R) as looking downstream☆

RIPARIAN WIDTH		FLOODPLAIN QUALITY			
L	R	L	R	L	R
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Wide >10m		Mature Forest, Wetland		Conservation Tillage	
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Moderate 5-10m		Immature Forest, Shrub or Old Field		Urban or Industrial	
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Narrow <5m		Residential, Park, New Field		Open Pasture, Row Crop	
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
None		Fenced Pasture		Mining or Construction	

COMMENTS _____

FLOW REGIME (At Time of Evaluation) (Check ONLY one box):

Stream Flowing Moist Channel, isolated pools, no flow (Intermittent)
 Subsurface flow with isolated pools (Interstitial) Dry channel, no water (Ephemeral)

COMMENTS _____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

None 1.0 2.0 3.0
 0.5 1.5 2.5 >3

STREAM GRADIENT ESTIMATE

Flat (0.5 ft/100 ft) Flat to Moderate Moderate (2 ft/100 ft) Moderate to Severe Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? - Yes No QHEI Score _____ (If Yes, Attach Completed QHEI Form)

DOWNSTREAM DESIGNATED USE(S)

WWH Name: Big Walnut Creek Distance from Evaluated Stream 0.6
 CWH Name: _____ Distance from Evaluated Stream _____
 EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION

USGS Quadrangle Name: New Albany NRCS Soil Map Page: _____ NRCS Soil Map Stream Order _____
 County: Franklin Township / City: Graham

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 2/25/22 Quantity: 0.8"
 Photograph Information: _____
 Elevated Turbidity? (Y/N): N Canopy (% open): 70%
 Were samples collected for water chemistry? (Y/N): N (Note lab sample no. or id. and attach results) Lab Number: _____
 Field Measures: Temp (°C) _____ Dissolved Oxygen (mg/l) _____ pH (S.U.) _____ Conductivity (µmhos/cm) _____
 Is the sampling reach representative of the stream (Y/N) Y If not, please explain: _____


Additional comments/description of pollution impacts: _____

BIOTIC EVALUATION

Performed? (Y/N): N (If Yes, Record all observations. Voucher collections optional. NOTE: all voucher samples must be labeled with the site ID number. Include appropriate field data sheets from the Primary Headwater Habitat Assessment Manual)
 Fish Observed? (Y/N) N Voucher? (Y/N) N Salamanders Observed? (Y/N) N Voucher? (Y/N) N
 Frogs or Tadpoles Observed? (Y/N) N Voucher? (Y/N) N Aquatic Macroinvertebrates Observed? (Y/N) N Voucher? (Y/N) N
 Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed):

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

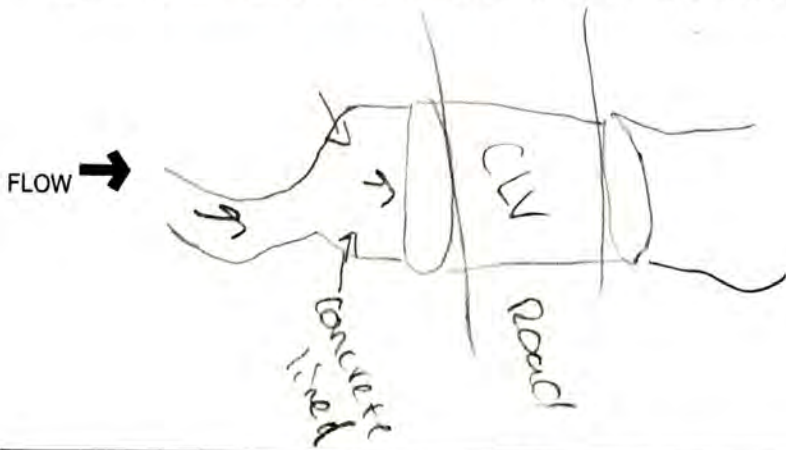



Primary Headwater Habitat Evaluation Form

HHEI Score (sum of metrics 1, 2, 3):

66

SITE NAME/LOCATION ASHP

SITE NUMBER 507

RIVER BASIN Scioto

DRAINAGE AREA (mi²) 0.45 mi²

LENGTH OF STREAM REACH (ft) 150'

LAT. 10.004413

LONG. -82.847822

RIVER CODE

RIVER MILE

DATE 3/2/22

SCORER REL

COMMENTS

NOTE: Complete All Items On This Form - Refer to "Field Evaluation Manual for Ohio's PHWH Streams" for Instructions

STREAM CHANNEL

NONE / NATURAL CHANNEL

RECOVERED

RECOVERING

RECENT OR NO RECOVERY

MODIFICATIONS:

channelized, culvert, recent dist.

1. SUBSTRATE (Estimate percent of every type of substrate present. Check ONLY two predominant substrate TYPE boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B.

TYPE	PERCENT	TYPE	PERCENT
<input type="checkbox"/> BLD R SLABS [16 pts]	_____	<input type="checkbox"/> SILT [3 pt]	_____
<input type="checkbox"/> BOULDER (>256 mm) [16 pts]	_____	<input type="checkbox"/> LEAF PACK/WOODY DEBRIS [3 pts]	_____
<input type="checkbox"/> BEDROCK [16 pt]	_____	<input type="checkbox"/> FINE DETRITUS [3 pts]	_____
<input checked="" type="checkbox"/> COBBLE (65-256 mm) [12 pts]	<u>20</u>	<input type="checkbox"/> CLAY or HARDPAN [0 pt]	_____
<input checked="" type="checkbox"/> GRAVEL (2-64 mm) [9 pts]	<u>30</u>	<input type="checkbox"/> MUCK [0 pts]	_____
<input type="checkbox"/> SAND (<2 mm) [6 pts]	<u>20</u>	<input type="checkbox"/> ARTIFICIAL [3 pts]	<u>10</u>

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 20

(A) 21

(B) 5

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES:

TOTAL NUMBER OF SUBSTRATE TYPES:

2. Maximum Pool Depth (Measure the maximum pool depth within the 61 meter (200 ft) evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check ONLY one box):

<input type="checkbox"/> > 30 centimeters [20 pts]	<input checked="" type="checkbox"/> > 5 cm - 10 cm [15 pts]
<input type="checkbox"/> > 22.5 - 30 cm [30 pts]	<input type="checkbox"/> < 5 cm [5 pts]
<input type="checkbox"/> > 10 - 22.5 cm [25 pts]	<input type="checkbox"/> NO WATER OR MOIST CHANNEL [0 pts]

COMMENTS

MAXIMUM POOL DEPTH (centimeters):

3. BANK FULL WIDTH (Measured as the average of 3-4 measurements) (Check ONLY one box):

<input type="checkbox"/> > 4.0 meters (> 13') [30 pts]	<input type="checkbox"/> > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
<input checked="" type="checkbox"/> > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]	<input type="checkbox"/> ≤ 1.0 m (≤ 3' 3") [5 pts]
<input type="checkbox"/> > 1.5 m - 3.0 m (> 9' 7" - 4' 8") [20 pts]	

COMMENTS

AVERAGE BANKFULL WIDTH (meters)

HHEI Metric Points

Substrate Max = 40

26

A + B

Pool Depth Max = 30

15

Bankfull Width Max=30

25

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY

☆NOTE: River Left (L) and Right (R) as looking downstream☆

RIPARIAN WIDTH

FLOODPLAIN QUALITY

- L R (Per Bank)
- Wide >10m
- Moderate 5-10m
- Narrow <5m
- None

- L R (Most Predominant per Bank)
- Mature Forest, Wetland
- Immature Forest, Shrub or Old Field
- Residential, Park, New Field
- Fenced Pasture

- L R
- Conservation Tillage
- Urban or Industrial
- Open Pasture, Row Crop
- Mining or Construction

COMMENTS

FLOW REGIME (At Time of Evaluation) (Check ONLY one box):

- Stream Flowing
- Subsurface flow with isolated pools (Interstitial)
- Moist Channel, isolated pools, no flow (Intermittent)
- Dry channel, no water (Ephemeral)

COMMENTS

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

- None
- 0.5
- 1.0
- 1.5
- 2.0
- 2.5
- 3.0
- >3

STREAM GRADIENT ESTIMATE

- Flat (0.5 ft/100 ft)
- Flat to Moderate
- Moderate (2 ft/100 ft)
- Moderate to Severe
- Severe (10 ft/100 ft)

ADDITIONAL STREAM INFORMATION (This Information Must Also be Completed):

QHEI PERFORMED? - Yes No QHEI Score _____ (If Yes, Attach Completed QHEI Form)

DOWNSTREAM DESIGNATED USE(S)

WWH Name: Big Walnut Creek Distance from Evaluated Stream: 0.58 mi
 CWH Name: _____ Distance from Evaluated Stream: _____
 EWH Name: _____ Distance from Evaluated Stream: _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION

USGS Quadrangle Name: New Albany NRCS Soil Map Page: _____ NRCS Soil Map Stream Order: _____
 County: Franklin Township / City: Grahamma

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 2/25/22 Quantity: 0.8"
 Photograph Information: _____
 Elevated Turbidity? (Y/N): N Canopy (% open): 75-90
 Were samples collected for water chemistry? (Y/N): N (Note lab sample no. or id. and attach results) Lab Number: _____
 Field Measures: Temp (°C) _____ Dissolved Oxygen (mg/l) _____ pH (S.U.) _____ Conductivity (µmhos/cm) _____
 Is the sampling reach representative of the stream (Y/N): Y If not, please explain: _____


Additional comments/description of pollution impacts: _____

BIOTIC EVALUATION

Performed? (Y/N): N (If Yes, Record all observations. Voucher collections optional. NOTE: all voucher samples must be labeled with the site ID number. Include appropriate field data sheets from the Primary Headwater Habitat Assessment Manual)
 Fish Observed? (Y/N) N Voucher? (Y/N) N Salamanders Observed? (Y/N) N Voucher? (Y/N) N
 Frogs or Tadpoles Observed? (Y/N) N Voucher? (Y/N) N Aquatic Macroinvertebrates Observed? (Y/N) N Voucher? (Y/N) N
 Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed):

Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

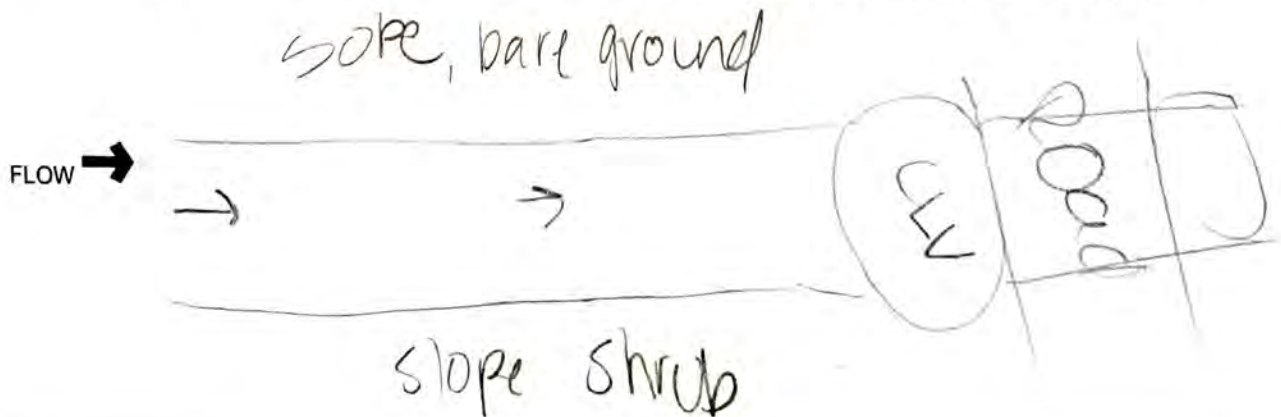



Primary Headwater Habitat Evaluation Form

HHEI Score (sum of metrics 1, 2, 3) : 106

SITE NAME/LOCATION NCHP SITE NUMBER 5008 RIVER BASIN SL1010 DRAINAGE AREA (mi²) 40.1 mi²
 LENGTH OF STREAM REACH (ft) 200' LAT. 40.00049 LONG. -82.80390 RIVER CODE _____ RIVER MILE _____
 DATE 3/2/22 SCORER REK COMMENTS _____

NOTE: Complete All Items On This Form - Refer to "Field Evaluation Manual for Ohio's PHWH Streams" for Instructions

STREAM CHANNEL NONE / NATURAL CHANNEL RECOVERED RECOVERING RECENT OR NO RECOVERY
 MODIFICATIONS: channelized

1. SUBSTRATE (Estimate percent of every type of substrate present. Check ONLY two predominant substrate TYPE boxes (Max of 32). Add total number of significant substrate types found (Max of 8). Final metric score is sum of boxes A & B.)

TYPE	PERCENT	TYPE	PERCENT
<input type="checkbox"/> BLDR SLABS [16 pts]	_____	<input type="checkbox"/> SILT [3 pt]	<u>20</u>
<input type="checkbox"/> BOULDER (>256 mm) [16 pts]	_____	<input type="checkbox"/> LEAF PACK/WOODY DEBRIS [3 pts]	_____
<input type="checkbox"/> BEDROCK [16 pt]	_____	<input type="checkbox"/> FINE DETRITUS [3 pts]	_____
<input checked="" type="checkbox"/> COBBLE (65-256 mm) [12 pts]	<u>20</u>	<input type="checkbox"/> CLAY or HARDPAN [0 pt]	_____
<input checked="" type="checkbox"/> GRAVEL (2-64 mm) [9 pts]	<u>30</u>	<input type="checkbox"/> MUCK [0 pts]	_____
<input type="checkbox"/> SAND (<2 mm) [6 pts]	<u>20</u>	<input type="checkbox"/> ARTIFICIAL [3 pts]	<u>10</u>

Total of Percentages of Bldr Slabs, Boulder, Cobble, Bedrock 20 (A) 2 (B) 3

SCORE OF TWO MOST PREDOMINATE SUBSTRATE TYPES: _____ TOTAL NUMBER OF SUBSTRATE TYPES: _____

2. Maximum Pool Depth (Measure the maximum pool depth within the 61 meter (200 ft) evaluation reach at the time of evaluation. Avoid plunge pools from road culverts or storm water pipes) (Check ONLY one box):

<input type="checkbox"/> > 30 centimeters [20 pts]	<input checked="" type="checkbox"/> > 5 cm - 10 cm [15 pts]
<input type="checkbox"/> > 22.5 - 30 cm [30 pts]	<input type="checkbox"/> < 5 cm [5 pts]
<input type="checkbox"/> > 10 - 22.5 cm [25 pts]	<input type="checkbox"/> NO WATER OR MOIST CHANNEL [0 pts]

COMMENTS _____ MAXIMUM POOL DEPTH (centimeters): 10

3. BANK FULL WIDTH (Measured as the average of 3-4 measurements) (Check ONLY one box):

<input type="checkbox"/> > 4.0 meters (> 13') [30 pts]	<input type="checkbox"/> > 1.0 m - 1.5 m (> 3' 3" - 4' 8") [15 pts]
<input checked="" type="checkbox"/> > 3.0 m - 4.0 m (> 9' 7" - 13') [25 pts]	<input type="checkbox"/> ≤ 1.0 m (≤ 3' 3") [5 pts]
<input type="checkbox"/> > 1.5 m - 3.0 m (> 9' 7" - 4' 8") [20 pts]	

COMMENTS _____ AVERAGE BANKFULL WIDTH (meters) 3

HHEI Metric Points

Substrate Max = 40 26

A + B

Pool Depth Max = 30 15

Bankfull Width Max = 30 25

This information must also be completed

RIPARIAN ZONE AND FLOODPLAIN QUALITY ☆NOTE: River Left (L) and Right (R) as looking downstream☆

RIPARIAN WIDTH		FLOODPLAIN QUALITY	
L	R	L	R
<input type="checkbox"/>	<input type="checkbox"/> Wide >10m	<input type="checkbox"/>	<input type="checkbox"/> Mature Forest, Wetland
<input type="checkbox"/>	<input type="checkbox"/> Moderate 5-10m	<input type="checkbox"/>	<input type="checkbox"/> Immature Forest, Shrub or Old Field
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/> Narrow <5m	<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/> Residential, Park, New Field
<input type="checkbox"/>	<input type="checkbox"/> None	<input type="checkbox"/>	<input type="checkbox"/> Fenced Pasture
		<input type="checkbox"/>	<input type="checkbox"/> Conservation Tillage
		<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/> Urban or Industrial
		<input type="checkbox"/>	<input type="checkbox"/> Open Pasture, Row Crop
		<input type="checkbox"/>	<input type="checkbox"/> Mining or Construction

COMMENTS _____

FLOW REGIME (At Time of Evaluation) (Check ONLY one box):

<input checked="" type="checkbox"/> Stream Flowing	<input type="checkbox"/> Moist Channel, isolated pools, no flow (Intermittent)
<input type="checkbox"/> Subsurface flow with isolated pools (Interstitial)	<input type="checkbox"/> Dry channel, no water (Ephemeral)

COMMENTS _____

SINUOSITY (Number of bends per 61 m (200 ft) of channel) (Check ONLY one box):

<input checked="" type="checkbox"/> None	<input type="checkbox"/> 1.0	<input type="checkbox"/> 2.0	<input type="checkbox"/> 3.0
<input type="checkbox"/> 0.5	<input type="checkbox"/> 1.5	<input type="checkbox"/> 2.5	<input type="checkbox"/> >3

STREAM GRADIENT ESTIMATE

<input type="checkbox"/> Flat (0.5 ft/100 ft)	<input checked="" type="checkbox"/> Flat to Moderate	<input type="checkbox"/> Moderate (2 ft/100 ft)	<input type="checkbox"/> Moderate to Severe	<input type="checkbox"/> Severe (10 ft/100 ft)
---	--	---	---	--

ADDITIONAL STREAM INFORMATION (This information Must Also be Completed):

QHEI PERFORMED? - Yes No QHEI Score _____ (If Yes, Attach Completed QHEI Form)

DOWNSTREAM DESIGNATED USE(S)

WWH Name: Big Walnut Creek Distance from Evaluated Stream 0.67m.
 CWH Name: _____ Distance from Evaluated Stream _____
 EWH Name: _____ Distance from Evaluated Stream _____

MAPPING: ATTACH COPIES OF MAPS, INCLUDING THE ENTIRE WATERSHED AREA. CLEARLY MARK THE SITE LOCATION

USGS Quadrangle Name: New Albany NRCS Soil Map Page: _____ NRCS Soil Map Stream Order _____
 County: Franklin Township / City: Gahanna

MISCELLANEOUS

Base Flow Conditions? (Y/N): Y Date of last precipitation: 2/25/22 Quantity: 0.8"
 Photograph Information: _____
 Elevated Turbidity? (Y/N): N Canopy (% open): 85%
 Were samples collected for water chemistry? (Y/N): N (Note lab sample no. or id. and attach results) Lab Number: _____
 Field Measures: Temp (°C) _____ Dissolved Oxygen (mg/l) _____ pH (S.U.) _____ Conductivity (µmhos/cm) _____
 Is the sampling reach representative of the stream (Y/N) Y If not, please explain: _____


Additional comments/description of pollution impacts: _____

BIOTIC EVALUATION

Performed? (Y/N): N (If Yes, Record all observations. Voucher collections optional. NOTE: all voucher samples must be labeled with the site ID number. Include appropriate field data sheets from the Primary Headwater Habitat Assessment Manual)
 Fish Observed? (Y/N) N Voucher? (Y/N) N Salamanders Observed? (Y/N) N Voucher? (Y/N) N
 Frogs or Tadpoles Observed? (Y/N) N Voucher? (Y/N) N Aquatic Macroinvertebrates Observed? (Y/N) N Voucher? (Y/N) N
 Comments Regarding Biology: _____

DRAWING AND NARRATIVE DESCRIPTION OF STREAM REACH (This must be completed):


Include important landmarks and other features of interest for site evaluation and a narrative description of the stream's location

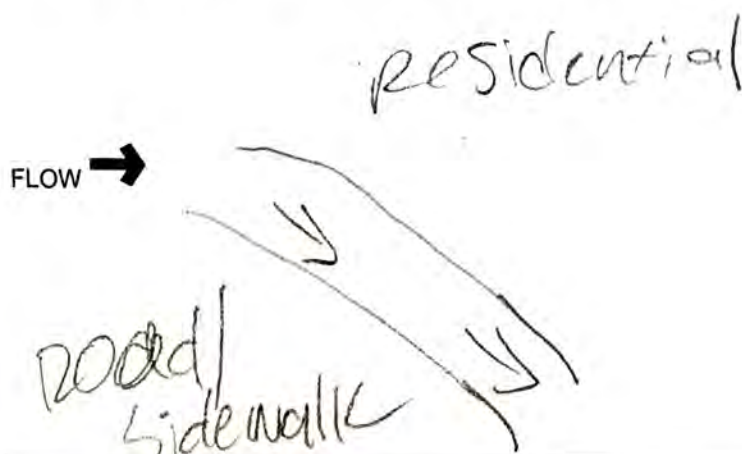



Appendix C | USACE Antecedent Precipitation Tool

Antecedent Precipitation vs Normal Range based on NOAA's Daily Global Historical Climatology Network

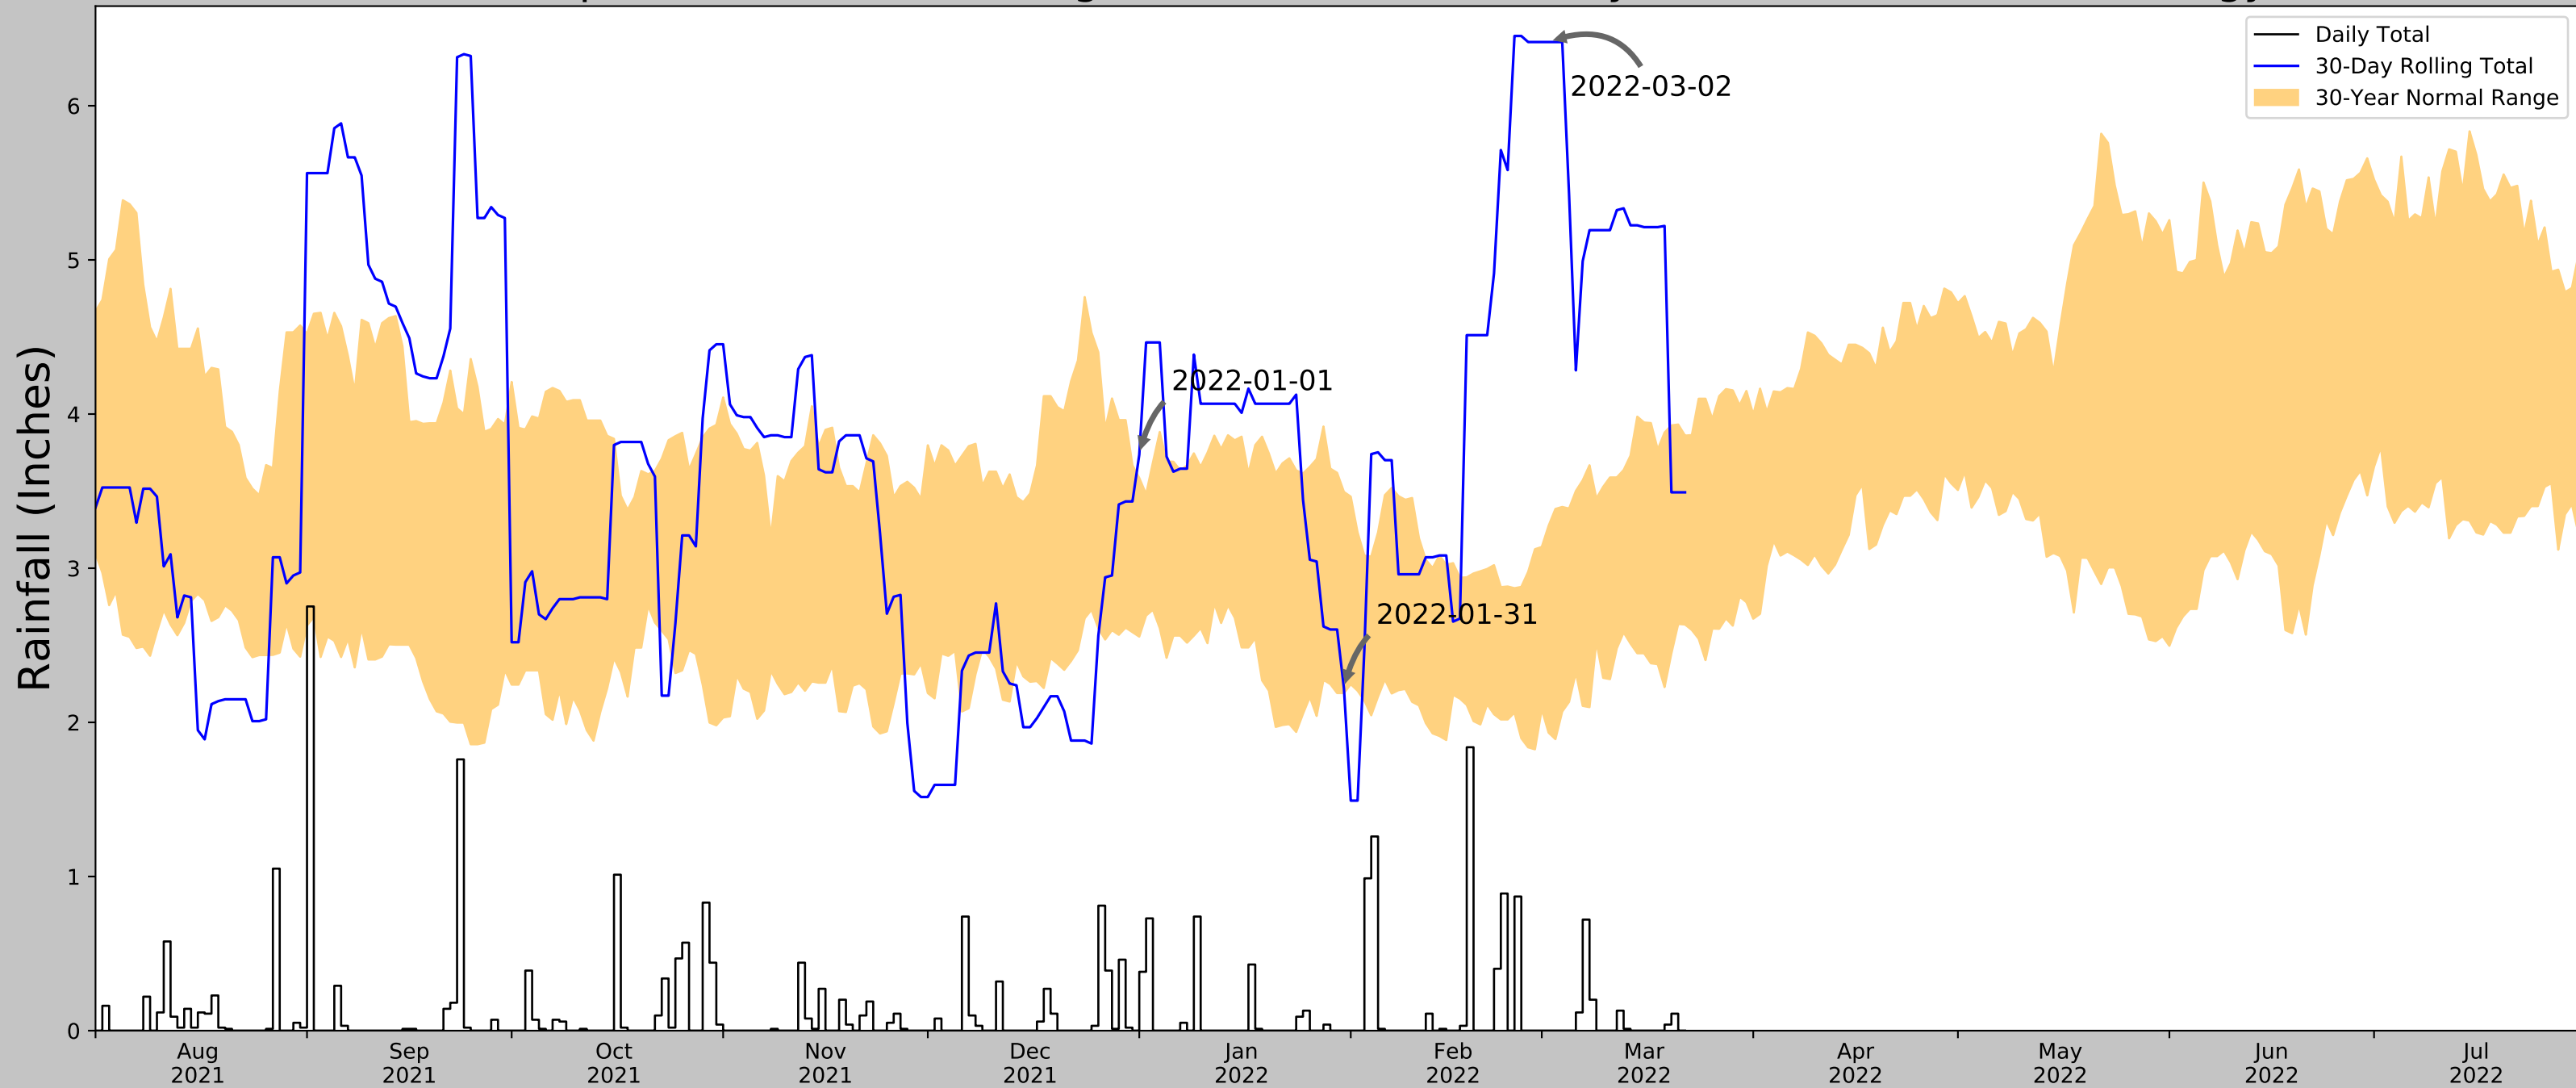

Coordinates	40.011997, -82.572119
Observation Date	2022-03-02
Elevation (ft)	1094.88
Drought Index (PDSI)	Severe wetness (2022-02)
WebWIMP H ₂ O Balance	Wet Season

30 Days Ending	30 th %ile (in)	70 th %ile (in)	Observed (in)	Wetness Condition	Condition Value	Month Weight	Product
2022-03-02	1.933071	3.275197	6.413386	Wet	3	3	9
2022-01-31	2.189764	3.494882	2.220473	Normal	2	2	4
2022-01-01	2.555906	3.585433	3.736221	Wet	3	1	3
Result							Wetter than Normal - 16

Weather Station Name	Coordinates	Elevation (ft)	Distance (mi)	Elevation Δ	Weighted Δ	Days (Normal)	Days (Antecedent)
BUCKEYE LAKE 1 N	39.9522, -82.4819	888.123	6.315	206.757	4.148	11082	90
KIRKERSVILLE 3.3 N	39.998, -82.5986	1075.131	1.703	19.749	0.8	8	0
PATASKALA 3.2 E	39.998, -82.6136	1074.147	2.399	20.733	1.129	7	0
GRANVILLE 2.6 WSW	40.0527, -82.5445	1064.961	3.169	29.919	1.521	10	0
PATASKALA 2.1 ENE	40.013, -82.6381	1171.916	3.492	77.036	1.841	1	0
PATASKALA 2.0 NE	40.024, -82.6511	1216.864	4.261	121.984	2.437	36	0
ALEXANDRIA 2.1 NNW	40.1182, -82.6265	1080.053	7.881	14.827	3.663	32	0
NEWARK HEATH AP	40.0228, -82.4625	883.858	5.848	211.022	3.866	3	0
UTICA 4 WSW	40.2061, -82.52	1134.843	13.691	39.963	6.708	1	0
NEWARK WTR WKS	40.0875, -82.4128	834.974	9.911	259.906	7.036	173	0


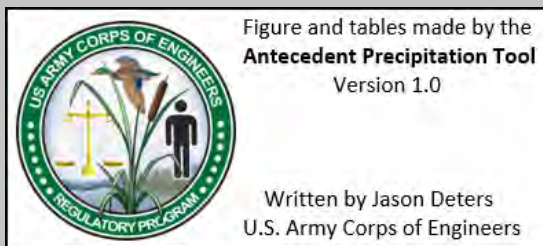


Figure and tables made by the
Antecedent Precipitation Tool
Version 1.0

Written by Jason Deters
U.S. Army Corps of Engineers

Antecedent Precipitation vs Normal Range based on NOAA's Daily Global Historical Climatology Network

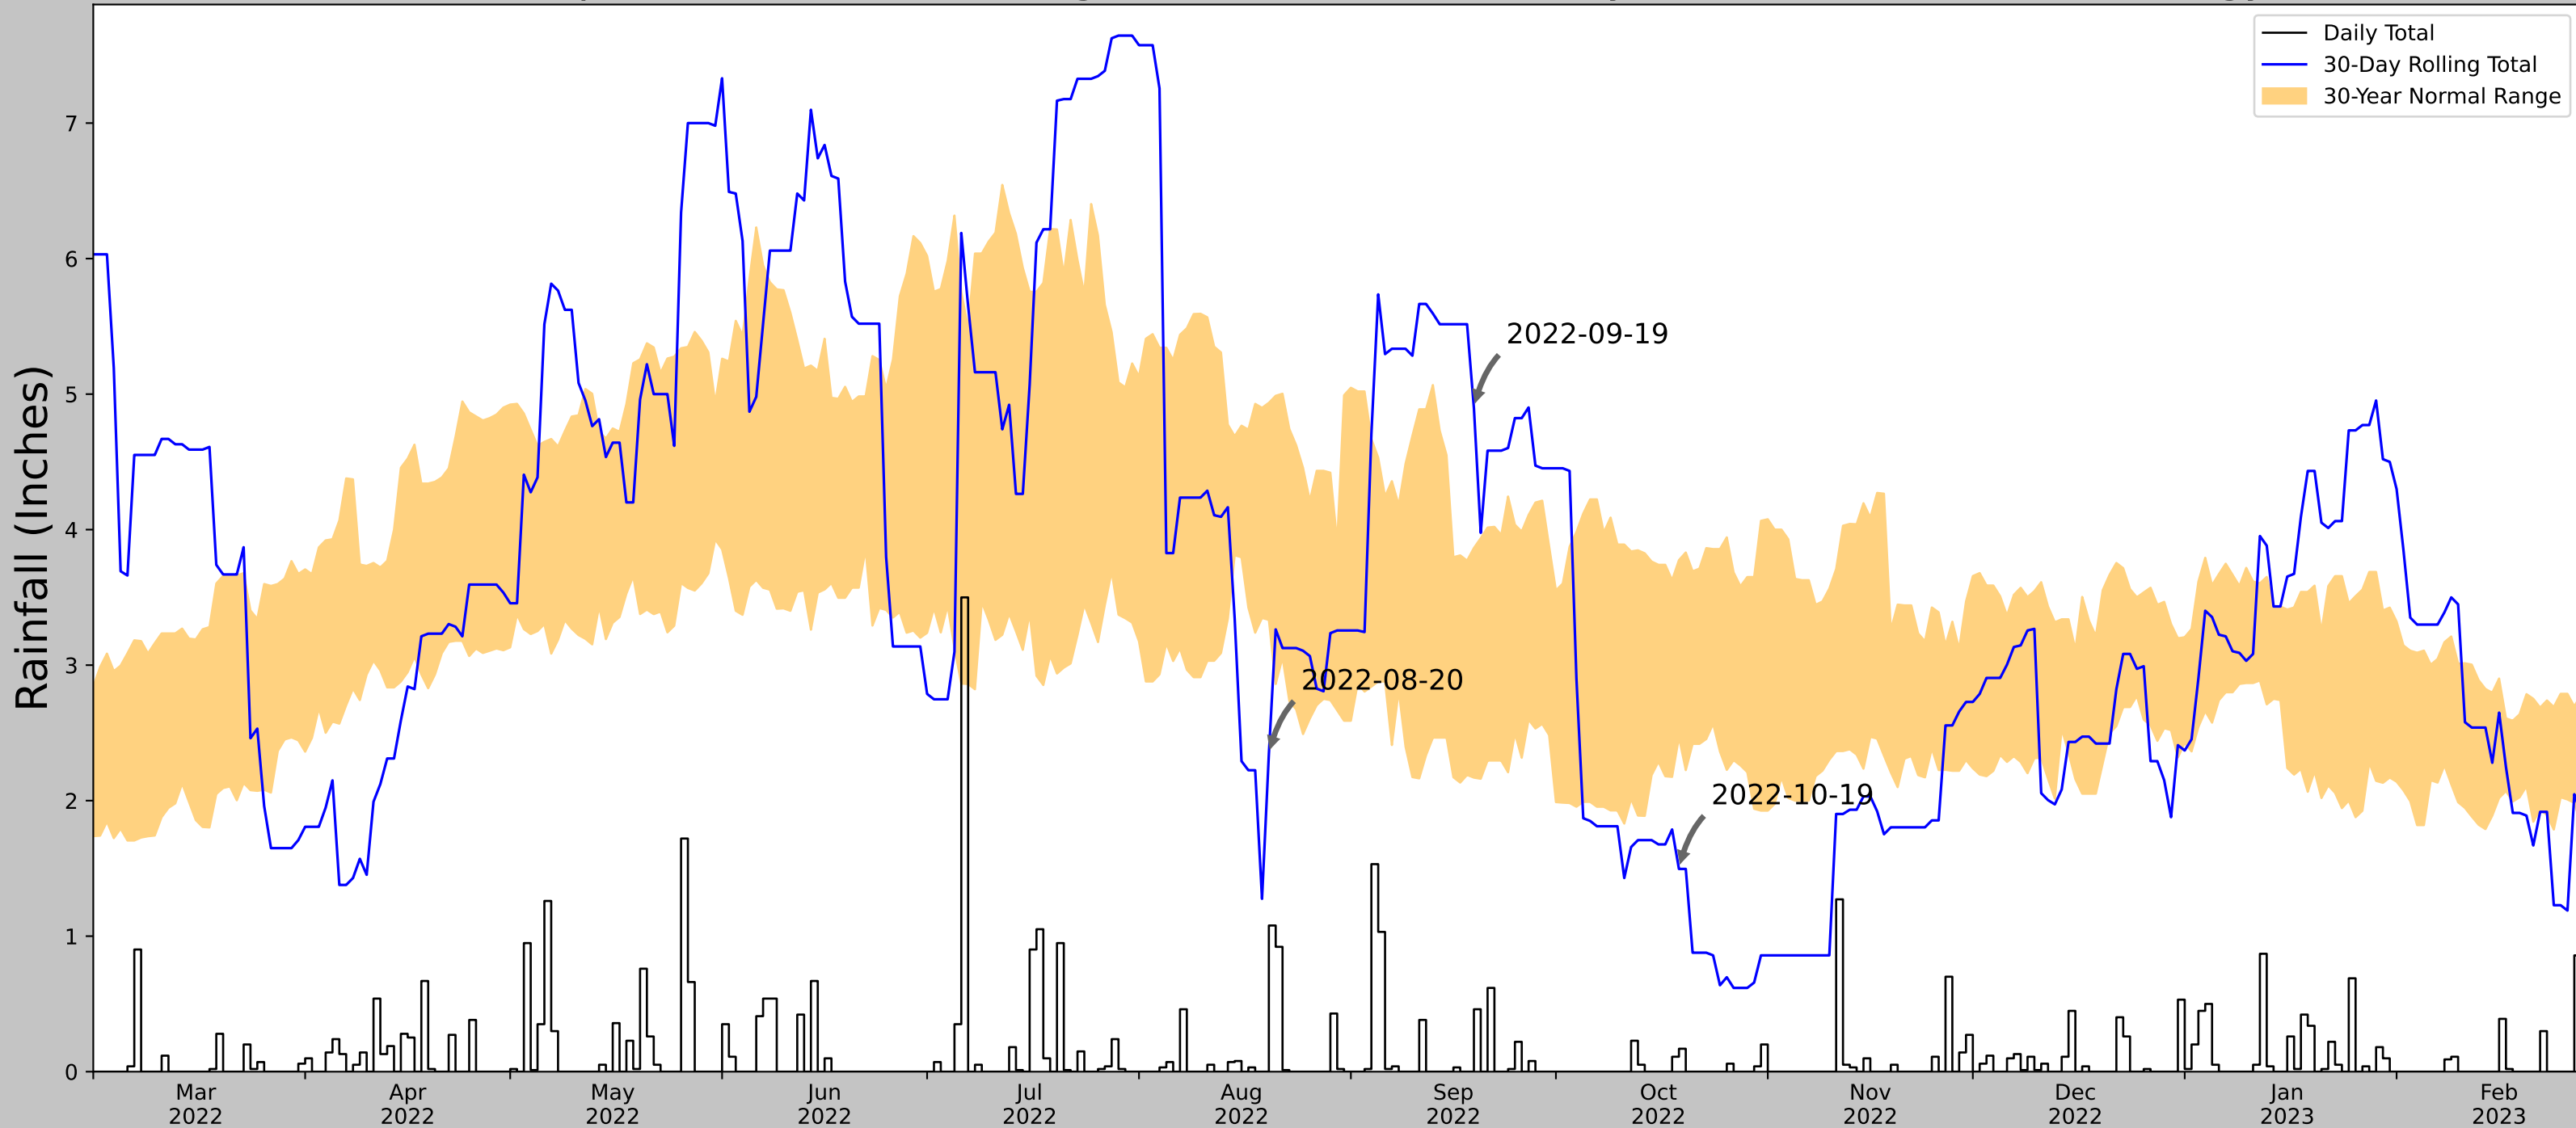

Coordinates	40.021777, -82.950994
Observation Date	2022-10-19
Elevation (ft)	834.369
Drought Index (PDSI)	Moderate wetness
WebWIMP H ₂ O Balance	Wet Season

30 Days Ending	30 th %ile (in)	70 th %ile (in)	Observed (in)	Wetness Condition	Condition Value	Month Weight	Product
2022-10-19	2.468504	3.775197	1.496063	Dry	1	3	3
2022-09-19	2.169685	3.864567	4.897638	Wet	3	2	6
2022-08-20	3.333858	4.935827	2.34252	Dry	1	1	1
Result							Normal Conditions - 10


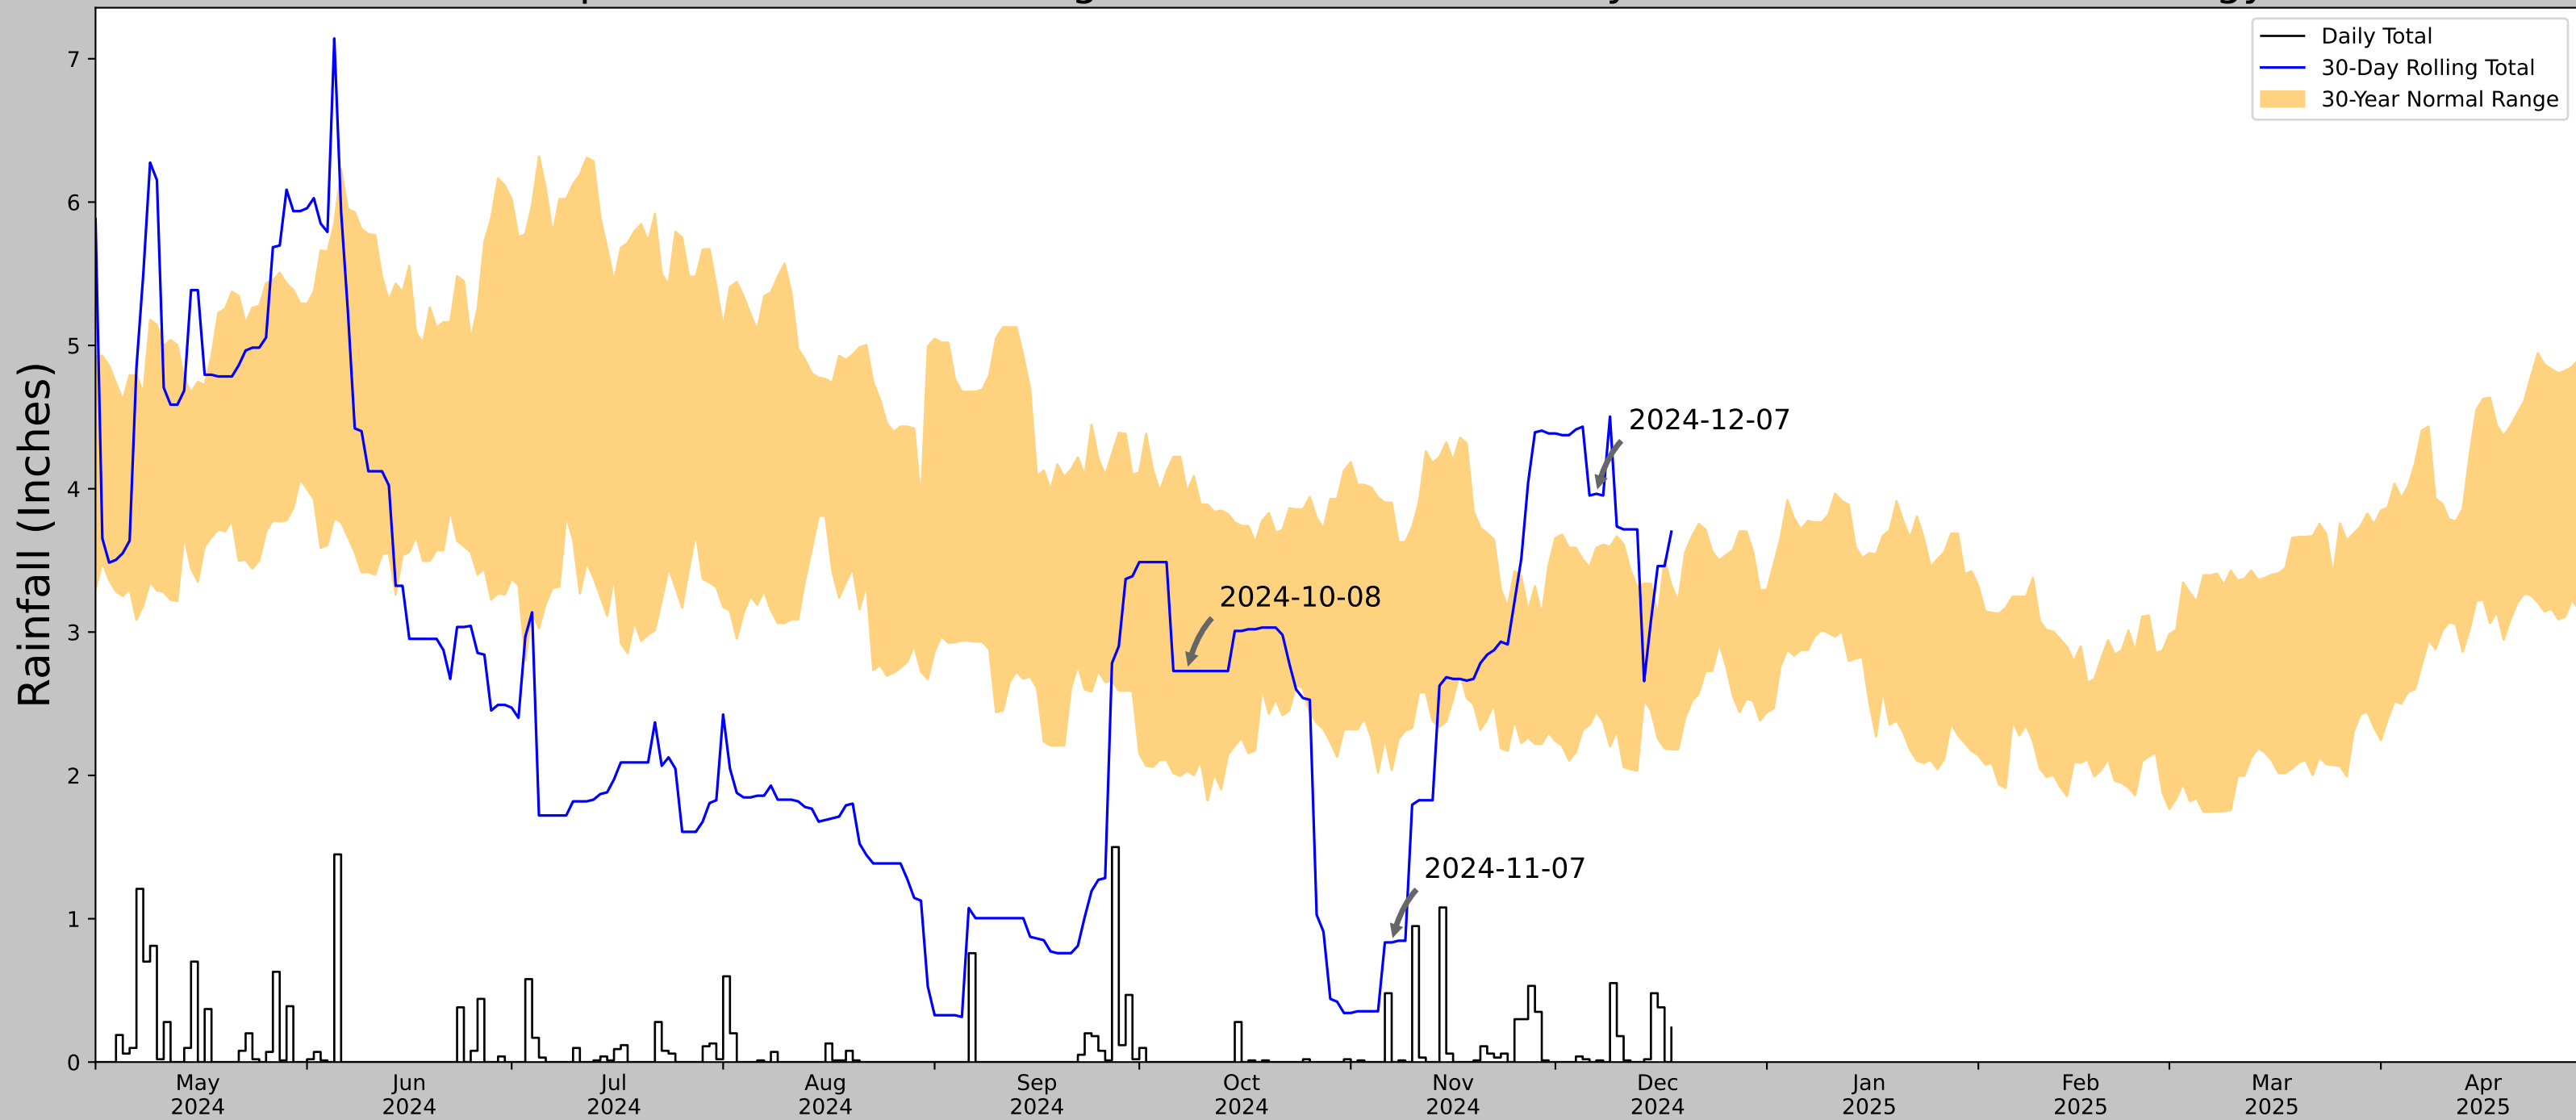


Figure and tables made by the
Antecedent Precipitation Tool
Version 1.0

Written by Jason Deters
U.S. Army Corps of Engineers

Weather Station Name	Coordinates	Elevation (ft)	Distance (mi)	Elevation Δ	Weighted Δ	Days Normal	Days Antecedent
COLUMBUS-HAP CREMEAN WP	40.0603, -82.8942	831.037	4.014	3.332	1.82	10742	90
COLUMBUS 8.2 NE	40.0639, -82.8673	955.053	1.444	124.016	0.829	7	0
COLUMBUS 3.5 NE	40.0287, -82.9477	833.005	3.574	1.968	1.615	2	0
WESTERVILLE 0.2 WNW	40.1226, -82.9213	886.155	4.537	55.118	2.292	43	0
JOHN GLENN INTL AP	39.9906, -82.8769	810.039	4.902	20.998	2.309	559	0

Antecedent Precipitation vs Normal Range based on NOAA's Daily Global Historical Climatology Network



Coordinates	40.020811, -82.922588
Observation Date	2024-12-07
Elevation (ft)	828.822
Drought Index (PDSI)	Severe drought (2024-11)
WebWIMP H ₂ O Balance	Wet Season

30 Days Ending	30 th %ile (in)	70 th %ile (in)	Observed (in)	Wetness Condition	Condition Value	Month Weight	Product
2024-12-07	2.442126	3.587795	3.964567	Wet	3	3	9
2024-11-07	2.036221	3.903937	0.834646	Dry	1	2	2
2024-10-08	2.032284	3.978347	2.728347	Normal	2	1	2
Result							Normal Conditions - 13

Figure and tables made by the
Antecedent Precipitation Tool
Version 1.0

Written by Jason Deters
U.S. Army Corps of Engineers

Weather Station Name	Coordinates	Elevation (ft)	Distance (mi)	Elevation Δ	Weighted Δ	Days Normal	Days Antecedent
COLUMBUS-HAP CREMEAN WP	40.0603, -82.8942	831.037	3.114	2.215	1.408	10771	78
COLUMBUS 8.2 NE	40.0639, -82.8673	955.053	1.444	124.016	0.829	8	11
GAHANNA 1.2 NNE	40.0408, -82.868	874.016	1.933	42.979	0.953	0	1
COLUMBUS 3.5 NE	40.0287, -82.9477	833.005	3.574	1.968	1.615	2	0
WESTERVILLE 3.0 ESE	40.1107, -82.8622	875.0	3.871	43.963	1.912	1	0
WESTERVILLE 0.2 WNW	40.1226, -82.9213	886.155	4.537	55.118	2.292	43	0
JOHN GLENN INTL AP	39.9906, -82.8769	810.039	4.902	20.998	2.309	528	0



Appendix D | Photographs

Site Photographs

December 17, 2024

CED Project No. 21004202A



Photo #1 -Looking east at Wetland 8; near wetland flag W8.4

Site Photographs

December 17, 2024

CED Project No. 21004202A



Photo #2: Looking at west at upland woodlands near wetland flag W8.4.

Site Photographs

December 17, 2024

CED Project No. 21004202A



Photo #3: Looking north at Wetland 9; near wetland flag W9.5

Site Photographs

December 17, 2024

CED Project No. 21004202A



Photo #4: Looking at west at upland maintained lawn/early successional vegetation near wetland flag W9.5.

Site Photographs

December 17, 2024

CED Project No. 21004202A



Photo #5: Looking north at typical conditions at Stelzer inlet.

Site Photographs

December 17, 2024

CED Project No. 21004202A



Photo #6: Looking north at typical conditions at Stygler inlet.



Colliers Engineering & Design is a trusted provider of multi-discipline engineering, design and consulting services providing customized solutions for public and private clients through a network of offices nationwide.

For a full listing of our office locations, please visit colliersengineering.com

1 877 627 3772



*Civil/Site • Traffic/Transportation • Governmental • Survey/Geospatial
Infrastructure • Geotechnical/Environmental • Telecommunications • Utilities/Energy*